

# TRANSURANIC WASTE ACCEPTANCE CRITERIA FOR THE WASTE ISOLATION PILOT PLANT

Revision 8.0

Effective Date: July 5, 2016



This document supersedes DOE/WIPP 02-3122, Rev. 7.4

**U.S. Department of Energy  
Carlsbad Field Office**

This document has been submitted as required to:

Office of Scientific and Technical Information  
U.S. Department of Energy  
PO Box 62  
Oak Ridge, TN 37831  
(865) 576-8401

Additional information about this document may be obtained by calling 1-800-336-9477.

Unlimited, publicly available full-text scientific and technical reports produced since 1991 are available online at Information Bridge ([www.osti.gov/bridge](http://www.osti.gov/bridge)).

U.S. Department of Energy and its contractors may obtain full-text reports produced prior to 1991 in paper form, for a processing fee, from:

U.S. Department of Energy  
Office of Scientific and Technical Information  
P.O. Box 62  
Oak Ridge, TN 37831-0062  
Phone: (865) 576-8401  
Fax: (865) 576-5728  
Email: [reports@osti.gov](mailto:reports@osti.gov)

Available for sale to the public from:

U.S. Department of Commerce  
National Technical Information Service  
5301 Shawnee Rd  
Alexandria, VA 22312  
Phone: (800) 553-6847 or (703) 605-6000  
Fax: (703) 605-6900  
Email: [info@ntis.gov](mailto:info@ntis.gov)

# TRANSURANIC WASTE ACCEPTANCE CRITERIA FOR THE WASTE ISOLATION PILOT PLANT

Revision 8.0

Effective Date: July 5, 2016

Approved by:

//Signature on File//

J.R. Stroble

Director, TRU Sites and Transportation Division

Date: June 21, 2016

Concurred by:

//Signature on File//

Todd Shrader

Manager, Carlsbad Field Office

Date: June 21, 2016

TABLE OF CONTENTS

1.0	INTRODUCTION .....	15
2.0	RESPONSIBILITIES.....	19
2.1	DOE Headquarters .....	19
2.2	DOE Carlsbad Field Office (CBFO) .....	19
2.3	DOE Sites.....	20
2.3.1	DOE Field Elements.....	20
2.3.2	WIPP Management and Operating (M&O) Contractor .....	20
2.4	WIPP Certified Programs (CCP by site and contractor for the Idaho AMWTP) .....	21
3.0	WASTE ACCEPTANCE REQUIREMENTS AND CRITERIA FOR CH WASTE ...	22
3.1	Summary of WIPP Authorization Basis.....	22
3.1.1	DOE Operations and Safety Requirements for WIPP .....	23
3.1.2	NRC Transportation Safety Requirements.....	23
3.1.3	NMED Hazardous Waste Facility Permit Requirements .....	24
3.1.4	EPA Requirements.....	24
3.1.4.1	EPA Compliance Recertification Decision .....	24
3.1.4.2	EPA Approval for PCB Disposal.....	25
3.1.5	WIPP Land Withdrawal Act Requirements.....	25
3.2	Container Properties .....	26
3.2.1	Description .....	26
3.2.2	Weight Limits and Center of Gravity.....	27
3.2.3	Assembly Configurations .....	27
3.2.4	Removable Surface Contamination.....	27
3.2.5	Identification/Labeling .....	27
3.2.6	Dunnage .....	28
3.2.7	Filter Vents.....	29
3.3	Radiological Properties .....	29
3.3.1	Radionuclide Composition .....	30
3.3.2	<sup>239</sup> Pu Fissile Gram Equivalent.....	31
3.3.3	TRU Alpha Activity Concentration.....	34
3.3.4	<sup>239</sup> Pu Equivalent Activity.....	35
3.3.5	Radiation Dose Equivalent Rate .....	36
3.3.6	Decay Heat .....	37
3.4	Physical Properties .....	37
3.4.1	Observable Liquid .....	37
3.4.2	Sealed Containers.....	38
3.5	Chemical Properties .....	38
3.5.1	Pyrophoric Materials .....	38
3.5.2	Hazardous Waste.....	38
3.5.3	Chemical Compatibility.....	39
3.5.4	Explosives, Corrosives, and Compressed Gases .....	39
3.5.5	Headspace Gas Concentrations .....	39
3.5.6	Polychlorinated Biphenyls.....	39

---

3.6	Data Package Contents .....	40
	3.6.1 Characterization and Certification Data.....	40
	3.6.2 Shipping Data.....	40
4.0	WASTE ACCEPTANCE REQUIREMENTS AND CRITERIA FOR RH WASTE ...	41
4.1	Summary of WIPP Authorization Basis.....	41
	4.1.1 DOE Operations and Safety Requirements for WIPP .....	42
	4.1.2 NRC Transportation Safety Requirements.....	42
	4.1.3 NMED Hazardous Waste Facility Permit Requirements .....	43
	4.1.4 EPA Requirements.....	43
	4.1.4.1 EPA Compliance Recertification Decision .....	43
	4.1.4.2 EPA Approval for PCB Disposal.....	44
	4.1.5 WIPP Land Withdrawal Act Requirements.....	44
4.2	Container Properties .....	45
	4.2.1 Description .....	45
	4.2.2 Weight Limits.....	45
	4.2.3 Assembly Configurations .....	46
	4.2.4 Removable Surface Contamination.....	46
	4.2.5 Identification/Labeling .....	46
	4.2.6 Dunnage .....	47
	4.2.7 Filter Vents.....	47
4.3	Radiological Properties .....	47
	4.3.1 Radionuclide Composition .....	48
	4.3.2 <sup>239</sup> Pu Fissile Gram Equivalent/ <sup>235</sup> U Fissile Equivalent Mass (FEM) .....	49
	4.3.3 TRU Alpha Activity Concentration .....	51
	4.3.4 <sup>239</sup> Pu Equivalent Activity.....	52
	4.3.5 Radiation Dose Equivalent Rate .....	52
	4.3.6 Decay Heat .....	52
4.4	Physical Properties .....	53
	4.4.1 Observable Liquid .....	53
	4.4.2 Sealed Containers.....	54
	4.4.3 Physical Form .....	54
4.5	Chemical Properties .....	54
	4.5.1 Pyrophoric Materials .....	54
	4.5.2 Hazardous Waste.....	54
	4.5.3 Chemical Compatibility.....	55
	4.5.4 Explosives, Corrosives, and Compressed Gases .....	55
	4.5.5 Headspace Gas Concentrations .....	55
	4.5.6 Polychlorinated Biphenyls .....	55
4.6	Data Package Contents .....	56
	4.6.1 Characterization and Certification Data.....	56
	4.6.2 Shipping Data.....	56
5.0	QUALITY ASSURANCE REQUIREMENTS .....	57
5.1	Waste Characterization Quality Assurance Requirements .....	57
5.2	Waste Certification Quality Assurance Requirements.....	57

5.3	Waste Transportation Quality Assurance Requirements .....	58
6.0	REFERENCES .....	59

LIST OF APPENDICES

Appendix A	Radioassay Requirements for Transuranic Waste .....	64
Appendix B	<sup>239</sup> Pu Equivalent Activity .....	84
Appendix C	Glossary .....	87
Appendix D	Payload Container Integrity Checklist .....	96
Appendix E	Payload Management of TRU Alpha Activity Concentration .....	100
Appendix F	Radiography Requirements for Contact-Handled Transuranic Waste for EPA Compliance .....	103
Appendix G	Visual Examination Requirements for Contact-Handled Transuranic Waste for EPA Compliance .....	110
Appendix H	Enhanced Acceptable Knowledge .....	115
Appendix I	Previously Certified Waste Preclusion of Shipments .....	122

LIST OF FIGURES

Figure 1.0	Regulatory Basis of TRU Waste Acceptance Criteria .....	16
------------	---	----

LIST OF TABLES

Table 1	<sup>239</sup> Pu FGE Limits for CH-TRU Waste Payload Containers .....	32
Table 2	PE-Ci Limits for CH-TRU Waste Payload Containers .....	36
Table 3	<sup>239</sup> Pu FGE Limits for a Canister Shipped in an RH-TRU 72-B Package .....	50
Table 4	<sup>239</sup> Pu FGE Limits for Drums Shipped in a 10-160B Package .....	51
Table 5	<sup>235</sup> U FEM Limit for a Canister Shipped in an RH-TRU 72-B Package .....	51
Table 6	PE-Ci Limits for RH-TRU Waste Payload Containers .....	52
Table A-1	Data Quality Objectives for Radioassay .....	70
Table A-2	Upper Limits for %RSD vs. Number of Replicates .....	74
Table A-3	Range of Applicability .....	76
Table A-4	Quality Control Requirements for Radiochemistry .....	77
Table B-1	PE-Ci Weighting Factors for Selected Radionuclides .....	86

## CHANGE HISTORY

DOE/WIPP-02-3122, Revision 0, Effective Date: May 17, 2002, *Contact-Handled Transuranic Waste Acceptance Criteria for the Waste Isolation Pilot Plant*, superseded DOE/WIPP-069, Revision 7, Interim Change Notice #2, Waste Acceptance Criteria for the Waste Isolation Pilot Plant.

DOE/WIPP-02-3122, Revision 0.1, Effective Date: July 25, 2002, *Contact-Handled Transuranic Waste Acceptance Criteria for the Waste Isolation Pilot Plant*, superseded DOE/WIPP-02-3122, Revision 0.

DOE/WIPP-02-3122, Revision 1, Effective Date: March 1, 2004, *Contact-Handled Transuranic Waste Acceptance Criteria for the Waste Isolation Pilot Plant*, superseded DOE/WIPP-02-3122, Revision 0.1.

DOE/WIPP-02-3122, Revision 2.0, Effective Date: November 15, 2004, *Contact-Handled Transuranic Waste Acceptance Criteria for the Waste Isolation Pilot Plant*, superseded DOE/WIPP-02-3122, Revision 1.

DOE/WIPP-02-3122, Revision 2.1, Effective Date: March 19, 2005, *Contact-Handled Transuranic Waste Acceptance Criteria for the Waste Isolation Pilot Plant*, superseded DOE/WIPP-02-3122, Revision 2.0.

DOE/WIPP-02-3122, Revision 3.0, Effective Date: April 25, 2005, *Contact-Handled Transuranic Waste Acceptance Criteria for the Waste Isolation Pilot Plant*, superseded DOE/WIPP-02-3122, Revision 2.1.

DOE/WIPP-02-3122, Revision 4.0, Effective Date: December 29, 2005, *Contact-Handled Transuranic Waste Acceptance Criteria for the Waste Isolation Pilot Plant*, superseded DOE/WIPP-02-3122, Revision 3.0.

DOE/WIPP-02-3122, Revision 5.0, Effective Date: Revision Cancelled, *Transuranic Waste Acceptance Criteria for the Waste Isolation Pilot Plant*.

DOE/WIPP-02-3122, Revision 6.0, Effective Date: November 14, 2006, *Transuranic Waste Acceptance Criteria for the Waste Isolation Pilot Plant*, superseded DOE/WIPP-02-3122, Revision 4.0.

DOE/WIPP-02-3122, Revision 6.1, Effective Date: October 29, 2007, *Transuranic Waste Acceptance Criteria for the Waste Isolation Pilot Plant*, superseded DOE/WIPP-02-3122, Revision 6.0.

CHANGE HISTORY (Continued)

DOE/WIPP-02-3122, Revision 6.2, Effective Date: May 30, 2008, *Transuranic Waste Acceptance Criteria for the Waste Isolation Pilot Plant*, superseded  
DOE/WIPP-02-3122, Revision 6.1.

DOE/WIPP-02-3122, Revision 6.3, Effective Date: February 5, 2009, *Transuranic Waste Acceptance Criteria for the Waste Isolation Pilot Plant*, superseded  
DOE/WIPP-02-3122, Revision 6.2.

DOE/WIPP-02-3122, Revision 6.4, Effective Date: December 10, 2009, *Transuranic Waste Acceptance Criteria For The Waste Isolation Pilot Plant*, superseded  
DOE/WIPP-02-3122, Revision 6.3.

DOE/WIPP-02-3122, Revision 6.5, Effective Date: June 30, 2010, *Transuranic Waste Acceptance Criteria for the Waste Isolation Pilot Plant*, superseded  
DOE/WIPP-02-3122, Revision 6.4.

DOE/WIPP-02-3122, Revision 7.0, Effective Date: December 29, 2010, *Transuranic Waste Acceptance Criteria for the Waste Isolation Pilot Plant*, superseded  
DOE/WIPP-02-3122, Revision 6.5.

DOE/WIPP-02-3122, Revision 7.1, Effective Date: April 21, 2011, *Transuranic Waste Acceptance Criteria for the Waste Isolation Pilot Plant*, superseded  
DOE/WIPP-02-3122, Revision 7.0.

DOE/WIPP-02-3122, Revision 7.2, Effective Date: June 13, 2011, *Transuranic Waste Acceptance Criteria for the Waste Isolation Pilot Plant*, superseded  
DOE/WIPP-02-3122, Revision 7.1.

DOE/WIPP-02-3122, Revision 7.3, Effective Date: February 18, 2013, *Transuranic Waste Acceptance Criteria for the Waste Isolation Pilot Plant*, superseded  
DOE/WIPP-02-3122, Revision 7.2.

DOE/WIPP-02-3122, Revision 7.4, Effective Date: April 22, 2013, *Transuranic Waste Acceptance Criteria for the Waste Isolation Pilot Plant*, superseded  
DOE/WIPP-02-3122, Revision 7.3.



## CHANGE HISTORY (Continued)

DOE/WIPP-02-3122, Revision 8.0, Effective Date: July, 5, 2016 , *Transuranic Waste Acceptance Criteria for the Waste Isolation Pilot Plant*, supersedes DOE/WIPP-02-3122, Revision 7.4.

Remote-handled TRU waste shipments to WIPP are not authorized under Revision 5b of the WIPP Documented Safety Analysis, DOE/WIPP 07-3372, as this activity will not be implemented as part of the contact-handled waste emplacement restart.

Revision 8.0 has added the WIPP Management and Operating (M&O) Contractor to the list of responsible organizations identified in section 2.0. Folded into the responsibilities of the WIPP M&O Contractor are the five key elements of the WIPP WAC Compliance Program identified in Chapter 18 of the DSA.

After the 2014 radiological release event, several new activities and process enhancements were established. Enhancements to AK and the required new processes are addressed in Appendix H. Appendix I lists the requirements imposed on previously certified waste prior to shipment to WIPP.

To provide consistency with other authorization basis documents, a change in terminology from site-specific TRAMPAC to programmatic or waste-specific TRAMPAC has been made throughout the document. Similarly, a change in terminology from generator site programs to WIPP certified programs (CCP by site and the contractor for the AMWTP) has been made throughout the document.

Revision 8.0 also incorporates the addition of a new CH-TRU waste payload container referred to as a criticality control overpack (CCO). As a result of adding the CCO to the list of approved CH-TRU waste payload containers, updates have been made to the lists of acronyms, references, and definitions in addition to sections 3.2 (Container Properties), 3.3.2 ( $^{239}\text{Pu}$  Fissile Gram Equivalent), 3.3.4 ( $^{239}\text{Pu}$  Equivalent Activity), and 3.3.5 (Rational Dose Equivalent Rate).

A prohibition has been added to the listing of authorized payload container types in section 3.2.1 that states, "waste streams packaged in POCs or CCOs that contain combustibles are excluded from shipment to the WIPP, excluding radiological control materials and packaging materials normally used to load the containers." Also, in section 3.3.6, wastes assigned to TRUCON Code 154 are prohibited at the WIPP (Reference 4, Section 3.3.2.3).

## CHANGE HISTORY (Continued)

In Table 2 of section 3.3.4, several changes have been made including the addition of a footnote to address the disposition of payload containers that exceed the PE-Ci limit and the application of PE-Ci limits to CCOs and POCs.

In section 3.3.5 (Radiation Dose Equivalent Rate) clarification has been added that SLB2 payload containers meeting the radiation dose equivalent rate requirements without shielding may be shielded to levels that are ALARA.

Changes to sections 3.4.1 and 4.4.1 addressing observable liquid in PCB/TRU and PCB/TRU mixed bulk product waste containers are the result of the EPA Region 6 reauthorization approval to the Waste Isolation Pilot Plant for the storage and disposal of PCBs (Reference 13). The glossary has been updated to include the definition of "PCB bulk product waste," together with the deletion of the definitions for "test category" and "volatile organic compounds." These two terms no longer appear in the document.

Other additions to the glossary include the terms "criticality control overpack", "minimum detectable activity", "PCB bulk product material", "shipper", and "WIPP Certified Program."

The fissile material exemption of 10 CFR §71.15 has been added as an alternative to meeting the FGE and FEM requirements in either Table 3 or Table 4 of section 4.3.2, respectively. The 10 CFR §71.15 fissile material exemption provides an alternative to the requirements.

Appendix A was expanded to include the radioassay of both CH- and RH-TRU waste as highlighted by its new title, "Radioassay Requirements for Transuranic Waste." The use of the terms minimum detectable activity (MDA) and lower limit of detection was clarified. Several newer concepts such as ASTM-approved methods for efficiency-based calibrations and the use of computer modeling techniques for calibration were also added. Finally, clarification and strengthening of the requirements and methods for NDA system quality control and documentation were added to adjust for the elimination of the requirement for weekly interfering matrix measurements.

Changes to Appendix F, "Radiography Requirements for Contact-Handled Transuranic Waste for EPA Compliance," have been made to address issues identified by EPA during an inspection of Los Alamos National Laboratory (LANL-CCP-CC-CH-2015). These changes to Appendix F more clearly reflect the requirements of 40 CFR Part 194 to identify and estimate the CPR and metal content of individual waste containers.

Other changes include updates to internet links, typographical corrections, elimination of redundancy, and renumbering the references.

INDEX OF CURRENT REVISION/CHANGE NUMBER BY PAGE

<u>PAGE NUMBER</u>	<u>REVISION NUMBER</u>	<u>PAGE NUMBER</u>	<u>REVISION NUMBER</u>
All pages	8.0		

LIST OF ACRONYMS AND ABBREVIATIONS

AK	acceptable knowledge
ALARA	as low as reasonably achievable
AMAD	activity mean aerodynamic diameter
AMWTP	Advanced Mixed Waste Treatment Project
ASTM	American Society for Testing and Materials
ANSI	American National Standards Institute
CBFO	Carlsbad Field Office
CCEM	Chemical Compatibility Evaluation Memo
CCO	criticality control overpack
CCP	Central Characterization Program
CFR	Code of Federal Regulations
CH	contact-handled
CH-TRAMPAC	Contact-Handled Transuranic Waste Authorized Methods for Payload Control
Ci	curie
CPR	cellulose, plastic, and rubber
DOE	U.S. Department of Energy
DOT	U.S. Department of Transportation
dpm	disintegrations per minute
DQO	data quality objective
DSA	Documented Safety Analysis
EPA	U.S. Environmental Protection Agency
FEIS	Final Environmental Impact Statement
FEM	fissile equivalent mass
FGE	fissile gram equivalent
HWFP	Hazardous Waste Facility Permit
IWMDL	Interface Waste Management Documents List
keV	kiloelectron volt
LCS	laboratory control sample
LLD	lower limit of detection
LWA	Land Withdrawal Act
MAR	material at risk
MDA	minimum detectable activity
MOA	Memorandum of Agreement

LIST OF ACRONYMS AND ABBREVIATIONS (Continued)

M&O	Management and Operating
mrem	milliroentgen equivalent man
MS	matrix spike
MSD	matrix spike duplicate
nCi/g	nanocuries per gram
NDA	nondestructive assay
NEPA	National Environmental Policy Act
NMAC	New Mexico Administrative Code
NMED	New Mexico Environment Department
NRC	U.S. Nuclear Regulatory Commission
NTP	National TRU Program
OJT	On-the-Job Training
PCB	polychlorinated biphenyl
PE-Ci	Plutonium-239 equivalent curie
POC	pipe overpack container
QA	quality assurance
QAPD	Quality Assurance Program Document
QAO	quality assurance objective
QAPjP	quality assurance project plan
QC	quality control
RC	radiochemistry
RCRA	Resource Conservation and Recovery Act
rem	roentgen equivalent man
RH	remote-handled
RH-TRAMPAC	Remote-Handled Transuranic Waste Authorized Methods for Payload Control
%R	percent recovery
RPD	relative percent difference
RSD	relative standard deviation
SAR	Safety Analysis Report
SEIS	Supplemental Environmental Impact Statement
SLB2	standard large box 2
SNM	special nuclear material
SME	subject matter expert
SPM	Site Project Manager
SWB	standard waste box

LIST OF ACRONYMS AND ABBREVIATIONS (Continued)

TDOP	ten-drum overpack
TMU	total measurement uncertainty
TRAMPAC	Transuranic Waste Authorized Methods for Payload Control
TRU	transuranic
TRUPACT-II	Transuranic Package Transporter-II
TRUPACT-III	Transuranic Package Transporter-III
TSDF	Treatment, Storage, and Disposal Facility
VE	visual examination
WAC	Waste Acceptance Criteria
WAP	Waste Analysis Plan
WCP	WIPP Certified Program
WCPIP	Waste Characterization Program Implementation Plan
WDS	Waste Data System
WIPP	Waste Isolation Pilot Plant
WMC	Waste Matrix Code
WSPF	Waste Stream Profile Form
WWIS	WIPP Waste Information System

## 1.0 INTRODUCTION


The purpose of this document is to summarize the waste acceptance criteria (WAC) applicable to the transportation, storage, and disposal of contact-handled (CH) and remote-handled (RH) transuranic (TRU) waste at the Waste Isolation Pilot Plant (WIPP). These criteria serve as the U.S. Department of Energy's (DOE's) primary directive for ensuring that CH and RH TRU waste is managed and disposed of in a manner that protects human health and safety and the environment.

The WIPP authorization basis for the disposal of CH and RH TRU waste includes the DOE National Security and Military Applications of Nuclear Energy Authorization Act of 1980 (Reference 1) and the WIPP Land Withdrawal Act (LWA; Reference 2). Included in this document are the requirements and associated criteria imposed by these acts and the Resource Conservation and Recovery Act (RCRA; Reference 3), as amended, on the TRU waste destined for disposal at the WIPP.

The WIPP Certified Programs (WCPs) must certify CH and RH TRU waste payload containers to the waste acceptance criteria identified in this document. As shown in Figure 1.0, Regulatory Basis of TRU Waste Acceptance Criteria, the flow-down of applicable requirements to the WAC is traceable to several higher-tier documents, including the WIPP safety requirements taken from the WIPP Documented Safety Analysis (DSA; Reference 4); the transportation requirements for CH wastes derived from the Transuranic Package Transporter-II (TRUPACT-II), Transuranic Package Transporter-III (TRUPACT-III), and HalfPACT Certificates of Compliance (References 5, 6, and 7); the transportation requirements for RH wastes derived from the RH-TRU 72-B and 10-160B Certificates of Compliance (References 8 and 9); the WIPP LWA (Reference 2); the WIPP Hazardous Waste Facility Permit (HWFP; Reference 10); the U.S. Environmental Protection Agency's (EPA's) Compliance Recertification Decision and approval for polychlorinated biphenyls (PCBs) disposal (References 11, 12, 13, 14, 15, and 16); and the EPA's letter of approval of DOE's RH TRU Waste Characterization Program (Reference 17). The dotted arrows shown in Figure 1.0 represent the flow-down of summary-level requirements from top-tier WIPP program documents. The solid arrows represent the flow-down of individual payload container-based requirements that serve to identify the most restrictive overlapping conditions, limitations, and prohibitions relating to the physical, chemical, and radiological attributes of the waste as well as the properties of the applicable payload containers.

This WAC does not address the subject of waste characterization relating to a determination of whether the waste is hazardous; rather, the WCPs are referred to the Waste Analysis Plan (WAP) contained in the WIPP HWFP (Reference 10) for details of the protocols to be used in determining compliance with the HWFP-required physical and chemical properties of the waste. Requirements and associated criteria pertaining to a determination of the radiological properties of TRU waste, however, are addressed in Appendix A.

Figure 1.0 Regulatory Basis of TRU Waste Acceptance Criteria

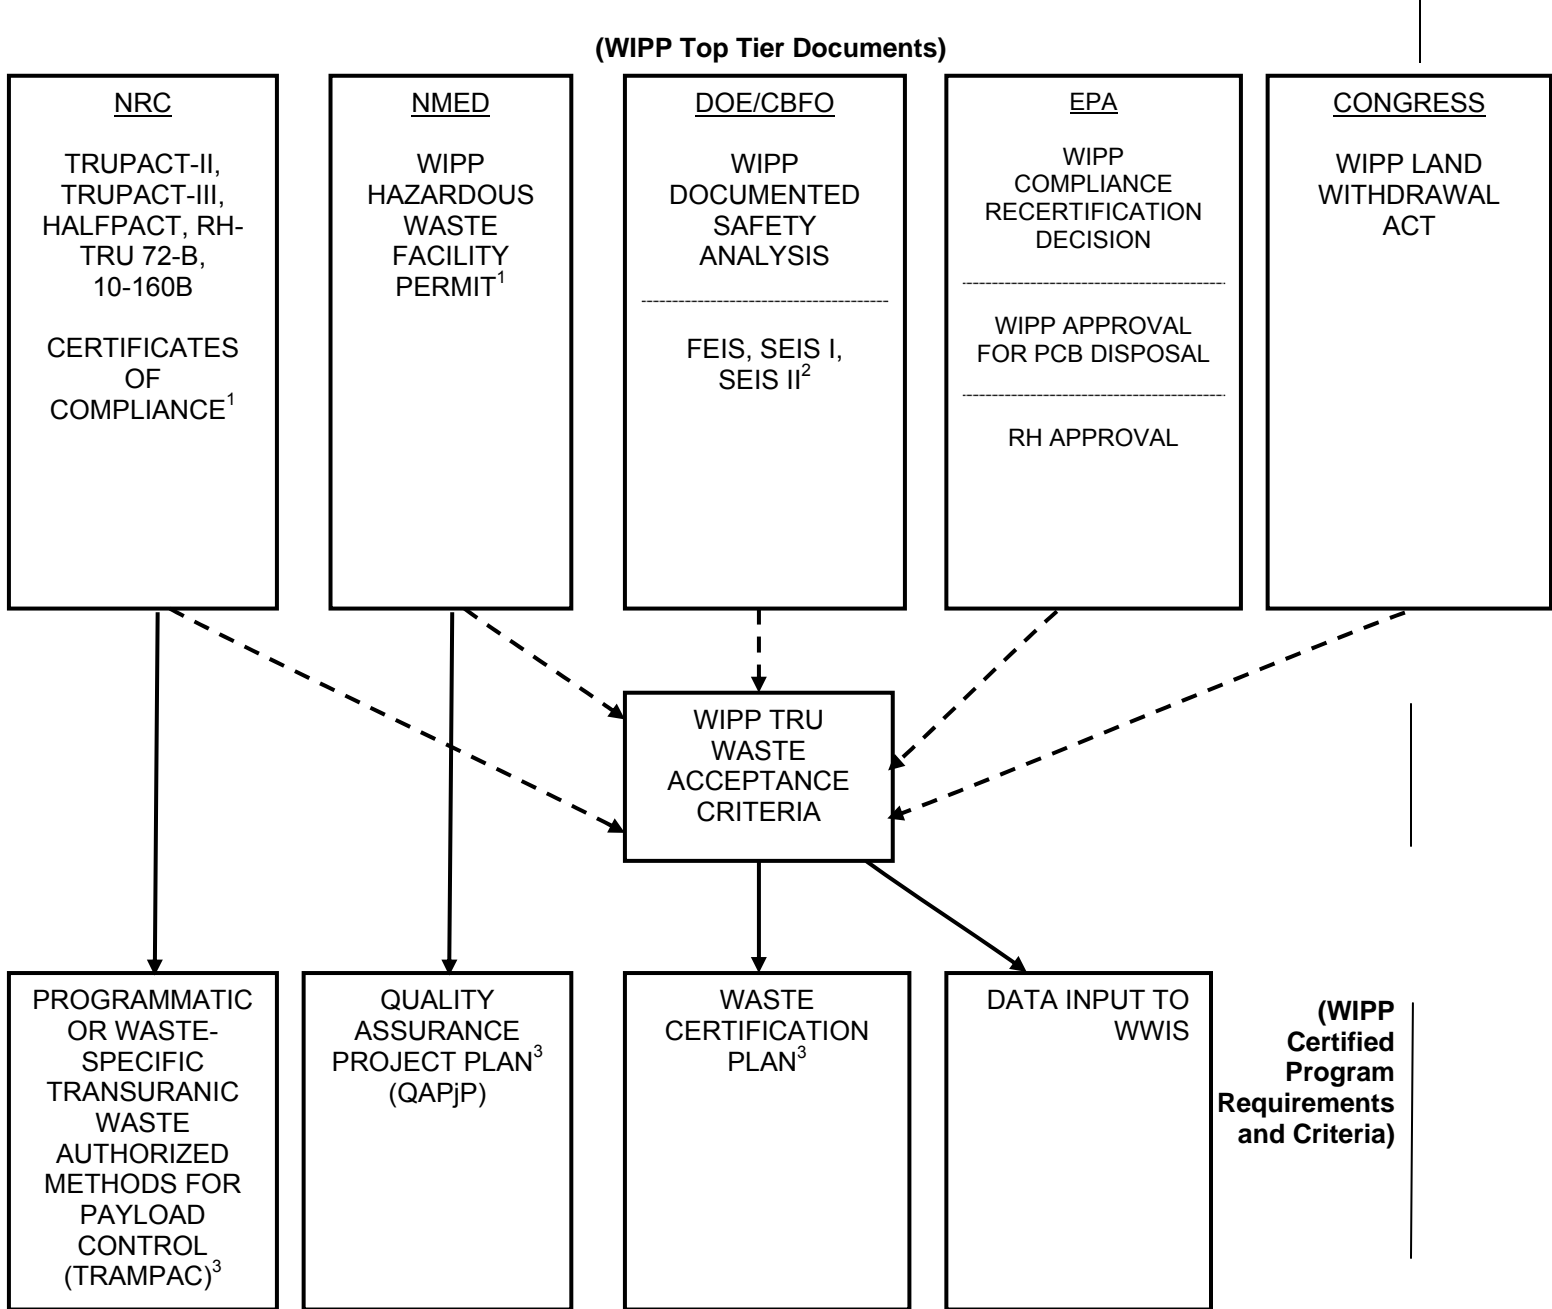

<sup>1</sup>The TRAMPACs as referenced by the TRUPACT-II, TRUPACT-III, HalfPACT, and RH-TRU 72-B Certificates of Compliance, the Safety Analysis Report as referenced by the 10-160B Certificate of Compliance and the WIPP HWFP provide detailed requirements. This WAC provides only an overview of these requirements.

<sup>2</sup>Final Environmental Impact Statement (FEIS), Supplemental Environmental Impact Statement (SEIS).

<sup>3</sup>All work performed by the WCPs for the CBFO must be performed under an approved QA program. The programmatic or waste-specific Transuranic Waste Authorized Methods for Payload Control (TRAMPAC) can be a separate document or can be embodied in the WCPs waste certification plans. The 10-160B Safety Analysis Report (SAR) does not require the preparation of a programmatic or waste-specific TRAMPAC. Instead, acceptable methods for payload compliance for the 10-160B package are implemented by an NRC-approved site-specific Appendix to the 10-160B SAR.



The requirements and associated criteria pertaining to a determination of the radiological properties of RH waste are addressed in the *Remote-Handled TRU Waste Characterization Program Implementation Plan* (WCPIP; Reference 18). The collective information obtained from waste characterization records and acceptable knowledge (AK) serves as the basis for the WCPs to certify the TRU waste satisfies the WIPP waste acceptance criteria listed herein.

Section 2.0 of this document identifies the responsible organizations and associated activities for ensuring that the TRU waste is managed in a manner that protects human health and safety and the environment.

Section 3.0 identifies the authorization basis of the CH requirements and lists the associated waste acceptance criteria relating to the physical, chemical, and radiological attributes of the waste, as well as the properties of the applicable payload containers and packages.

Section 4.0 identifies the authorization basis of the RH requirements and lists the associated waste acceptance criteria relating to the physical, chemical, and radiological attributes of the waste, as well as the properties of the applicable payload containers and packages.

Section 5.0 summarizes the quality assurance (QA) requirements relating to waste characterization, certification, and transportation. Prior to achieving WIPP certification, CBFO designated TRU waste programs must develop and implement a QA program that meets all applicable requirements of the Carlsbad Field Office (CBFO) *Quality Assurance Program Document* (QAPD; Reference 19). Characterization of TRU waste must be in accordance with the performance requirements of the WIPP WAP, the WCPIP and the WAC, and implemented in accordance with a WCP Quality Assurance Project Plan (QAPjP). Certification of payload containers for shipment in the TRUPACT-II, TRUPACT-III, HalfPACT, RH-TRU 72-B, or 10-160B shall be performed under a CBFO-approved QA program that provides confidence for both the shipper and the receiver that the requirements for the transportation system have been met.

The appendices to this WAC provide supplemental information relating to radioassay (Appendix A, Radioassay Requirements for Transuranic Waste), and radiotoxic inhalation hazard analyses (Appendix B, <sup>239</sup>Pu Equivalent Activity). Appendix C, Glossary, provides definitions for terms used in this document. Appendix D, Payload Container Integrity Checklist, addresses the visual inspection requirements and compliance criteria for determining if CH and RH payload containers meet the criteria of section 3.2.1 and section 4.2.1, respectively. Appendix E, Payload Management of TRU Alpha Activity Concentration, describes the policy and implementation methods for the payload management of TRU alpha activity concentration when overpacking waste containers. Appendices F, Radiography Requirements for Contact-Handled Transuranic Waste, and G, Visual Examination Requirements for Contact-Handled Transuranic Waste for EPA Compliance, provide the radiography and visual examination (VE) requirements relating to the EPA's physical characterization

requirements for CH waste. Appendix H, Enhanced Acceptable Knowledge, discusses the new activities and process enhancements relating to the collection, verification, and validation of AK.

This WAC is a controlled document. The current revision of the WAC may be downloaded from the CBFO Web Page at <http://www.wipp.energy.gov/library/wac/WAC.pdf>. This Internet link is provided for informational purposes only and may change without prior public notification.

## 2.0 RESPONSIBILITIES

This section identifies the responsibilities of organizations that develop and approve this WAC and of those that oversee the implementation of the requirements defined herein. The responsibilities of the organizations to which these requirements apply are also identified in this section (Reference 4, Chapter 18).

### 2.1 DOE Headquarters

Provides policy, guidance, and oversight for DOE EM sites, facilities, and operations.

### 2.2 DOE Carlsbad Field Office (CBFO)

The CBFO is responsible for administration of the WIPP Management and Operating (M&O) Contract and managing the National TRU Program (NTP) for the DOE. The CBFO is responsible for the day-to-day management and direction of strategic planning and related activities associated with the characterization, certification, transportation, and disposal of defense TRU waste. The CBFO holds the applicable permits, certifications, and records of decision necessary for the operation and closure of the WIPP facility.

The CBFO assists the DOE sites in resolving issues about the management of TRU waste as requested. The CBFO provides policy and oversight direction for WCP activities related to certification of waste for transportation to and disposal at the WIPP. Other CBFO responsibilities include but are not limited to the following:

- Ensuring that the WCPs prepare implementation plans, procedures, and documentation to meet the requirements and criteria in the WAC
- Reviewing and approving the WIPP certified programs' waste certification plans, QA plans, Quality Assurance Project Plans (QAPjPs), programmatic or waste-specific TRAMPACs, and implementing procedures to ensure adequate flow-down of WIPP top-tier requirements including changes to those documents.
- Overseeing activities associated with the
  - repackaging and treatment of TRU waste to determine accuracy of AK
  - characterization and certification of TRU waste
  - proper use of approved transportation packaging
  - receipt, management, and disposal of TRU waste at the WIPP
- Initiating Memorandum of Agreements (MOAs) with DOE sites regarding mutual interface and agreed upon requirements (including TRU waste repackaging and treatment) including provisions in MOAs for CBFO and the WIPP M&O contractor oversight of DOE site repackaging and treatment activities performed for WIPP acceptability.

- Providing a fleet of NRC-approved Type B transportation packagings for shipment of TRU waste from the DOE sites to the WIPP
- Ensuring that TRU waste accepted for management and disposal at the WIPP complies with the WIPP HWFP, applicable laws, and regulations as described in this WAC
- Initiating, reviewing, and approving proposed revisions to this WAC to ensure that environmental impacts associated with any revision are bounded by existing WIPP National Environmental Policy Act (NEPA) documentation including the Final Environmental Impact Statement (Reference 20) and related supplements I (Reference 21) and II (Reference 22)
- Performing certification audits and surveillances
- Performing Generator Site Technical Reviews jointly but independently from the WIPP M&O contractor
- Reviewing and approving waste confirmation activities performed by the M&O contractor
- Granting and/or rescinding transportation and waste certification authority to WCPs

### 2.3 DOE Sites

Manages TRU waste including its generation, packaging, repackaging, and treatment in accordance with site-specific M&O contracts, DOE Orders, and implements conditions agreed to in MOA between the CBFO Manager and the DOE site. Transfers waste to the WCP for characterization and certification.

#### 2.3.1 DOE Field Elements

Each DOE Field Element at the DOE sites is responsible for overseeing the management of the site TRU waste program in compliance with established CBFO requirements, policies, and guidelines, and for providing liaison between the CBFO and the management and operating contractors.

#### 2.3.2 WIPP Management and Operating (M&O) Contractor

The WIPP M&O Contractor is responsible for the day-to-day management and planning required for the safe disposal of defense generated TRU waste at the WIPP. Related key activities include:

- Verification that each container is part of an approved waste stream with the Enhanced Acceptable Knowledge process (see Appendix H of this WAC) prior to authorizing shipment in the Waste Data System (WDS).
- Review of approved Waste Stream Profile Forms (WSPFs) to verify the information provided is complete and accurate, and that the waste stream complies with the HWFP, WAP, and the WAC prior to authorization for shipment.
- Verification of the HWFP requirement for confirmation of certified waste prior to shipment to the WIPP from the DOE sites.
- Review (no less frequently than annually) of material at risk for waste certified for future shipment to the WIPP to provide conservative, unmitigated consequences in the safety analysis.
- Management of the CCP for the CBFO National TRU Program.
- Performance of Generator Site Technical Reviews, which are reviews of DOE sites' and WCPs' implementation of WIPP requirements (excluding DOE activities). These reviews of DOE sites' waste affecting activities are performed immediately prior to offering that waste for characterization by WCPs, as specified in MOAs between the CBFO and DOE sites, and the WCPs' implementation of the WIPP WAC requirements. WIPP M&O Contractor personnel will perform technical reviews to assess the sufficiency and implementation of DOE sites' treatment and packaging procedures and processes, including the flow-down of information to the WCPs. These reviews will also assess how DOE sites' treatment and packaging procedures and information are verified and used by the WCPs. The Generator Site Technical Reviews are performed to assure that any deficiencies are detected and noncompliant shipments are avoided.

#### 2.4 WIPP Certified Programs (CCP by site and contractor for the Idaho AMWTP)

Each WCP is responsible for developing and implementing CBFO approved TRU waste program plans and procedures that address applicable WIPP top-tier requirements and the WIPP waste acceptance criteria for packaging, characterizing, and certifying defense TRU waste for WIPP disposal. The CCP is responsible for developing and implementing programmatic or waste specific TRAMPACs and procedures for certifying and shipping TRU waste to the WIPP. Methods of compliance with each requirement and associated criterion to be implemented by the WCPs shall be described or specifically referenced and shall include procedural and administrative controls consistent with the CBFO QAPD (Reference 19). WCPs are required to submit these program plans and procedures to the CBFO for review and approval prior to their implementation. WCPs will certify that each TRU waste payload container meets the waste acceptance criteria contained in this document prior to shipment.

### 3.0 WASTE ACCEPTANCE REQUIREMENTS AND CRITERIA FOR CH WASTE

The requirements and associated criteria for acceptance of defense TRU waste at the WIPP for disposal are identified in this WAC. The acceptance criteria of this WAC describe the controlling (i.e., the most restrictive) requirements to be used by the DOE sites in preparing their waste for transportation to and disposal at the WIPP. In some instances the acceptance criteria and regulatory requirements are synonymous. WAC requirements are taken from several source documents including but not limited to the WIPP DSA (Reference 4), the TRUPACT-II, TRUPACT-III, and HalfPACT Certificates of Compliance (References 5, 6, and 7), the WIPP LWA (Reference 2), the WIPP HWFP (Reference 10), the Compliance Recertification Decision (Reference 11), the Initial Report for PCB Disposal Authorization (Reference 12), the EPA letter of approval to land dispose non-liquid PCBs at the WIPP (References 13 and 14), and the Revision to the Record of Decision for the DOE's WIPP Disposal Phase and associated WIPP NEPA database (References 15 and 16). Terms used in this WAC are defined in Appendix C.

When implementing this WAC, WCPs should refer to these source documents, 40 CFR §194.8 and 194.24, and other WIPP program documents including Performance Demonstration Program Plans and the Quality Assurance Program Document, as applicable, for information pertinent to the DOE system of controls, including compilation of AK.

#### 3.1 Summary of WIPP Authorization Basis

The purpose of section 3.0 and related appendices is to present the requirements and associated criteria that must be met for CH TRU waste to be transported to, managed at, and disposed of at the WIPP. The requirements and associated criteria are organized under five major headings: Container Properties, Radiological Properties, Physical Properties, Chemical Properties, and Data Package Contents. Only TRU waste from a properly characterized and approved waste stream may be certified as meeting the requirements and associated criteria contained in this WAC. Any waste container from a waste stream that has not been preceded by an appropriate certified and approved Waste Stream Profile Form (WSPF) is not acceptable at the WIPP (Reference 10, Part 2, Section 2.3.3.10; Reference 4, Chapter 18).

WCPs' plans and procedures shall contain details of the processes, controls, techniques, tests, and other actions to be applied to each TRU payload container, waste stream, and shipment. Methods of compliance with each requirement shall be described and the specific procedure cited. These methods of compliance shall include procedural controls and administrative controls. The QA requirements applicable to waste characterization, certification, and transportation are addressed in various sections of this WAC and are briefly summarized in section 5.0. The data resulting from the implementation of the plans and procedures will form the basis for verifying that TRU waste to be sent to the WIPP is certified to meet the WAC by the responsible WCP certifying official(s).

WCPs shall transmit required characterization, certification, and shipping data to the WIPP Waste Information System (WWIS) database using the Waste Data System (WDS). The WWIS is an electronic database and is a subsystem of the WDS. The WDS is equipped with edit/limit checks to verify that the data representing the waste payload containers are in compliance with this WAC. Before shipping TRU waste payload containers from a WIPP-accepted waste stream, the WCP shall transmit the required waste characterization, certification, and shipping data via WDS to the WWIS database. WCPs may periodically be requested to transmit payload container radiography reports or other data to the WIPP. WIPP will not accept any waste shipments for disposal if the waste payload container information has not been correctly submitted and approved for shipment by the WWIS Data Administrator. The Waste Data System User's Manual (Reference 23) provides the information needed by WCPs to perform tasks associated with transmittal of the payload container's characterization, certification, and shipment information to the WIPP.

DOE sites will be notified of revisions to external regulatory requirements by CBFO. Revisions of requirements in referenced documents not controlled by the DOE (but by, for example, the EPA, NRC, or NMED) shall have precedence over the values specified here if they are more restrictive. These changes will be incorporated in future revisions of this WAC.

### 3.1.1 DOE Operations and Safety Requirements for WIPP

The WIPP DSA (Reference 4) addresses TRU waste handling and emplacement operations. The waste accepted for emplacement at the WIPP must conform to the WAC to meet the DSA. The DSA documents the safety analyses that develop and evaluate the adequacy of the WIPP safety basis necessary to ensure the safety of workers, the public, and the environment from the hazards posed by WIPP waste receiving, handling, and emplacement operations. The DSA establishes and evaluates the adequacy of the safety basis in response to plant normal and abnormal operations and postulated accident conditions.

### 3.1.2 NRC Transportation Safety Requirements

Acceptable methods for payload compliance are defined in the TRUPACT-II, TRUPACT-III, and HalfPACT Certificates of Compliance and implemented by the CH-TRAMPAC and TRUPACT-III TRAMPAC (References 24 and 25). For shipments to the WIPP, each WCP must prepare a programmatic or waste-specific TRAMPAC describing how it will ensure compliance with each payload parameter. The programmatic or waste-specific TRAMPAC shall contain sufficient detail to allow reviewers to adequately understand and evaluate the compliance methodology for each payload parameter.

WCPs shall have a packaging QA program that defines the QA activities that apply to the use of NRC-approved transportation packagings equivalent to Title 10 of the Code

of Federal Regulations (CFR), Part 71, Subpart H (Reference 26).

### 3.1.3 NMED Hazardous Waste Facility Permit Requirements

TRU waste is classified as TRU-mixed waste if it contains hazardous constituents regulated under the New Mexico Hazardous Waste Act (Reference 27). Only TRU-mixed waste and TRU waste that have been characterized in accordance with the WIPP WAP and that meet the Treatment, Storage, and Disposal Facility (TSDF) waste acceptance criteria as presented in the HWFP Sections 2.3.3.1 through 2.3.3.10 will be accepted at the WIPP facility for disposal in the permitted underground hazardous waste disposal unit.

Prior to disposal, each participating WCP shall develop and implement a QAPjP that addresses all the applicable requirements specified in the WIPP WAP. In accordance with Attachment C5 of the WAP, the QAPjP will include the qualitative or quantitative criteria for determining whether the waste characterization programs are being satisfactorily performed. All WCPs' QAPjPs will be reviewed and approved by the CBFO.

### 3.1.4 EPA Requirements

#### 3.1.4.1 EPA Compliance Recertification Decision

Title 40 CFR §194.24(c) states that the DOE shall specify the limiting values for waste components to be emplaced in the repository (Reference 28). The EPA's Compliance Recertification Decision (Reference 11) identifies the repository limits for several waste components including free water, metals, and cellulose, plastic, and rubber (CPR). Although the Recertification does not specify limiting values for the activities and masses of specific radionuclides, it identifies the listed values for a number of radionuclides that are considered in the Performance Assessment. To demonstrate that the cumulative total activities of the specified radionuclides ( $^{241}\text{Am}$ ,  $^{238}\text{Pu}$ ,  $^{239}\text{Pu}$ ,  $^{240}\text{Pu}$ ,  $^{242}\text{Pu}$ ,  $^{233}\text{U}$ ,  $^{234}\text{U}$ ,  $^{238}\text{U}$ ,  $^{90}\text{Sr}$ , and  $^{137}\text{Cs}$ ) are consistent with the levels used for the Performance Assessment and the Recertification, reporting and tracking of the specified radionuclides is necessary (see Appendix A). TRU waste payload containers shall contain more than 100 nanocuries per gram (nCi/g) of waste of alpha-emitting TRU isotopes with half-lives greater than 20 years, as specified in section 3.3.3 of this WAC.

The repository limit for free water is a maximum of 1,684 cubic meters ( $\text{m}^3$ ) and is met by the observable liquid criterion specified in section 3.4.1 of this WAC.

The limits for metals are a minimum of  $2 \times 10^7$  kilograms (kg) for ferrous metals and  $2 \times 10^3$  kg for nonferrous metals. These limits will be met in the total repository inventory by the metals that constitute the payload containers alone; thus, the WIPP tracks the number and type of payload containers emplaced in the repository as reported to the WWIS database by the WCPs (see section 3.2.1 of this WAC).



The repository limit for CPR is a maximum of  $2.2 \times 10^7$  kg. WCPs are required to estimate the CPR weights and report these estimates to the WWIS database on a payload container basis as required by section 3.6.1 of this WAC.

WCPs must quantify and report the activities and masses of specific radionuclides for the purpose of tracking the total radionuclide inventory of the repository as specified in section 3.3.1 of this WAC. The presence or absence of these specific radionuclides is determined from AK, radioassay, or both in accordance with Appendix A of this WAC. The results of this determination are reported to the WWIS database on a payload container basis.

The methods used to quantify the above waste components for purposes of EPA compliance are discussed in Appendices A, F, and G.

#### 3.1.4.2 EPA Approval for PCB Disposal

PCB-contaminated TRU and PCB-contaminated TRU waste mixed with a hazardous waste, including PCB remediation waste, PCB articles, and PCB bulk product waste may be stored and disposed at the WIPP (References 12, 13, 14, 15, and 16).

Waste streams identified as containing PCBs shall be brought to the attention of the CBFO in order that a determination can be made regarding their acceptability at the WIPP.

#### 3.1.5 WIPP Land Withdrawal Act Requirements

The term "WIPP" means the Waste Isolation Pilot Plant project authorized under Section 213 of the DOE National Security and Military Applications of Nuclear Energy Authorization Act of 1980 (Pub. L. 96-164; 93 Stat. 1259, 1265) to demonstrate the safe disposal of radioactive waste materials generated by atomic energy defense activities (Reference 1). Hence, by law, the WIPP can accept only radioactive waste generated by atomic energy defense activities of the United States (Reference 2, Section 2[19]).

The DOE and its predecessor agencies were engaged in a broad range of activities that fall under the heading of atomic energy defense activities. A TRU waste is eligible for disposal at the WIPP if it has been generated in whole or in part by one or more of the following functions (References 29 and 30):

- naval reactors development
- weapons activities, including defense inertial confinement fusion
- verification and control technology
- defense nuclear materials production
- defense nuclear waste and materials by-products management
- defense nuclear materials security and safeguards and security investigations
- defense research and development

Using AK, DOE sites must determine that each waste stream to be disposed of at the WIPP is "defense" TRU waste.

High-level radioactive waste or spent nuclear fuel shall neither be transported, emplaced, nor disposed of at the WIPP (Reference 2, Section 12). Also, no TRU waste may be transported by or for the DOE to or from the WIPP except in packages (1) the design of which has been certified by the NRC, and (2) that have been determined by the NRC to satisfy its QA requirements (Reference 2, Section 16[a]).

### 3.2 Container Properties

#### 3.2.1 Description

Acceptance Criterion. Each payload container shall be assigned a TRUCON code and a payload shipping category (References 24 and 25, Section 5.1.1). Authorized payload container types include the:

- 55-gallon drum
- 55-gallon drum containing a pipe component (commonly referred to as a pipe overpack container [POC]). Waste streams packaged in POCs that contain combustibles are excluded from shipment to the WIPP, excluding radiological control materials and packaging materials normally used to load these containers (Reference 4, Sections 3.3.2.3, 3.6, and 4.5.8.5)
- 55-gallon drum containing a criticality control container (commonly referred to as a criticality control overpack [CCO]). Waste streams packaged in CCOs that contain combustibles are excluded from shipment to the WIPP, excluding radiological control materials and packaging materials normally used to load these containers (References 4, Sections 3.3.2.3, 3.6, and 4.5.8.5)
- 85-gallon drum, either direct loaded or containing one 55-gallon drum. The term "85-gallon drum" includes 75- to 85-gallon drums.
- 100-gallon drum
- shielded container containing a 30-gallon steel drum
- standard large box 2 (SLB2), either direct loaded or containing various individual containers (4 x 4 x 7-foot boxes and 5 x 5 x 8-foot boxes as well as other containers of smaller sizes)
- standard waste box (SWB), either direct loaded, containing up to four 55-gallon drums, up to three 85-gallon drums, up to two 100-gallon drums, or one bin
- ten-drum overpack (TDOP), either direct loaded, containing up to ten 55-gallon drums, up to six 85-gallon drums, or one SWB

Payload containers shall meet U.S. Department of Transportation (DOT) Specification 7A, Type A, packaging requirements delineated in 49 CFR §173.465 (Reference 4, Section 2.3.2; Reference 9, Attachment A1, Section A1-1b). Payload containers must be made of steel and be in good and unimpaired condition prior to shipment from the DOE sites. To demonstrate compliance with the requirement that payload containers be in good and unimpaired condition, the exterior of all payload containers shall undergo 100% visual inspection prior to loading into an authorized package. The results of this visual inspection shall be documented using the Payload Container Integrity Checklist contained in Appendix D. A payload container in good and unimpaired condition, 1) does not have significant rusting, 2) is of sound structural integrity, and 3) does not show signs of leakage. Significant rusting is a readily observable loss of metal due to oxidation (e.g., flaking, bubbling, or pitting) that causes degradation of the payload container's structural integrity. Rusting that causes discoloration of the payload container surface or consists of minor flaking is not considered significant. A payload container is not of sound structural integrity if it has breaches or significant denting or deformation. Breaching is defined as a penetration in the payload container that exposes the internals of the container. Significant denting or deformation is defined as damage to the payload container that results in creasing, cracking, or gouging of the metal, or damage that affects payload container closure. Dents or deformations that do not result in creasing, cracking, or gouging or affect payload container closure are not considered significant. WCPs will report to the WWIS database the number and types of payload containers planned for shipment to the WIPP.

### 3.2.2 Weight Limits and Center of Gravity

Acceptance Criterion. See the CH-TRAMPAC for weight limits and center of gravity requirements (Reference 24). See the TRUPACT-III TRAMPAC for applicable weight limits (Reference 25).

### 3.2.3 Assembly Configurations

Acceptance Criterion. See the CH-TRAMPAC and TRUPACT-III TRAMPAC for payload assembly configuration requirements (References 24 and 25).

### 3.2.4 Removable Surface Contamination

Acceptance Criterion. Removable surface contamination on CH TRU waste payload containers, payload assemblies, and packagings shall not exceed 20 disintegrations per minute (dpm)/100 square centimeters (cm<sup>2</sup>) alpha and 200 dpm/100 cm<sup>2</sup> beta-gamma (Reference 10, Attachment A1, Section A1-1d[2]; References 31 and 32). The fixing of surface contamination to meet these criteria is not allowed by the WIPP in accordance with best management practices for ensuring worker radiation dose as low as reasonably achievable (ALARA).

### 3.2.5 Identification/Labeling

Acceptance Criterion. Each payload container to be shipped in a TRUPACT-II, TRUPACT-III, or a HalfPACT shall be labeled with a unique payload container identification number (Reference 24, Section 2.4; Reference 25, Section 2.3) using bar code labels permanently attached in conspicuous locations. The unique payload container identification number shall include a DOE site identifier as a prefix (Reference 23, Page 41).

The payload container identification number shall be in medium to low density Code 39 bar code symbology as required by American National Standards Institute (ANSI) Standard ANSI/AIM BC1-1995 (Reference 33) in characters at least 1-inch high and alphanumeric characters at least ½-inch high. In the case of a 55-, 85-, and 100-gallon drum, or a shielded container, a minimum of three bar code identification labels shall be placed at approximately equal intervals around the circumference of the drum or shielded container (120 degrees for three labels, 90 degrees for four labels, etc.) so that at least one label is clearly visible when the drums or shielded containers are assembled into a payload (i.e., a label must be visible after slip sheets and wrapping are applied). In the case of SWBs, bar code labels are required on the flat sides of the SWBs (Reference 34). For TDOPs and SLB2s, a minimum of one bar code is required.

Payload containers shall be marked "Caution Radioactive Material" using a yellow and magenta label as specified in 10 CFR Part 835 (Reference 32). Those payload containers whose contents are also RCRA-regulated (mixed-TRU) shall be additionally marked "Hazardous Waste" as specified in 40 CFR §262.32 (Reference 35). For TRU and TRU-mixed wastes containing PCBs, the payload containers shall be marked in accordance with 40 CFR §761.40 (Reference 14). Additionally, DOT Type B packages (i.e., the TRUPACT-II, TRUPACT-III, and HalfPACT) containing PCBs must be properly marked in accordance with the EPA Conditions of Approval and 40 CFR §761.40 (References 13 and 14).

If an empty 55-, 85-, 100-gallon drum or shielded container is used as dunnage to complete a payload configuration, the dunnage container shall be labeled with the following information:

- Unique payload container identification number
- "EMPTY" or "DUNNAGE"

If a seven-pack of only dunnage 55-gallon drums, a four-pack of only dunnage 85-gallon drums, a three-pack of only dunnage 100-gallon drums, or a dunnage SWB is used in the TRUPACT-II, the container(s) shall be labeled only "EMPTY" or "DUNNAGE," and the unique container identification number label is not required for these containers (Reference 24, Section 2.4.1).

### 3.2.6 Dunnage

Acceptance Criterion. See the CH-TRAMPAC for dunnage requirements (Reference 24).

To maximize the efficiency of disposal operations at the WIPP, the use of dunnage should be minimized. In the event the use of dunnage cannot be avoided, the preferred practice for maximizing the efficiency of waste handling and the utilization of disposal room capacity is to ship them in assemblies (e.g., a seven-pack assembly of 55-gallon drums).

### 3.2.7 Filter Vents

Acceptance Criterion. Containers that have been stored in an unvented condition (i.e., no filter and/or unpunctured liner), shall be aspirated for a specific length of time to ensure equilibration of any gases that may have accumulated in the closed payload container (References 24 and 25, Section 5.3.1).

Each payload container shall have one or more filter vents (Reference 24, Section 2.5.1; Reference 25, Section 2.4.1; Reference 10, Attachment A1, Section A1-1b[1]). These filter vents shall meet the specifications of the WIPP HWFP, CH-TRAMPAC, and TRUPACT-III TRAMPAC, as applicable. The model number of each filter vent or combination of filter vents installed on a payload container shall be reported to the WWIS database.

### 3.3 Radiological Properties

With respect to the required radiological properties identified within this section, they can be divided into two distinct groups.

The first group includes the activities and masses of the ten WIPP-tracked radionuclides (i.e.,  $^{241}\text{Am}$ ,  $^{238}\text{Pu}$ ,  $^{239}\text{Pu}$ ,  $^{240}\text{Pu}$ ,  $^{242}\text{Pu}$ ,  $^{233}\text{U}$ ,  $^{234}\text{U}$ ,  $^{238}\text{U}$ ,  $^{90}\text{Sr}$ , and  $^{137}\text{Cs}$ ) and the TRU alpha activity concentration of the waste (i.e., >100 nCi/g of alpha-emitting TRU isotopes with half lives greater than 20 years). This set of radiological properties is regulated by the EPA in accordance with 40 CFR Parts 191 and 194 (References 36 and 28). Estimates of their activities and masses shall be derived from a system of controls certified by CBFO that includes AK, computations, measurements, sampling, etc. (Reference 37, Appendix TRU Waste). Appendix A provides the methods and requirements by which to characterize the radiological composition of TRU waste utilizing radioassay techniques.

The second group includes the remaining radionuclides contributing to the  $^{239}\text{Pu}$  fissile gram equivalent (FGE), the plutonium-239 equivalent curies (PE-Ci), and the decay heat of the payload container. This set of radiological data is regulated both by the NRC as specified in the CH-TRAMPAC (Reference 24) and the TRUPACT-III TRAMPAC (Reference 25) and by the CBFO as summarized by the WIPP DSA (Reference 4). PE-Ci quantities shall be calculated for each payload container in accordance with Appendix B. Any CH-TRAMPAC and/or TRUPACT-III TRAMPAC compliant method may be used to quantify the remaining radiological properties at the discretion of the shipping facility. Appendix A provides recommended radioassay

methods by which to characterize the remaining radiological properties. However, the resulting data (e.g., AK from Safeguards and Security data), the source and method from which the data were generated, and the basis for the reliability of the data shall be submitted to and approved by CBFO prior to use.

### 3.3.1 Radionuclide Composition

Acceptance Criterion. The activities and masses of  $^{241}\text{Am}$ ,  $^{238}\text{Pu}$ ,  $^{239}\text{Pu}$ ,  $^{240}\text{Pu}$ ,  $^{242}\text{Pu}$ ,  $^{233}\text{U}$ ,  $^{234}\text{U}$ ,  $^{238}\text{U}$ ,  $^{90}\text{Sr}$ , and  $^{137}\text{Cs}$  shall be established on a payload container basis for purposes of tracking their contributions to the total WIPP radionuclide inventory (Reference 37, Appendix TRU Waste). The estimated activities and masses, including their associated total measurement uncertainties (TMUs), expressed in terms of one standard deviation, for these ten radionuclides shall be reported to the WWIS database on a payload container basis. For any of these ten radionuclides whose presence can be substantiated from AK, direct measurement, computations, or a combination thereof, and whose measured data are reported as being below the lower limit of detection (LLD) or the minimum detectable activity (MDA) for that radionuclide, the WCP shall report the character string "< LLD" to the WWIS database for the activity and mass of that radionuclide; otherwise a value of zero shall be reported. Quantitative estimates for either the LLD or MDA shall not be used when calculating related radiological properties of the waste such as TRU alpha activity concentration,  $^{239}\text{Pu}$  fissile gram equivalent, decay heat, and  $^{239}\text{Pu}$  equivalent activity. See Appendix A, section A.3, of this document for information pertaining to the development and application of LLD or MDA.

In addition, all radionuclides other than the ten WIPP-tracked radionuclides (i.e.,  $^{241}\text{Am}$ ,  $^{238}\text{Pu}$ ,  $^{239}\text{Pu}$ ,  $^{240}\text{Pu}$ ,  $^{242}\text{Pu}$ ,  $^{233}\text{U}$ ,  $^{234}\text{U}$ ,  $^{238}\text{U}$ ,  $^{90}\text{Sr}$ , and  $^{137}\text{Cs}$ ) that contribute to 95% of the radioactive hazard for the payload container shall be reported on the TRUPACT-II, TRUPACT-III, or HalfPACT bill of lading or manifest in accordance with 49 CFR §172.203 and 49 CFR §173.433 (References 38 and 39). The activities and masses of these other radionuclides shall also be reported to the WWIS database along with their associated TMU, expressed in terms of one standard deviation for each waste container.

### 3.3.2 $^{239}\text{Pu}$ Fissile Gram Equivalent

*Acceptance Criterion.* For each payload container, the sum of  $^{239}\text{Pu}$  FGE plus two times its associated TMU, expressed in terms of one standard deviation, shall comply with the limits in Table 1 (Reference 4, Section 6.4.2; References 24 and 25, Section 3.1.1). The values calculated for  $^{239}\text{Pu}$  FGE and its associated TMU (expressed in terms of one standard deviation) shall be reported to the WWIS database for each payload container. See the CH-TRAMPAC and TRUPACT-III TRAMPAC for  $^{239}\text{Pu}$  FGE limits applicable to the TRUPACT-II, TRUPACT-III, and HalfPACT packages (References 24 and 25).

**Table 1 <sup>239</sup>Pu FGE Limits for CH-TRU Waste Payload Containers**

Waste Container Type	Be/BeO Limits	Special Waste Container Geometry/Material Requirements	<sup>239</sup> Pu FGE Limit
Non-Machine Compacted Waste			
55- (excluding POCs and CCOs), 85-, and 100-gallon drums	≤ 1% by weight of the waste	None	≤ 200
55-gallon drum configured as a POC (i.e., a Standard, S100, S200, and S300)	≤ 1% by weight of the waste	None	≤ 200
55-gallon drum configured as a CCO	≤ 1% by weight of the waste	None	≤ 380
Shielded Container	≤ 1% by weight of the waste	None	≤ 200
SLB2	≤ 1% by weight of the waste	None	≤ 325
SWB	≤ 1% by weight of the waste	None	≤ 325
TDOP	≤ 1% by weight of the waste	None	≤ 325
55- (excluding POCs and CCOs), 85-, and 100-gallon drums	>1% by weight of the waste up to 100 kg	None	≤ 100



**Table 1 <sup>239</sup>Pu FGE Limits for CH-TRU Waste Payload Containers (Continued)**

Waste Container Type	Be/BeO Limits	Special Waste Container Geometry/Material Requirements	<sup>239</sup> Pu FGE Limit
Non-Machine Compacted Waste			
SWB	>1% by weight of the waste	None	≤ 100
TDOP	>1% by weight of the waste	None	≤ 100
POCs (i.e., a Standard, S100, S200, and S300)	> 1% by weight of the waste	None	≤ 140
Machine Compacted Waste			
55- (excluding POCs and CCOs), 85-, and 100-gallon drums	≤ 1% by weight of the waste	Partially compacted waste. Applies to waste that has been compacted such that the distribution and form of polyethylene in the waste does not exceed 0.646 gram/cubic centimeter (g/cm <sup>3</sup> ), i.e., 70% of the theoretical full density of polyethylene (0.923 g/cm <sup>3</sup> ).	≤ 200
55- (excluding POCs and CCOs), 85-, and 100-gallon drums	≤ 1% by weight of the waste	Fully compacted waste without design vertical spacing. Applies to waste that has been compacted such that the distribution and form of polyethylene in the waste exceeds 0.646 g/cm <sup>3</sup> , i.e., 70% of the theoretical full density of polyethylene (0.923 g/cm <sup>3</sup> ).	≤ 170
55- (excluding POCs and CCOs), 85-, and 100-gallon drums	≤ 1% by weight of the waste	Fully compacted waste with design vertical spacing. Applies to waste that has been compacted such that the distribution and form of polyethylene in the waste exceeds 0.646 g/cm <sup>3</sup> , i.e., 70% of the theoretical full density of polyethylene (0.923 g/cm <sup>3</sup> ), and the dimensions of the payload containers (e.g., 100-gallon drums) ensure a minimum 0.5-inch separation between their compacted waste contents and other axially adjacent payload containers.	≤ 200
Shielded Container	≤ 1% by weight of the waste	None	≤ 200

**Table 1 <sup>239</sup>Pu FGE Limits for CH-TRU Waste Payload Containers (Continued)**

Waste Container Type	Be/BeO Limits	Special Waste Container Geometry/Material Requirements	<sup>239</sup> Pu FGE Limit
Machine Compacted Waste			
SWB/TDOP	≤ 1% by weight of the waste	Fully compacted waste with design vertical spacing. Applies to waste that has been compacted such that the distribution and form of polyethylene in the waste exceeds 0.646 g/cm <sup>3</sup> , i.e., 70% of the theoretical full density of polyethylene (0.923 g/cm <sup>3</sup> ), and contains one 16-gauge steel 100-gallon drum having a top and bottom design spacing of 0.75 and 0.50 inches, respectively, with no loose material or other drums of waste in the SWB/TDOP.	≤ 250
SWB/TDOP	≤ 1% by weight of the waste	Fully compacted waste with design vertical spacing. Containing one 55-, 85-, or 100-gallon drum whose design ensures a minimum of 0.5-inch vertical spacing between drum contents and the exterior top and bottom of the drum (e.g., a recessed lid) with no loose material or other drums of waste in the SWB/TDOP.	≤ 200
SWB/TDOP	≤ 1% by weight of the waste	Partially compacted waste. Containing one 55-, 85-, or 100-gallon drum whose contents have been compacted such that the distribution and form of polyethylene in the waste does not exceed 0.646 g/cm <sup>3</sup> , i.e., 70% of the theoretical full density of polyethylene (0.923 g/cm <sup>3</sup> ) with no loose material or other drums of waste in the SWB/TDOP.	≤ 200
SWB/TDOP	≤ 1% by weight of the waste	Fully compacted waste with design vertical spacing. Applies to waste that has been compacted such that the distribution and form of polyethylene in the waste exceeds 0.646 g/cm <sup>3</sup> , i.e., 70% of the theoretical full density of polyethylene (0.923 g/cm <sup>3</sup> ).	≤ 185

### 3.3.3 TRU Alpha Activity Concentration

**Acceptance Criterion.** TRU waste payload containers shall contain more than 100 nCi/g of alpha-emitting TRU isotopes with half-lives greater than 20 years. Without taking into consideration the TMU, the TRU alpha activity concentration for a payload container is determined by dividing the TRU alpha activity of the waste by the weight of the waste. The weight of the waste is the weight of the material placed into the payload container (i.e., the net weight of the container). The weight of the waste is typically determined by subtracting the tare weight of the payload container (including the weight of the rigid liner and any shielding external from the waste, if applicable) from the gross weight of the payload container. In the event waste containers (e.g., 55-gallon drums) that have been radioassayed are overpacked in a payload container (e.g., in an SWB), WCPs

shall sum the individual TRU alpha activity values of the individual waste containers and divide by the sum of the individual net waste weights (i.e., less container, shielding, and liner weights as appropriate) to determine the activity per gram for the payload container. Waste containers selected for payload management shall comply with the policy for the management of TRU alpha activity concentration (see Appendix E). Loading a 55-gallon pipe overpack with cans is considered direct loading, not overpacking, for the purposes of calculating the weight of the container. The TRU alpha activity concentration shall be reported to the WWIS database; however, there are no reporting requirements for its associated TMU (Reference 37, Chapter 4).

#### 3.3.4 <sup>239</sup>Pu Equivalent Activity

Acceptance Criterion. PE-Ci limits are shown in Table 2. PE-Ci quantities shall be calculated for each payload container (see Appendix B) and reported to the WWIS database (Reference 4, Table 3.4-1). There are no reporting requirements for the associated TMU.

**Table 2 PE-Ci Limits for CH-TRU Waste Payload Containers**

Payload Container	Packing Configuration	PE-Ci Limit <sup>1</sup>
55-, 85-, and 100-gallon drum	Direct loaded – all approved waste forms	≤80
Shielded Container	Direct loaded – vented 30-gallon inner steel drum – all approved waste forms	≤80
CCO	Except CCOs containing combustibles other than radiological control materials and packaging materials normally used to load these containers - all approved waste forms	≤1800
SLB2	Direct loaded – all approved waste forms	≤560
SWB	Direct loaded (or a bin) – all approved waste forms	≤560
TDOP	Direct loaded – all approved waste forms	≤560
85-gallon drum	Overpacking an undamaged <sup>2</sup> 55-gallon drum – all approved waste forms	≤1100
SWB, TDOP	Overpacking an assembly of undamaged <sup>2</sup> 55- or 85-gallon drums with no single payload container within the assembly exceeding 1100 PE-Ci – all approved waste forms	≤1200
TDOP	Overpacking an undamaged <sup>2</sup> SWB – all approved waste forms	≤1200
POCs (Standard, S100, S200, and S300)	Except POCs containing combustibles other than radiological control materials and packaging materials normally used to load these containers - all approved waste forms	≤1800
All	Solidified/vitrified waste (PE-Ci limit of 1800 is per payload container assembly, as applicable)	≤1800 PE-Ci

<sup>1</sup>For payload containers that exceed the PE-Ci limit, disposal options include either repackaging the waste or petitioning the CBFO for an alternative determination of disposition using the WIPP's Unreviewed Safety Question Determination and Suspect Container Response Program.

<sup>2</sup>An undamaged container provides an additional barrier should a breach occur in the overpack. When overpacking one or more damaged waste containers, direct loaded PE-Ci limits apply.

### 3.3.5 Radiation Dose Equivalent Rate

**Acceptance Criterion.** The external radiation dose equivalent rate of individual payload containers shall be ≤200 milliroentgen equivalent man (mrem)/hour (hr) at the surface with the exception of the S100 and S300 pipe overpacks, which are limited to ≤179 mrem/hr and ≤155 mrem/hr, respectively, at the surface (References 24 and 25, Section 3.2). Internal payload container shielding shall not be used to meet this

criterion, except for authorized shielded payload container configurations such as the use of 55-gallon drums containing a pipe component or 55-gallon drums containing a criticality control container or a shielded container (Reference 25, Section 3.2).

In the case of a SLB2 payload container that meets the radiation dose equivalent rate requirement of 200 mrem/hr, however, additional payload container shielding beyond that identified as an integral component of the SLB2 may be used to shield to levels that are ALARA.

Total dose equivalent rate and the neutron contribution to the total dose equivalent rate shall be reported for each payload container to the WWIS database.

See the CH-TRAMPAC and TRUPACT-III TRAMPAC for associated package requirements (References 24 and 25).

### 3.3.6 Decay Heat

*Acceptance Criterion.* See the CH-TRAMPAC and TRUPACT-III TRAMPAC for decay heat requirements (References 24 and 25). Wastes with TRUCON Content Number 154 are excluded from shipment to the WIPP thereby mitigating potential deflagrations associated with high decay heat waste (Reference 4, Section 3.3.2.3).

## 3.4 Physical Properties

### 3.4.1 Observable Liquid

*Acceptance Criterion.* Liquid waste is not acceptable at the WIPP. Liquid in the quantities delineated below is acceptable.

- Observable liquid shall be less than 1 percent by volume of the outermost container at the time of radiography or visual examination (Reference 10). The limit of “less than 1 percent” is taken from the CH-TRAMPAC and TRUPACT-III TRAMPAC and is more restrictive than the limit of “no more than 1 percent” in the HWFP.
- Internal containers with more than 60 milliliters or 3 percent by volume observable liquid, whichever is greater, are prohibited (Reference 10).
- Containers with Hazardous Waste Number U134 assigned shall have no observable liquid (Reference 10).
- Overpacking the outermost container that was examined during radiography or visual examination or redistributing untreated liquid within the container shall not be used to meet the liquid volume limits (Reference 10).
- The disposal of free-flowing PCB liquids (i.e., observable liquids) is prohibited except that incidental liquids such as, but not limited to, rainwater, groundwater,

condensate, leachate, load separation and dust control liquid, are allowed in PCB/TRU and PCB/TRU mixed bulk product waste containers less than 1 percent by volume of the outermost container at the time of radiography or visual examination (Reference 13). The limit of "less than 1 percent" is taken from the CH-TRAMPAC and TRUPACT-III TRAMPAC and is more restrictive than the limit of "up to 1 percent" as stated in the EPA's letter of approval for disposal of TRU and TRU-mixed wastes containing PCBs.

For WCPs that use VE, the detection of any liquid in non-transparent internal containers, detected from shaking the internal container, will be handled by assuming that the internal container is filled with liquid and adding this volume to the total liquid in the container being characterized using VE (Reference 10, Attachment C, Section C-3b; Reference 37, Appendix TRU Waste).

### 3.4.2 Sealed Containers

Acceptance Criterion. Sealed containers that are greater than 4 liters (nominal) are prohibited except for solid inorganic waste (Waste Material Type II.2) packaged in a metal container (Reference 24, Section 2.8.1; Reference 25, Section 2.7.1).

## 3.5 Chemical Properties

### 3.5.1 Pyrophoric Materials

Acceptance Criterion. Radioactive pyrophoric materials shall be present only in small residual amounts ( $\leq 1$  percent by weight) in payload containers and shall be generally dispersed in the waste in accordance with best management practices for ensuring worker protection. Radioactive pyrophorics in concentrations greater than 1 percent by weight and all nonradioactive pyrophorics shall be reacted (or oxidized) and/or otherwise rendered nonreactive prior to placement in the payload container (References 24 and 25, Section 4.1.1).

Nonradionuclide pyrophoric materials are not acceptable at the WIPP (Reference 4, Section 11.4.1; Reference 10, Attachment C, Section C-1c; Reference 10, Part 2, Section 2.3.3.2).

### 3.5.2 Hazardous Waste

Acceptance Criterion. Hazardous wastes not occurring as co-contaminants with TRU wastes (non-mixed hazardous wastes) are not acceptable at the WIPP. Each CH TRU mixed waste container shall be assigned one or more hazardous waste numbers as appropriate. Only EPA hazardous waste numbers listed as allowable in the Hazardous Waste Facility Permit may be managed at the WIPP. Some of the waste may also be identified by unique state hazardous waste codes. These wastes are acceptable at the WIPP as long as the TSDf waste acceptance criteria are met (Reference 10, Attachment C, Section C-1b; Reference 10, Part 2, Section 2.3.3.3). Wastes exhibiting the characteristic of ignitability, corrosivity, or reactivity (EPA hazardous waste numbers

of D001, D002, or D003) are not acceptable at the WIPP (Reference 10, Attachment C, Section C-1c; Reference 10, Part 2, Sections 2.3.3.3, 2.3.3.7, and 2.3.4).

### 3.5.3 Chemical Compatibility

Acceptance Criterion. TRU waste containing incompatible materials or materials incompatible with payload container and packaging materials, shipping container materials, other wastes, repository backfill, or seal and panel closure materials are not acceptable for transport in the TRUPACT-II, TRUPACT-III, and HalfPACT or for disposal at the WIPP. Chemical constituents shall conform to the lists of allowable materials in Tables 4.3-1 through 4.3-8 of the CH-TRAMPAC, and Tables 4.3-1 through 4.3-7 of the TRUPACT-III TRAMPAC, as applicable. Other chemicals or materials not identified in these tables are allowed provided that they meet the requirements as specified in Section 4.3.1 of the CH-TRAMPAC and TRUPACT-III TRAMPAC (Reference 10, Attachment C, Section C-1c; Reference 10, Part 2, Section 2.3.3.4; References 24 and 25, Section 4.4.1). Also see Appendix H.3 of this document.

### 3.5.4 Explosives, Corrosives, and Compressed Gases

Acceptance Criterion. Waste shall contain no explosives, corrosives, or compressed gases (pressurized containers) (Reference 10, Attachment C, Section C-1c; Reference 10, Part 2, Sections 2.3.3.5 and 2.3.3.7; References 24 and 25, Section 4.2.1).

### 3.5.5 Headspace Gas Concentrations

Acceptance Criterion. The headspace gas of payload containers shall be determined in accordance with a programmatic or waste-specific TRAMPAC (References 24 and 25, Section 5.2.1), as required.

### 3.5.6 Polychlorinated Biphenyls

Acceptance Criterion. For TRU and TRU-mixed wastes containing PCBs meeting the conditions of approval in Reference 13, the payload container data entered into the WWIS database shall include the earliest date of waste generation (i.e., the date of removal from service for disposal), the date of waste certification for disposal, and the date the waste was sent to the WIPP for disposal (Reference 13, Section III.D.4). Additionally, the estimated weight of the PCBs in kilograms (as recorded on the uniform hazardous waste manifest), and a description of the type of PCB waste (e.g., PCB remediation waste, PCB bulk product waste, etc.) shall be entered into the WWIS database (References 14, §761.207(a)(2) and §761.180). Hanford, Idaho National Laboratory, Savannah River Site, Oak Ridge Reservation, Knolls Atomic Power Laboratory, and Los Alamos National Laboratory are authorized to ship their TRU and TRU-mixed wastes containing PCBs to the WIPP (References 15 and 16).

Other sites in the DOE complex may also identify some TRU waste that contains PCBs during the process of characterizing their TRU waste for disposal at the WIPP. Subject

to NEPA review, as appropriate, CBFO will make a determination regarding the acceptability of waste from these DOE sites at the WIPP.

### 3.6 Data Package Contents

#### 3.6.1 Characterization and Certification Data

Acceptance Criterion. WCPs shall prepare a WSPF for each waste stream. Each WSPF shall be approved by the Permittees prior to the first shipment of that waste stream. Characterization and certification information for each payload container shall be submitted to the WWIS database and approved by the Data Administrator. WCPs are required to estimate the CPR weights and report these estimates to the WWIS database on a payload container basis. Any payload container from a waste stream that has not been preceded by an appropriate certified WSPF is not acceptable at the WIPP (Reference 10, Part 2, Section 2.3.3.10).

#### 3.6.2 Shipping Data

Acceptance Criterion. WCPs shall prepare either a bill of lading or a uniform hazardous waste manifest for CH TRU waste shipments as required by the transportation requirements. The land disposal restriction notification for CH TRU mixed waste shipments shall state that the waste is not prohibited from land disposal (Reference 10, Attachment C, Section C-5b(2)).



#### 4.0 WASTE ACCEPTANCE REQUIREMENTS AND CRITERIA FOR RH WASTE

The requirements and associated criteria for acceptance of defense TRU waste at the WIPP for disposal are identified in this WAC. The acceptance criteria of this WAC describe the controlling (i.e., the most restrictive) requirements to be used by the DOE sites in preparing their waste for transportation to and disposal at the WIPP. In some instances the acceptance criteria and regulatory requirements are synonymous. The WAC requirements are taken from several source documents including but not limited to the WIPP DSA (Reference 4), the RH-TRU 72-B and 10-160B Certificates of Compliance (References 8 and 9), the WIPP LWA (Reference 2), the WIPP Hazardous Waste Facility Permit (Reference 10), the Compliance Recertification Decision (Reference 11), the Initial Report for PCB Disposal Authorization (Reference 12), the EPA letter of approval to land dispose non-liquid PCBs at the WIPP (References 13 and 14), the Revision to the Record of Decision for the DOE's WIPP Disposal Phase and associated WIPP NEPA database (References 15 and 16), the EPA's letter of approval of DOE's RH TRU Waste Characterization Program (Reference 17), and the Remote-Handled TRU Waste Characterization Program Implementation Plan (Reference 18). Definitions of terms used in this WAC are included in Appendix C.

When implementing this WAC, WCPs should refer to these source documents, 40 CFR §194.8 and 194.24, and other WIPP program documents including Performance Demonstration Program Plans and the Quality Assurance Program Document, as applicable, for information pertinent to the DOE system of controls, including compilation of AK.

##### 4.1 Summary of WIPP Authorization Basis

The purpose of section 4.0 and related appendices is to present the requirements and associated criteria that must be met for RH TRU waste to be transported to, managed at, and disposed of at the WIPP. The requirements and associated criteria are organized under five major headings: Container Properties, Radiological Properties, Physical Properties, Chemical Properties, and Data Package Contents. Only TRU waste from a properly characterized and approved waste stream may be certified as meeting the requirements and associated criteria contained in this WAC. Any waste container from a waste stream which has not been preceded by an appropriate certified WSPF is not acceptable at the WIPP (Reference 10, Part 2, Section 2.3.3.10).

WCPs' plans and procedures shall contain details of the processes, controls, techniques, tests, and other actions to be applied to each TRU payload container, waste stream, and shipment. Methods of compliance with each requirement shall be described and the specific procedure cited. These methods of compliance shall include procedural controls, administrative controls, and waste generation process controls. The QA requirements applicable to waste characterization, certification, and transportation are addressed in various sections of this WAC and are briefly summarized in section 5.0. The data resulting from the implementation of the plans and

procedures will form the basis for verifying that TRU waste to be sent to WIPP is certified to meet the WAC by the responsible WCP certifying official(s).

WCPs shall transmit required characterization, certification, and shipping data to the WWIS database using the WDS. The WWIS is an electronic database and is a subsystem of the WDS. The WDS is equipped with edit/limit checks to verify that the data representing the waste payload containers are in compliance with this WAC. Before shipping TRU waste payload containers from a WIPP-accepted waste stream, the WCP shall transmit the required waste characterization, certification, and shipping data via WDS to the WWIS database. WCPs may periodically be requested to transmit payload container radiography reports or other data to WIPP. WIPP will not accept any waste shipments for disposal if the waste payload container information has not been correctly submitted and approved for shipment by the WWIS Data Administrator. The Waste Data System User's Manual (Reference 23) provides the information needed by WCPs to perform tasks associated with transmittal of the payload container's characterization, certification, and shipment information to WIPP.

DOE sites will be notified of revisions to external regulatory requirements by CBFO. Revisions of requirements in referenced documents not controlled by the DOE (but by, for example, the EPA, NRC, or NMED) shall have precedence over the values specified here if they are more restrictive. These changes will be incorporated in future revisions of the WAC.

#### 4.1.1 DOE Operations and Safety Requirements for WIPP

The WIPP DSA addresses TRU waste handling and emplacement operations. The waste accepted for emplacement in the WIPP must conform to the WAC to meet the DSA (Reference 4). The DSA documents the safety analyses that develop and evaluate the adequacy of the WIPP safety basis necessary to ensure the safety of workers, the public, and the environment from the hazards posed by WIPP waste receiving, handling, and emplacement operations. The DSA establishes and evaluates the adequacy of the safety basis in response to plant normal and abnormal operations and postulated accident conditions.

#### 4.1.2 NRC Transportation Safety Requirements

Acceptable methods for payload compliance are defined in the RH-TRU 72-B and 10-160B Certificates of Compliance (References 8 and 9). For shipments to WIPP in a RH-TRU 72-B, each WCP must prepare a programmatic or waste-specific RH-TRAMPAC describing how it will ensure compliance with each payload parameter. This technical plan shall contain sufficient detail to allow reviewers to adequately understand and evaluate the compliance methodology for each payload parameter.

The payload requirements for the 10-160B package and site-specific compliance are specified by the 10-160B SAR (Reference 40). For shipments in the 10-160B package, each DOE site must prepare a site-specific appendix to the 10-160B SAR for approval

by the NRC. The 10-160B SAR does not require the preparation of a programmatic or waste-specific "TRAMPAC."

WCPs shall have a packaging QA program that defines the QA activities that apply to the use of NRC-approved transportation packagings equivalent to 10 CFR Part 71, Subpart H (Reference 26).

#### 4.1.3 NMED Hazardous Waste Facility Permit Requirements

TRU waste is classified as TRU-mixed waste if it contains hazardous constituents regulated under the New Mexico Hazardous Waste Act (Reference 27). Only TRU-mixed waste and TRU waste that have been characterized in accordance with the WIPP WAP and that meet the TSDf waste acceptance criteria as presented in HWFP Sections 2.3.3.1 through 2.3.3.10 will be accepted at the WIPP facility for disposal in the permitted underground hazardous waste disposal unit.

Prior to disposal, each participating WCP shall develop and implement a QAPjP that addresses all the applicable requirements specified in the WIPP WAP. In accordance with Attachment C5 of the WAP, the QAPjP will include the qualitative or quantitative criteria for determining whether the waste characterization programs are being satisfactorily performed. All WCPs' QAPjPs will be reviewed and approved by the CBFO.

#### 4.1.4 EPA Requirements

##### 4.1.4.1 EPA Compliance Recertification Decision

Title 40 CFR §194.24(c) states that the DOE shall specify the limiting values for waste components to be emplaced in the repository (Reference 28). The EPA's Compliance Recertification Decision (Reference 11) identifies the repository limits for several waste components including free water, metals, and CPR. Although the Recertification does not specify limiting values for the activities and masses of specific radionuclides, it identifies the listed values for a number of radionuclides that are considered in the Performance Assessment. To demonstrate that the cumulative total activities of the specified radionuclides ( $^{241}\text{Am}$ ,  $^{238}\text{Pu}$ ,  $^{239}\text{Pu}$ ,  $^{240}\text{Pu}$ ,  $^{242}\text{Pu}$ ,  $^{233}\text{U}$ ,  $^{234}\text{U}$ ,  $^{238}\text{U}$ ,  $^{90}\text{Sr}$ , and  $^{137}\text{Cs}$ ) are consistent with the levels used for the Performance Assessment and the Recertification, reporting and tracking of the specified radionuclides is necessary (see Appendix A). TRU waste payload containers shall contain more than 100 nCi/g of alpha-emitting TRU isotopes with half-lives greater than 20 years, as specified in section 4.3.3 of this WAC.

The repository limit for free water is a maximum of 1684 m<sup>3</sup> and is met by the observable liquid criterion specified in section 4.4.1 of this WAC.

The limits for metals are a minimum of 2 X 10<sup>7</sup> kg for ferrous metals and 2 X 10<sup>3</sup> kg for nonferrous metals. These limits will be met in the total repository inventory by the metals that constitute the payload containers alone; thus, WIPP tracks the number and

type of payload containers emplaced in the repository as reported to the WWIS database by the WCPs (see section 4.2.1). The repository limit for CPR is a maximum of  $2.2 \times 10^7$  kg. The WDS will calculate the plastic value on a payload container basis as required by section 4.4.3.

WCPs must quantify and report the activities and masses of specific radionuclides for the purpose of tracking the total radionuclide inventory of the repository as specified in section 4.3.1 of this WAC. The presence or absence of these specific radionuclides is determined from AK, direct measurement, computations, or a combination thereof (Reference 18, section 2.2.6). The results of this determination are reported to the WWIS database on a payload container basis.

#### 4.1.4.2 EPA Approval for PCB Disposal

PCB-contaminated TRU and PCB-contaminated TRU waste mixed with a hazardous waste including PCB remediation waste, PCB articles, and PCB bulk product waste may be stored and disposed at the WIPP (References 11, 12, 13, 14, 15, and 16).

Waste streams identified as containing PCBs shall be brought to the attention of the CBFO in order that a determination can be made regarding their acceptability at WIPP.

#### 4.1.5 WIPP Land Withdrawal Act Requirements

The term "WIPP" means the Waste Isolation Pilot Plant project authorized under Section 213 of the Department of Energy National Security and Military Applications of Nuclear Energy Authorization Act of 1980 (Pub. L. 96-164; 93 Stat. 1259, 1265), to demonstrate the safe disposal of radioactive waste materials generated by atomic energy defense activities (Reference 1). Hence, by law, WIPP can accept only radioactive waste generated by atomic energy defense activities of the United States (Reference 2, Section 2[19]).

The DOE and its predecessor agencies were engaged in a broad range of activities that fall under the heading of atomic energy defense activities. A TRU waste is eligible for disposal at WIPP if it has been generated in whole or in part by one or more of the following functions (References 29 and 30):

- naval reactors development
- weapons activities, including defense inertial confinement fusion
- verification and control technology
- defense nuclear materials production
- defense nuclear waste and materials by-products management
- defense nuclear materials security and safeguards and security investigations
- defense research and development

Using AK, DOE sites must determine that each waste stream to be disposed of at WIPP is "defense" TRU waste (Reference 2).

High-level radioactive waste or spent nuclear fuel shall neither be transported, emplaced, nor disposed of at WIPP (Reference 2, Section 12). Also, no TRU waste may be transported by or for the DOE to or from WIPP except in packages (1) the design of which has been certified by the NRC, and (2) that have been determined by the NRC to satisfy its QA requirements (Reference 2, Section 16[a]).

## 4.2 Container Properties

### 4.2.1 Description

*Acceptance Criterion.* The only payload containers authorized for receipt of RH-TRU waste in the RH bay of the Waste Handling Building at WIPP include RH-TRU waste canisters and 55-gallon drums shipped in RH-TRU 72-B and 10-160B packaging, respectively (References 41 and 9). The WCP shall report the number and type of payload containers to the WWIS database.

Payload containers must meet DOT Type 7A standards (Reference 4, Section 2.3.2). Prior to loading in the transportation packaging, the exterior of a payload container must undergo 100% visual inspection to ensure compliance with the requirement that payload containers be in good and unimpaired condition. The results of this visual inspection must be documented. Inspection of payload containers shall be documented using the payload container integrity checklist contained in Appendix D. A payload container is in good and unimpaired condition if it does not have significant rusting, is of sound structural integrity, and does not show signs of leakage.

The RH-TRU waste canister shall comply with the specifications in the RH-TRAMPAC (Reference 43).

### 4.2.2 Weight Limits

*Acceptance Criterion.* Each payload container shall comply with the following maximum (gross) weight limit (Reference 41):

- Removable Lid Canister (direct loaded or drum loaded) – 4240 lb
- NS15 Neutron Shielded Canister – 3100 lbs
- NS30 Neutron Shielded Canister – 3100 lbs
- 1000 lbs (453.59 kg) per 55-gallon drum (Reference 4, Section 2.5.2.2)

See the RH-TRU 72-B and/or 10-160B packaging Certificates of Compliance for applicable package weight limits (References 8 and 9).

#### 4.2.3 Assembly Configurations

Acceptance Criterion. See the RH-TRU 72-B and/or 10-160B packaging Certificates of Compliance for applicable assembly configuration requirements (References 8 and 9).

#### 4.2.4 Removable Surface Contamination

Acceptance Criterion. Removable surface contamination on RH TRU waste payload containers, payload assemblies, and packagings shall not exceed 20 dpm/100 cm<sup>2</sup> alpha and 200 dpm/100 cm<sup>2</sup> beta-gamma (Reference 10, Attachment A1, Section A1-1d[2]; References 31 and 32). The fixing of surface contamination to meet these criteria is not allowed by WIPP in accordance with best management practices for ensuring worker radiation dose is within the ALARA guidelines.

#### 4.2.5 Identification/Labeling

Acceptance Criterion. Each payload container shall be labeled with a unique payload container identification number permanently applied in a conspicuous location. The unique payload container identification number shall include a DOE site identifier as a prefix.

For RH-TRU waste canisters, payload container labeling shall be as follows:

- Each canister shall be labeled with a unique payload container identification number (ID) that includes a DOE site identifier as a prefix.
- The characters composing the canister ID number shall be approximately 2-inches high and of a color contrasting with their background.
- A minimum of three canister ID numbers shall be placed at approximately equal intervals around the circumference of the canister and within 18-inches of the top of the canister.

Any exception to these identification/labeling requirements is subject to CBFO's review and approval.

The 10-160B 55-gallon payload container identification number shall be in medium to low density Code 39 bar code symbology as required by ANSI, standard ANSI/AIM BC1-1995 (Reference 33) in characters at least 1-inch high and alphanumeric characters at least ½-inch high. In the case of 55-gallon drums, the labels must be placed approximately 120 degrees apart so that one label is visible once the containers are assembled into a 5-drum carriage.

Payload containers shall be marked "Caution Radioactive Material" using a yellow and either a magenta or black label as specified in 10 CFR Part 835 (Reference 32). Those payload containers, whose contents are also RCRA regulated (mixed-TRU), shall be

additionally marked "Hazardous Waste" as specified in 40 CFR §262.32 (Reference 35). DOT Type B packages containing PCBs must be properly marked in accordance with 40 CFR §761.40 (References 13 and 14).

If an empty 55-gallon drum is used as dunnage to complete a payload configuration in the 10-160B package, the dunnage container shall be labeled with the following information:

- Unique payload container identification number
- "EMPTY" or "DUNNAGE"

If a five-drum carriage of only dunnage 55-gallon drums is used in the 10-160B, the containers shall be labeled only "EMPTY" or "DUNNAGE," and the unique container identification number label is not required for these containers.

#### 4.2.6 Dunnage

Acceptance Criterion. See the 10-160B packaging Certificate of Compliance for dunnage requirements (Reference 9).

To maximize the efficiency of operations at the WIPP, the use of dunnage drums should be minimized.

#### 4.2.7 Filter Vents

Acceptance Criterion. Each payload container and any sealed secondary or internal containers (greater than 4 liters in size) in the payload container shall meet the filter vent specifications of Reference 41, Section 2.4.1; and Reference 10, Attachment A1, Section A1-1b[2]. These filter vents shall meet the specifications of the 10-160B SAR and RH-TRAMPAC as applicable. The model number of each filter vent or combination of filter vents installed on a payload container shall be reported to the WWIS database (Reference 47).

### 4.3 Radiological Properties

With respect to the required radiological properties identified within this section, they can be divided into two distinct groups.

The first group includes the activities and masses of the ten WIPP-tracked radionuclides (i.e.,  $^{241}\text{Am}$ ,  $^{238}\text{Pu}$ ,  $^{239}\text{Pu}$ ,  $^{240}\text{Pu}$ ,  $^{242}\text{Pu}$ ,  $^{233}\text{U}$ ,  $^{234}\text{U}$ ,  $^{238}\text{U}$ ,  $^{90}\text{Sr}$ , and  $^{137}\text{Cs}$ ) and the TRU alpha activity concentration (i.e., >100 nCi/g of alpha-emitting TRU isotopes with half lives greater than 20 years) of the waste. This set of radiological properties is regulated by the EPA in accordance with 40 CFR Parts 191 and 194 (References 36 and 28). Total activity will be quantified and tracked to ensure compliance with the WIPP LWA limits for RH TRU waste including limiting activity to 23 curies per liter (Ci/l) per canister, limiting disposed RH TRU waste to 5.1 million curies, and limiting surface dose rates of

canisters to 1000 roentgen equivalent man per hour (rem/hr). No more than 5 percent by volume of the remote-handled transuranic waste received at WIPP may have a surface dose rate in excess of 100 rems per hour. Estimates of their activities and masses shall be derived from a system of controls certified by CBFO that includes AK, computations, measurements, sampling, etc. (Reference 37). The RH TRU Waste Characterization Program Implementation Plan provides the methods and requirements used to characterize the radiological composition of the RH TRU waste.

The second group includes the remaining radionuclides contributing to the FGE, the PE-Ci, and the decay heat of the payload container. This set of radiological data is regulated both by the NRC as specified in the RH transportation documentation (References 8 and 9) and the CBFO as summarized by the WIPP DSA (Reference 4). PE-Ci quantities shall be calculated for each payload container in accordance with Appendix B. Any method that complies with the Certificate of Compliance may be used to quantify the remaining radiological properties at the discretion of the shipping facility.

However, the resulting data (e.g., AK from Safeguards and Security data), the source and method from which the data was generated, and the basis for the reliability of the data shall be submitted to and approved by CBFO prior to use.

#### 4.3.1 Radionuclide Composition

*Acceptance Criterion.* Remote-handled transuranic waste received at WIPP shall not exceed 23 curies per liter maximum activity level (averaged over the volume of the canister) (Reference 2, Section 7).

Contents of the 10-160B package may include fissile material contaminants provided the mass limits of 10 CFR §71.15 are not exceeded and the plutonium content does not exceed 0.74 tera-becquerel (20 curies) (Reference 9). The quantity of radioactive material must not exceed 3,000 times the Type A quantity (Reference 9).

The activities and masses of  $^{241}\text{Am}$ ,  $^{238}\text{Pu}$ ,  $^{239}\text{Pu}$ ,  $^{240}\text{Pu}$ ,  $^{242}\text{Pu}$ ,  $^{233}\text{U}$ ,  $^{234}\text{U}$ ,  $^{238}\text{U}$ ,  $^{90}\text{Sr}$ , and  $^{137}\text{Cs}$  shall be established on a payload container basis for purposes of tracking their contributions to the total WIPP radionuclide inventory (Reference 37). The estimated activities and masses, including their associated TMU expressed in terms of one standard deviation, for these ten radionuclides shall be reported to the WWIS database on a payload container basis. For any of these ten radionuclides whose presence can be substantiated from AK, direct measurement, computations, or a combination thereof, and for which measured data are reported as being below the LLD or MDA for that radionuclide, the WCP shall report the character string "< LLD" to the WWIS database for the activity and mass of that radionuclide; otherwise a value of zero shall be reported (Reference 18, Section 2.2.6). Quantitative estimates for either the LLD or MDA shall not be used when calculating related radiological properties of the waste such as TRU alpha activity concentration,  $^{239}\text{Pu}$  fissile gram equivalent, decay heat, and  $^{239}\text{Pu}$  equivalent activity. See Appendix A, Section A.3, of this document for information pertaining to the development and application of LLD or MDA.



In addition, all radionuclides other than the ten WIPP-tracked radionuclides (i.e.,  $^{241}\text{Am}$ ,  $^{238}\text{Pu}$ ,  $^{239}\text{Pu}$ ,  $^{240}\text{Pu}$ ,  $^{242}\text{Pu}$ ,  $^{233}\text{U}$ ,  $^{234}\text{U}$ ,  $^{238}\text{U}$ ,  $^{90}\text{Sr}$ , and  $^{137}\text{Cs}$ ) that contribute to 95% of the radioactive hazard for the payload container shall be reported on the RH-TRU 72-B or 10-160B bill of lading or manifest in accordance with 49 CFR §172.203 and 49 CFR §173.433 (Reference 38, Reference 39). The activities and masses of these other radionuclides shall also be reported to the WWIS database along with their associated TMU, expressed in terms of one standard deviation for each waste container (Reference 37).

#### 4.3.2 $^{239}\text{Pu}$ Fissile Gram Equivalent/ $^{235}\text{U}$ Fissile Equivalent Mass (FEM)

Acceptance Criterion. Each canister must comply with the limits in either Table 3 or Table 5 or meet the fissile material exemption of 10 CFR §71.15. In the case of Table 3 or Table 5, either the sum of the  $^{239}\text{Pu}$  FGE plus two times its associated TMU, expressed in terms of one standard deviation, shall comply with the applicable limits in Table 3 or the  $^{235}\text{U}$  FEM weight percentage plus two times its associated TMU, with TMU expressed in terms of one standard deviation, shall comply with the applicable limit in Table 5 (Reference 41).

See the 10-160B packaging Certificate of Compliance for applicable package requirements (Reference 9) and Table 4 for associated drum requirements.

The value calculated for  $^{239}\text{Pu}$  FGE or  $^{235}\text{U}$  FEM and their associated TMUs (expressed in terms of one standard deviation) shall be reported to the WWIS database for each payload container.

**Table 3 <sup>239</sup>Pu FGE Limits for a Canister Shipped in an RH-TRU 72-B Package**

Payload Contents	<sup>239</sup> Pu FGE Limit (Removable/Welded Lid Canister)	<sup>239</sup> Pu FGE Limit (Neutron Shielded Canister)
Non-Machine-Compacted Waste		
Be/BeO limited to ≤ 1% by weight of the waste	≤ 315	≤ 245
Be/BeO limited to ≤ 1% by weight of the waste including credit taken for ≥ 5g of <sup>240</sup> Pu Poisoning <sup>1</sup>	≤ 325	≤ 245
Be/BeO limited to ≤ 1% by weight of the waste including credit taken for ≥ 15g of <sup>240</sup> Pu Poisoning <sup>1</sup>	≤ 350	≤ 245
Be/BeO limited to ≤ 1% by weight of the waste including credit taken for ≥ 25g of <sup>240</sup> Pu Poisoning <sup>1</sup>	≤ 370	≤ 245
Be/BeO > 1% by weight of the waste and is chemically or mechanically bound to the fissile material	≤ 305	Unauthorized
Be/BeO > 1% by weight of the waste and is not chemically or mechanically bound to the fissile material	≤ 100	Unauthorized
Machine-Compacted Waste		
Be/BeO limited to ≤ 1% by weight of the waste	≤ 245	≤ 245

<sup>1</sup>The minimum <sup>240</sup>Pu content for the RH-TRU waste canister shall be determined after the subtraction of two times the error.

**Table 4 <sup>239</sup>Pu FGE Limits for Drums Shipped in a 10-160B Package**

Payload Contents	<sup>239</sup> Pu FGE Limit
Non-Machine-Compacted Waste	
55-gallon drum (Be/BeO limited to ≤ 1 % by weight of the waste)	≤ 200 g
55-gallon drum (Be/BeO > 1 % by weight of the waste)	≤ 100 g
Machine-Compacted Waste	
55-gallon drum (Be/BeO limited to ≤ 1 % of the weight of the waste)	≤ 170 g
55-gallon drum (Be/BeO limited ≤ 1 % of the weight of the waste). 1.0-in. design spacing must be maintained between drum content and exterior top and bottom	≤ 200 g

**Table 5 <sup>235</sup>U FEM Limit for a Canister Shipped in an RH-TRU 72-B Package**

Payload Contents	Weight % <sup>235</sup> U FEM (Removable/Fixed Lid Canister)	Weight % <sup>235</sup> U FEM (Neutron Shielded Canister)
Non-machine compacted homogeneous solid/sludge with a particle size characteristic dimension of 1 inch or less that is primarily uranium (in terms of heavy metal component) with waste matrix distributed to not exceed enrichment limit (Reference 8)	≤ 0.96	Not Applicable

#### 4.3.3 TRU Alpha Activity Concentration

*Acceptance Criterion.* Payload containers shall contain TRU waste. TRU waste shall contain more than 100 nanocuries of alpha-emitting transuranic isotopes per gram of waste, with half-lives greater than 20 years (Reference 2, Section 2 [18]). Without taking into consideration the TMU, the TRU alpha activity concentration for a payload container is determined by dividing the TRU alpha activity of the waste by the weight of the waste.

The TRU alpha activity concentration shall be reported to the WWIS database (Reference 37, Chapter 4, Section 4.3.2; Reference 18, Section 2.2.5).

#### 4.3.4 <sup>239</sup>Pu Equivalent Activity

Acceptance Criterion. PE-Ci limits are shown in Table 6.

PE-Ci quantities shall be calculated for each payload container (see Appendix B) and reported to the WWIS database (Reference 4, Section 3.4.1.2 and Table 3.4-1 ). There are no reporting requirements for the associated TMU.

**Table 6 PE-Ci Limits for RH-TRU Waste Payload Containers**

<b>Payload Container</b>	<b>Packing Configuration</b>	<b>PE-Ci Limit</b>
RH-TRU Waste Canister	All approved waste forms other than solidified/vitrified waste	≤ 240
55-Gallon Drum (shipped in a 10-160B)		≤ 80
RH-TRU Waste Canister	Solidified/vitrified waste	≤ 1800
55-Gallon Drum (shipped in a 10-160B)		

#### 4.3.5 Radiation Dose Equivalent Rate

Acceptance Criterion. The external surface radiation dose equivalent rate of individual containers must be  $\geq 200$  mrem/hr and  $\leq 1000$  rem/hr (Reference 2, Sections 2 and 7). Containers whose dose rate is greater than or equal to 200 mrem/hr but when placed into a payload container result in that payload container being less than 200 mrem/hr can be shipped as RH waste. Total dose equivalent rate and the neutron contribution to the total dose equivalent rate shall be reported for each payload container to the WWIS database (Reference 2, Section 16; Reference 18, Section 2.2.4).

See the RH-TRU 72-B and/or 10-160B packaging Certificates of Compliance for applicable radiation dose equivalent rate requirements (References 8 and 9).

#### 4.3.6 Decay Heat

Acceptance Criterion. See the RH-TRU 72-B RH-TRAMPAC and/or 10-160B packaging Certificate of Compliance for applicable decay heat requirements (References 41 and 9).

#### 4.4 Physical Properties

##### 4.4.1 Observable Liquid

Acceptance Criterion. Liquid waste is not acceptable at WIPP. Liquid in the quantities delineated below is acceptable.

- Observable liquid shall be less than 1 percent by volume of the outermost container at the time of radiography or visual examination (Reference 10). The limit of “less than 1 percent” is taken from the RH-TRAMPAC and is more restrictive than the limit of “no more than 1 percent” in the HWFP.
- Internal containers with more than 60 milliliters or 3 percent by volume observable liquid, whichever is greater, are prohibited (Reference 10).
- Containers with Hazardous Waste Number U134 assigned shall have no observable liquid (Reference 10).
- Overpacking the outermost container that was examined during radiography or visual examination or redistributing untreated liquid within the container shall not be used to meet the liquid volume limits (Reference 10).
- The disposal of free-flowing PCB liquids (i.e., observable liquids) is prohibited except that incidental liquids such as, but not limited to, rainwater, groundwater, condensate, leachate, load separation and dust control liquid, are allowed in PCB/TRU and PCB/TRU mixed bulk product waste containers less than 1 percent by volume of the outermost container at the time of radiography or visual examination (Reference 13). The limit of “less than 1 percent” is taken from the CH-TRAMPAC and TRUPACT-III TRAMPAC and is more restrictive than the limit of “up to 1 percent” as stated in EPA’s letter of approval for disposal of TRU and TRU-mixed wastes containing PCBs.

For characterization programs that use VE, the detection of any liquid in non-transparent internal containers, detected from shaking the internal container, will be handled by assuming that the internal container is filled with liquid and adding this volume to the total liquid in the container being characterized using VE (Reference 10, Attachment C, Section C-3b; Reference 37).

#### 4.4.2 Sealed Containers

Acceptance Criterion. Sealed containers that are greater than 4 liters (nominal) are prohibited except for metal containers packaging solid inorganic waste. This packaging configuration does not generate flammable gas (Reference 41, Section 2.7.1).

#### 4.4.3 Physical Form

Acceptance Criterion. Debris waste (S5000) shall be reported to the WWIS database as plastic using the volume of the waste container multiplied by 620 kg/m<sup>3</sup> up to the net weight of the waste. Soils and gravel (S4000) shall be reported to the WWIS database as the net weight of the waste with the waste material parameter type of "soil." Homogeneous solids (S3000) shall be reported to the WWIS database as the net weight of the waste with the waste material parameter type appropriate to the waste. Debris included in containers of S3000 or S4000 waste shall be reported to the WWIS database as plastic with an estimated weight. Plastic packaging will also be reported to the WWIS database as packaging (Reference 18, Section 2.2.3).

#### 4.5 Chemical Properties

##### 4.5.1 Pyrophoric Materials

Acceptance Criterion. Radioactive pyrophoric materials shall be limited to residual amounts (<1 percent by weight) in payload containers and shall be generally dispersed in the waste in accordance with best management practices for ensuring worker protection. Radioactive pyrophorics in concentrations  $\geq 1$  percent by weight and all nonradioactive pyrophorics shall be reacted (or oxidized) and rendered nonreactive prior to placement in the payload container (Reference 41, Section 4.1.1).

Nonradionuclide pyrophoric materials are not acceptable at WIPP (Reference 4, Section 11.4.1; Reference 10, Attachment C, Section C-1c; Reference 10, Part 2, Section 2.3.3.2).

##### 4.5.2 Hazardous Waste

Acceptance Criterion. Hazardous wastes not occurring as co-contaminants with TRU wastes (non-mixed hazardous wastes) are not acceptable at WIPP. Each RH-TRU mixed waste container shall be assigned one or more hazardous waste numbers as appropriate. Only EPA hazardous waste numbers listed as allowable in the Hazardous Waste Facility Permit may be managed at WIPP. Some of the waste may also be identified by unique state hazardous waste codes. These wastes are acceptable at WIPP as long as the TSDF waste acceptance criteria are met (Reference 10, Attachment C, Section C-1b; Reference 10, Part 2, Sections 2.3.3.3 and 2.3.4). Wastes exhibiting the characteristic of ignitability, corrosivity, or reactivity (EPA hazardous waste numbers of D001, D002, or D003) are not acceptable at WIPP (Reference 10, Attachment C, Section C-1c; Reference 10, Part 2, Sections 2.3.3.3, 2.3.3.7, and 2.3.4).

#### 4.5.3 Chemical Compatibility

Acceptance Criterion. TRU waste containing incompatible materials or materials incompatible with payload container and packaging materials, shipping container materials, other wastes, repository backfill, or seal and panel closure materials are not acceptable for transport in the RH-TRU 72-B or 10-160B packages or for disposal at the WIPP. Chemical constituents of allowed content codes shall conform to the lists of allowable materials in the RH-TRAMPAC and Appendix 4.10.2 of the 10-160B SAR (References 41 and 40). The content code must be reported to the WWIS database for each payload container.

The total quantity of the trace chemicals/materials (materials that occur in the waste in quantities less than 1 percent [weight]) not listed in Table 4.3-1 (Reference 41) in the payload container is restricted to less than 5 percent (weight). Also see Appendix H.3 of this document.

#### 4.5.4 Explosives, Corrosives, and Compressed Gases

Acceptance Criterion. Waste shall contain no explosives, corrosives, or compressed gases (pressurized containers) (Reference 10, Attachment C, Section C-1c; Reference 10, Part 2, Sections 2.3.3.5 and 2.3.3.7; Reference 41, Section 4.2.1).

#### 4.5.5 Headspace Gas Concentrations

Acceptance Criterion. The headspace gas of payload containers shall meet the requirements in the following approved documents, as applicable: the programmatic or waste-specific TRAMPAC (if shipping in RH-TRU 72-B packaging), or Appendix 4.10.2 (if shipping in 10-160B packaging) (References 41 and 40, respectively).

#### 4.5.6 Polychlorinated Biphenyls

Acceptance Criterion. For TRU and TRU-mixed wastes containing PCBs meeting the conditions of approval in Reference 13, the payload container data entered into the WWIS database shall include the earliest date of waste generation (i.e., the date of removal from service for disposal), the date of waste certification for disposal, and the date the waste was sent to the WIPP for disposal (Reference 13, Section III.D.4). Additionally, the estimated weight of the PCBs in kilograms (as recorded on the uniform hazardous waste manifest) and a description of the type of PCB waste (e.g., PCB remediation waste, PCB bulk product waste, etc.) shall be entered into the WWIS database (Reference 14, §761.207(a)(2) and §761.180). Hanford, Idaho National Laboratory, Savannah River Site, Oak Ridge Reservation, Knolls Atomic Power Laboratory, and Los Alamos National Laboratory are authorized to ship their TRU and TRU-mixed wastes containing PCBs to WIPP (References 15 and 16).

Other sites in the DOE complex may also identify some TRU waste that contains PCBs during the process of characterizing their TRU waste for disposal at WIPP. Subject to

NEPA review, as appropriate, CBFO will make a determination regarding the acceptability of waste from these DOE sites at WIPP.

#### 4.6 Data Package Contents

##### 4.6.1 Characterization and Certification Data

Acceptance Criterion. WCPs shall prepare a WSPF for each waste stream. Each WSPF shall be approved by the Permittees prior to the first shipment of that waste stream. Characterization and certification information for each payload container shall be submitted to the WWIS database and approved by the Data Administrator. Any payload container from a waste stream that has not been preceded by an appropriate certified WSPF is not acceptable at WIPP (Reference 10, Part 2, Section 2.3.3.10).

See the WCPIP (Reference 18) for additional characterization and certification data requirements.

##### 4.6.2 Shipping Data

Acceptance Criterion. WCPs shall prepare either a bill of lading or a uniform hazardous waste manifest for RH TRU waste shipments as required by the transportation requirements. The land disposal restriction notification for RH TRU mixed waste shipments shall state that the waste is not prohibited from land disposal (Reference 10, Attachment C, Section C-5b(2)).



## 5.0 QUALITY ASSURANCE REQUIREMENTS

Quality assurance is an integral part of TRU waste characterization, certification, transportation, and operation activities. This section defines the QA program requirements that provide confidence that TRU waste characterization, certification, and transportation activities will be performed satisfactorily by each participating WCP. The QA requirements applicable to WIPP are addressed in the QAPD (Reference 19).

Each WCP shall be responsible for developing, documenting, and implementing site-specific QA plans that address the elements of the QAPD that apply to their TRU waste program. Specifically, WCPs shall develop QA plans that govern TRU waste characterization, certification, and transportation activities. These site-specific QA plans shall be submitted to the CBFO for approval. TRU wastes may not be characterized, certified, or shipped to WIPP before CBFO approval of these QA plans. The CBFO and the Management and Operating Contractor will conduct audits and surveillances to ensure that the WCPs are in compliance with their approved site-specific QA plans.

### 5.1 Waste Characterization Quality Assurance Requirements

WCPs are responsible for describing required QA and quality control (QC) activities applicable to TRU waste characterization in site-specific QA documentation. All analytical laboratories analyzing WIPP waste characterization samples for the WCPs shall have established documented QA/QC programs.

Data quality objectives (DQOs) are qualitative and quantitative statements that specify WIPP program technical and quality objectives; they are determined through the DQO process (Reference 42). The DQOs for waste characterization activities relating to the physical and chemical properties of the waste are contained in the WAP of the WIPP HWFP (Reference 10, Attachment C3). The radioassay data quality objectives are given in Appendix A of this document.

Corrective action reports applicable to WAP requirements shall be resolved prior to waste shipment (Reference 10, Attachment C6, Section C6-4).

### 5.2 Waste Certification Quality Assurance Requirements

Participating WCPs shall develop and implement a site-specific QA plan for waste certification that describes the required QA and QC activities applicable to the certification of TRU waste to the WAC. Site-specific QA plans must comply with the requirements of the QAPD (Reference 19).

### 5.3 Waste Transportation Quality Assurance Requirements

Quality assurance requirements for the transportation of TRU waste involve two elements: compliance with payload control requirements and compliance with usage requirements, as applicable.

The QA requirements for payload control compliance are derived from the certificates of compliance for the TRUPACT-II, TRUPACT-III, HalfPACT, RH-TRU 72-B, and 10-160B issued by the NRC (References 5, 6, 7, 8, and 9). The QA requirements for compliance with usage requirements are derived from 10 CFR Part 71 and 49 CFR Part 173 (References 26 and 39), the Certificates of Compliance, DOE Orders 460.1 and 460.2 (References 43 and 44), the CH Packaging Program Guidance (Reference 45), and the RH Packaging Program Guidance (Reference 46).

Participating WCPs shall develop and implement site-specific QA plans that comply with these requirements. WCPs are responsible for describing the QA and QC activities applicable to the specific parameters of the transportation packaging methods for payload control. WCPs shall develop and implement a transportation packaging QA program that defines the QA and QC activities applicable to usage of the transportation systems, as applicable. The use, operation, and maintenance of the transportation systems by the user are conducted under a QA program approved by the appropriate DOE field offices. This program controls the use of the NRC-certified packaging and shall comply with the CH Packaging Program Guidance (Reference 45) and RH Packaging Program Guidance (Reference 46), as applicable.

## 6.0 REFERENCES

*NOTE: The current revision of these reference documents is applicable. The Internet links are provided for informational purposes only and may change without prior public notification.*

1. Public Law 96-164, 93 Stat. 1259. National Security and Military Applications of Nuclear Energy Authorization Act of 1980, Section 213(a). (<http://uscode.house.gov/status/pl/96/164.pdf>)
2. Public Law 102-579, 106 Stat. 4777, 1992 (as amended by Public Law 104-201, 1996). Waste Isolation Pilot Plant Land Withdrawal Act. (<http://www.wipp.energy.gov/library/CRA/BaselineTool/Documents/Regulatory%20Tools/10%20WIPPLWA1996.pdf>)
3. 42 U.S.C. 6901 et seq. Resource Conservation and Recovery Act (RCRA) of 1976. (<http://www.epa.gov/laws-regulations/summary-resource-conservation-and-recovery-act>)
4. U.S. Department of Energy. *Waste Isolation Pilot Plant Documented Safety Analysis*. DOE/WIPP-07-3372. Carlsbad, New Mexico, Waste Isolation Pilot Plant, U.S. Department of Energy. (<http://bellview/wsaf/safanal/documents/index.html> )
5. U.S. Nuclear Regulatory Commission. TRUPACT-II *Certificate of Compliance*. NRC Docket No. 71-9218. Washington, D.C., Office of Regulatory Procedures, U.S. Nuclear Regulatory Commission.
6. U.S. Nuclear Regulatory Commission. TRUPACT-III *Certificate of Compliance*. NRC Docket No. 71-9305. Washington, D.C., Office of Regulatory Procedures, U.S. Nuclear Regulatory Commission.
7. U.S. Nuclear Regulatory Commission. HalfPACT *Certificate of Compliance*. NRC Docket No. 71-9279. Washington, D.C., Office of Regulatory Procedures, U.S. Nuclear Regulatory Commission.
8. U.S. Nuclear Regulatory Commission. RH-TRU 72-B *Certificate of Compliance*. NRC- Docket- No. 71-9212. Office of Regulatory Procedures, U.S. Nuclear Regulatory Commission, Washington, D.C.
9. U.S. Nuclear Regulatory Commission. 10-160B *Certificate of Compliance*. NRC- Docket- No. 71-9204. Office of Regulatory Procedures, U.S. Nuclear Regulatory Commission, Washington, D.C.

10. New Mexico Environment Department. *Waste Isolation Pilot Plant Hazardous Waste Facility Permit*. NM4890139088-TSDF, Santa Fe, New Mexico.  
(<http://www.nmenv.state.nm.us/wipp/pdfpermit.html>)
11. 75 FR 70584. Criteria for the Certification and Recertification of the Waste Isolation Pilot Plant's Compliance with the Disposal Regulations: Recertification Decision: EPA Final Rule. Federal Register 75: 70584-70595, November 18, 2010, Radiation Protection Division, Washington, D.C.  
(<http://www.gpo.gov/fdsys/pkg/FR-2010-11-18/pdf/2010-28806.pdf>)
12. U.S. Department of Energy. *Waste Isolation Pilot Plant Initial Report for PCB Disposal Authorization*. DOE/WIPP 02-3196. Carlsbad, New Mexico, Carlsbad Field Office, U.S. Department of Energy.  
([http://www.wipp.energy.gov/rcradox/final/02-3196\\_PCB\\_Initial\\_3-19-02\\_4-29-02.pdf](http://www.wipp.energy.gov/rcradox/final/02-3196_PCB_Initial_3-19-02_4-29-02.pdf))
13. U.S. Environmental Protection Agency, Letter and enclosed *Conditions of Approval* from Wren Stenger (Director, Multimedia Planning and Permitting Division, EPA) to Jose R. Franco, Manager, Carlsbad Field Office, DOE, dated May 21, 2013, granting approval for WIPP to dispose of TRU and TRU-mixed wastes containing PCBs.  
([http://www.wipp.energy.gov/library/EPA/EPA\\_Permit\\_Approval\\_2013.pdf](http://www.wipp.energy.gov/library/EPA/EPA_Permit_Approval_2013.pdf))
14. Title 40 CFR Part 761. *Polychlorinated Biphenyls (PCBs) Manufacturing, Processing, Distribution in Commerce, and Use Prohibitions*. Code of Federal Regulations, Washington, D.C., Office of the Federal Register, National Archives and Records Administration. ([http://www.ecfr.gov/cgi-bin/text-idx?tpl=/ecfrbrowse/Title40/40cfr761\\_main\\_02.tpl](http://www.ecfr.gov/cgi-bin/text-idx?tpl=/ecfrbrowse/Title40/40cfr761_main_02.tpl))
15. 69 FR 39456. *Revision to the Record of Decision for the Department of Energy's Waste Isolation Pilot Plant Disposal Phase*. Federal Register 69: 39456-39459, June 30, 2004, Department of Energy, Washington, D.C.  
(<http://www.gpo.gov/fdsys>)
16. WIPP National Environmental Policy Act Database, June 19, 2007, Carlsbad, New Mexico, Waste Isolation Pilot Plant, U.S. Department of Energy.
17. U.S. Environmental Protection Agency, Letter and Enclosures from Frank Marcinowski (Director, Radiation Protection Division), to R. Paul Detwiler (Acting Manager, Carlsbad Field Office), dated March 26, 2004.  
(<http://www.wipp.energy.gov/rcradox/RH-EPAFinal3-26-04.pdf>)
18. U.S. Department of Energy. *Remote-Handled TRU Waste Characterization Program Implementation Plan*. DOE/WIPP-02-3214. Carlsbad, New Mexico, Carlsbad Field Office, U.S. Department of Energy.  
([http://www.wipp.energy.gov/rcradox/DOE-WIPP\\_02-3214\\_Rev\\_3.pdf](http://www.wipp.energy.gov/rcradox/DOE-WIPP_02-3214_Rev_3.pdf))

19. U.S. Department of Energy. *Quality Assurance Program Document*. DOE/CBFO-94-1012. Carlsbad, New Mexico, Carlsbad Field Office, U.S. Department of Energy. (<http://www.wipp.energy.gov/library/qapd/DOE-CBFO-94-1012 QAPD Rev 12.pdf> )
20. DOE (U.S. Department of Energy), 1980. *Final Environmental Impact Statement for the Waste Isolation Pilot Plant*, DOE/EIS-0026, October, Washington, D.C.
21. DOE (U.S. Department of Energy), 1990. *Final Supplemental Environmental Impact Statement for the Waste Isolation Pilot Plant*, DOE/EIS-0026-FS, January, Washington, D.C.
22. DOE (U.S. Department of Energy), 1997. *Waste Isolation Pilot Plant Disposal Phase Final Supplemental Environmental Impact Statement*, DOE/EIS-0026-S-2, September, Washington, D.C.  
(<http://www.wipp.energy.gov/library/seisii/Summary.pdf>)
23. U.S. Department of Energy. *Waste Data System User's Manual*. DOE/WIPP-09-3427. Carlsbad, New Mexico, Carlsbad Field Office, U.S. Department of Energy. (<http://www.wipp.energy.gov/library/WDS/DOE-WIPP 09-3427 Rev 12.pdf> )
24. U.S. Nuclear Regulatory Commission. *Contact-Handled Transuranic Waste Authorized Methods for Payload Control (CH-TRAMPAC)*. Washington, D.C., Office of Regulatory Procedures, U.S. Nuclear Regulatory Commission.
25. U.S. Nuclear Regulatory Commission. *TRUPACT-III Transuranic Waste Authorized Methods for Payload Control (TRUPACT-III TRAMPAC)*. Washington, D.C., Office of Regulatory Procedures, U.S. Nuclear Regulatory Commission.
26. Title 10 CFR Part 71. *Packaging and Transportation of Radioactive Material*. Code of Federal Regulations, Washington, D.C., Office of the Federal Register, National Archives and Records Administration.  
(<http://www.nrc.gov/reading-rm/doc-collections/cfr/part071/>)
27. New Mexico Hazardous Waste Act, NMSA 1978, 74-4-1 through 74-4-14.  
(<http://www.nmonesource.com/nmnxtadmin/NMPublic.aspx>)
28. Title 40 CFR Part 194. *Criteria for the Certification and Re-certification of the Waste Isolation Pilot Plant's Compliance with the 40 CFR Part 191 Disposal Regulations*. Code of Federal Regulations, Washington, D.C., Office of the Federal Register, National Archives and Records Administration.  
[http://www.law.cornell.edu/cfr/text/40/part-194~/media/bes/pdf/nureg\\_0980\\_v1\\_no7\\_june2005.pdf](http://www.law.cornell.edu/cfr/text/40/part-194~/media/bes/pdf/nureg_0980_v1_no7_june2005.pdf) )

29. 42 U.S.C. 2011 et seq. Atomic Energy Act of 1954. (<http://science.energy.gov/>)
30. 42 U.S.C 10141. Nuclear Waste Policy Act of 1982. ([http://uscode.house.gov/view.xhtml?req=\(title:42%20section:10141%20edition:p%20relim\)](http://uscode.house.gov/view.xhtml?req=(title:42%20section:10141%20edition:p%20relim)))
31. U.S. Department of Energy Standard Radiological Control, DOE-STD-1098-2008, Table 2-2 and Chapter 4, Part 2, Sec. 423. ([http://energy.gov/sites/prod/files/2013/06/f1/DOE-STD-1098-2008\\_CN1a.pdf](http://energy.gov/sites/prod/files/2013/06/f1/DOE-STD-1098-2008_CN1a.pdf))
32. Title 10 CFR Part 835. *Occupational Radiation Protection*. Code of Federal Regulations, Washington, D.C., Office of the Federal Register, National Archives and Records Administration. (<https://www.gpo.gov/fdsys/pkg/CFR-2015-title10-vol4/pdf/CFR-2015-title10-vol4-part835.pdf>)
33. American National Standards Institute. ANSI/AIM BC1-1995, *Uniform Symbology Specification - Code 39*. American National Standards Institute, Inc., 1430 Broadway, New York, NY 10018.
34. U.S. Department of Energy. *Radioactive Waste Management*, DOE Order 435.1, Implementation Guide, Chapter III, Section III.L, page 103. (<http://www.nrc.gov/docs/ML1015/ML101590061.pdf>)
35. Title 40 CFR Part 262. *Standards Applicable to Generators of Hazardous Waste*. Code of Federal Regulations, Washington, D.C., Office of the Federal Register, National Archives and Records Administration. (<https://www.epa.gov/sites/production/files/2014-12/documents/gen05.pdf>)
36. Title 40 CFR Part 191. *Environmental Radiation Protection for Management and Disposal of Spent Nuclear Fuel, High-Level, and Transuranic Radioactive Wastes*. Code of Federal Regulations, Washington, D.C., Office of the Federal Register, National Archives and Records Administration. (<https://www.epa.gov/enviro/radinfo-waste-isolation-plant-40-cfr-parts-191-and-194>)
37. U.S. Department of Energy. *Title 40 CFR Part 191, Compliance Recertification Application for the Waste Isolation Pilot Plant*, DOE/WIPP 2004-3231, 2009, Carlsbad, New Mexico. (<http://www.wipp.energy.gov/library/CRA/BaselineTool/Index.htm>)
38. Title 49 CFR §172.203 *Additional Description Requirements*. Code of Federal Regulations, Washington, D.C., Office of the Federal Register, National Archives and Records Administration. (<http://www.gpoaccess.gov/cfr/index.html>)

39. Title 49 CFR §173.433(g). *Shipping Papers and Labeling*. Code of Federal Regulations, Washington, D.C., Office of the Federal Register, National Archives and Records Administration. (<http://www.ecfr.gov/cgi-bin/text-idx?node=49:2.1.1.3.9.3.25.4&rgn=div8>)
40. *Safety Analysis Report for Model 10-160B Type B Radwaste Shipping Cask*. NRC-Docket No. 71-9204. Office of Regulatory Procedures, U.S. Nuclear Regulatory Commission, Washington, D.C.
41. U.S. Nuclear Regulatory Commission. *Remote-Handled Transuranic Waste Authorized Methods for Payload Control (RH-TRAMPAC)*. Washington, D.C., Office of Regulatory Procedures, U.S. Nuclear Regulatory Commission.
42. U.S. Environmental Protection Agency. *Guidance for the Data Quality Objectives Process*. EPA-QA/G-4, Washington, DC, Quality Assurance Management Staff, U.S. Environmental Protection Agency. ([https://www.epa.gov/sites/production/files/documents/guidance\\_systematic\\_planning\\_dqo\\_process.pdf](https://www.epa.gov/sites/production/files/documents/guidance_systematic_planning_dqo_process.pdf))
43. U.S. Department of Energy. *Packaging and Transportation Safety*. DOE Order 460.1C. Washington, D.C. ([http://energy.gov/sites/prod/files/2013/06/f1/O-460-1C\\_O-460-2A\\_ssm.pdf](http://energy.gov/sites/prod/files/2013/06/f1/O-460-1C_O-460-2A_ssm.pdf))
44. U.S. Department of Energy. *Departmental Materials Transportation and Packaging Management*. DOE Order 460.2. Washington, D.C. (<http://www.directives.doe.gov>)
45. U.S. Department of Energy. *CH Packaging Program Guidance*, DOE/WIPP-02-3183. Carlsbad, New Mexico, Waste Isolation Pilot Plant, U.S. Department of Energy.
46. U.S. Department of Energy. *RH Packaging Program Guidance*. DOE/WIPP-02-3283. Carlsbad, New Mexico, Waste Isolation Pilot Plant, U.S. Department of Energy.
47. U.S. Department of Energy. *CBFO Approved Filter Vents*. DOE/WIPP-11-3384. Carlsbad, New Mexico, Waste Isolation Pilot Plant, U. S. Department of Energy.
48. U.S. Nuclear Regulatory Commission. *CH-TRU Payload Appendices*. Washington, D.C., Office of Regulatory Procedures, U.S. Nuclear Regulatory Commission.

**Appendix A**  
**Radioassay Requirements for**  
**Transuranic Waste**



## A.1 Introduction

The WIPP requires radiological characterization data to:

- track the WIPP radionuclide inventory, by radionuclide activity and mass, for those radionuclides listed in sections 3.3.1 and 4.3.1,
- demonstrate that each payload container disposed of at the WIPP contains TRU waste as specified in sections 3.3.3, and 4.3.3, and
- verify that applicable transportation and facility limits on individual payload containers and assemblies for FGE, PE-Ci, and decay heat are not exceeded, as specified in sections 3.3.2, 3.3.4, 3.3.6, 4.3.2, 4.3.4, and 4.3.6.

The radioassay process quantifies at least one of the more prevalent radionuclides known to be present in the waste. The remaining listed radionuclides present in the waste in significant quantities will be identified by direct measurement or through acceptable knowledge of radionuclide ratios as discussed in section A.2. The radionuclide ratios are then used to quantify radionuclides based on the assay value.

The requisite data on radionuclide ratios and quantities will be derived from AK (see section A.2), radioassay, or both using CBFO approved nondestructive assay (NDA), or radiochemistry (RC) techniques, instruments and procedures. Each WCP must technically justify that the AK and radioassay techniques, instruments and procedures used:

- are appropriate for the specific waste stream and waste content code descriptions being assayed, and
- will result in unbiased values for the cumulative activity and mass of the WIPP radionuclide inventory.

Existing radioassay data collected prior to the implementation of a quality assurance program pursuant to 40 CFR §194.22(a)(1) may only be qualified in accordance with an alternate methodology that is approved by CBFO and employs one or more of the following methods:

- peer review in accordance with NUREG-1297 (Reference A1),
- corroborating data,
- confirmatory testing (i.e., testing made on a representative sub-population of payload containers within a waste stream), or
- demonstration of the equivalence of an alternate QA program (as described in Reference A2, Section 5.4).

Proposals for alternative approaches to identification and quantification of radionuclides (e.g., quantification of radionuclide ratios AK on a waste stream basis) must be submitted to CBFO for review and approval. CBFO will report such proposals to EPA for consideration prior to issuing approval.

Controlled changes to radioassay (NDA or RC), related plans, or procedures shall be managed through the document control process that complies with the QAPD. The WCP's Site Project Manager (SPM) and the Site QA Manager shall review all such changes and report to the CBFO those changes that could impact compliance with the criteria in this document. The SPM shall ensure that WCP approved changes to radioassay-related plans or procedures affecting either the performance criteria or data quality of certified systems/processes are not used in the collection of waste certification data prior to CBFO's review and approval. Related testing, calibration, and training performed in accordance with these WCP approved changes, however, are not precluded from being conducted prior to CBFO's review and approval (Memorandum from CBFO to Distribution, CBFO:NTP:RMK:VW:02-2734:UFC:5822, July 29, 2002).

## **A.2 Radionuclide Ratios**

Establishing radionuclide ratios for use in quantifying radionuclides is performed by direct measurement of the containers using WIPP-certified systems. WCPs may opt to qualify AK as permitted by 40 CFR §194.22(b) by performing confirmatory testing using WIPP-certified radioassay systems. When a WCP performs direct measurements of radionuclide ratios, it is expected that all containers in the waste stream will be measured, with the understanding that, in some cases, valid data may not be obtainable for given containers for technical reasons (e.g., lack of sufficient signal or poor counting statistics). All such instances will be documented and appropriately dispositioned by the measurement facility. For those few waste containers for which direct measurement does not yield useable radionuclide ratio information, AK may be used.

### **A.2.1 Methods for Confirmation of Radionuclide Ratio AK**

As a minimum, to confirm existing AK data, it is necessary to compare ratios of the two most prevalent radionuclides in the radionuclide mix. For weapons and reactor grade plutonium, these are typically  $^{239}\text{Pu}$  and  $^{240}\text{Pu}$ . For heat source waste, the predominant radionuclides are typically  $^{238}\text{Pu}$  and  $^{239}\text{Pu}$ . Measured radionuclide ratios for  $^{241}\text{Am}$  may confirm existing AK by waste stream. However, due to the fluctuation of  $^{241}\text{Am}$  in certain waste streams, it may become necessary to measure  $^{239}\text{Pu}$  to  $^{241}\text{Am}$  radionuclide ratios on all containers in that waste stream.

$^{241}\text{Am}$  is the daughter of  $^{241}\text{Pu}$ , which decays with a half-life of about 14 years. If the time since the chemical separation of the plutonium is known, the quantity of measured  $^{241}\text{Am}$  can be used to calculate the quantity of  $^{241}\text{Pu}$ . This assumes there was no  $^{241}\text{Am}$  in the waste just after the chemical separation and that no  $^{241}\text{Am}$  was added to or removed from the waste during the time since the separation. Since  $^{241}\text{Am}$  is an indirect measurement of  $^{241}\text{Pu}$ , it could be compared (by ratio) to any plutonium isotope ( $^{239}\text{Pu}$  or  $^{240}\text{Pu}$ ) associated with weapons and reactor grade plutonium.

For weapons grade and reactor grade waste, radionuclide ratio values for  $^{238}\text{Pu}$  can be assumed to be valid in AK data if the values for  $^{239}\text{Pu}$  and  $^{240}\text{Pu}$  have been confirmed. Because  $^{242}\text{Pu}$  cannot be measured using NDA methods, the contribution of  $^{242}\text{Pu}$  radionuclide ratio is calculated by correlation techniques.

For some of the DOE sites that were involved primarily in weapons production, the fissile isotopes  $^{235}\text{U}$  and  $^{233}\text{U}$  and the fissionable isotope  $^{238}\text{U}$  may not have been measured when the transuranic waste was originally assayed (i.e., using non-WIPP-certified systems), primarily because the plutonium isotopes were the radionuclides of interest to the DOE site. However, other forms of AK may be available. If so, then the AK can be confirmed by data generated on a WIPP-certified system. If valid AK does not exist, then the data generated on a WIPP-certified system can only be used to detect or calculate  $^{238}\text{U}$ ,  $^{235}\text{U}$ , and  $^{233}\text{U}$  or to confirm their absence. Because  $^{234}\text{U}$  cannot be measured using NDA methods, the radionuclide ratios for  $^{234}\text{U}$  may be calculated from the  $^{235}\text{U}$  enrichment. Values, or lack thereof, for  $^{137}\text{Cs}$  can be confirmed by the data generated on a WIPP-certified system. This is typically done by measuring  $^{137}\text{Cs}$  directly, or by comparing the NDA measured  $^{241}\text{Am}$  662 kiloelectron volt (keV) peak to the other  $^{241}\text{Am}$  peaks (e.g., the 125 keV or 721 keV peaks) to determine if the 662 keV peak's intensity is consistent with the expected  $^{241}\text{Am}$  intensity. A disproportionate response for the 662 keV peak relative to the other  $^{241}\text{Am}$  peaks may indicate the presence of  $^{137}\text{Cs}$ .  $^{90}\text{Sr}$  may be calculated from the value for  $^{137}\text{Cs}$  and AK. If detected, a waste container's concentration of  $^{137}\text{Cs}$  can be used to derive a value of  $^{90}\text{Sr}$  through the application of the appropriate scaling factor(s). All scaling factors used will be technically sound and based on known, documented relationships or correlations. The data report for the waste containers for which the  $^{90}\text{Sr}$  value is derived in this manner shall reflect the use of a scaling factor(s) and provide sufficient documentation to enable its independent calculation. Finally, the gamma spectra must be carefully examined for significant presence of other radionuclides to ensure compliance with transportation requirements. Data obtained for radionuclides other than the WIPP-tracked radionuclides presented above are required to address confounding radionuclide issues (i.e., masking) with regard to NDA. When RC is used for confirmation radioassay instead of NDA, less reliance on calculated radionuclides is required.

Each WCP must technically justify that the techniques used to confirm the absence or the ratio of non-measurable radionuclides are valid for the particular radioassay method used to confirm AK.

## A.2.2 Acceptable Knowledge Documentation

The use of AK information concerning the radiological composition of a waste stream will be documented either in the AK summary report for the waste characterization of the waste stream or in another controlled document approved by the SPM. Should this information be contained in AK package(s) prepared to meet other general waste characterization requirements, it need not be duplicated in other controlled documents that address the radiological properties of the waste stream; however, all relevant information must be included in the AK record. The following discussion is included for the sake of completeness.

### A.2.2.1 Required Elements

This section identifies the required radiological information that each TRU waste site or WCP measurement facility must maintain for a waste stream. A TRU waste site or WCP waste characterization facility may use AK to delineate the distribution of the 10 WIPP-tracked radioisotopes within a TRU waste stream and the presence or absence of isotopes. The type and quantity of supporting documentation may vary by waste stream and shall be compiled in a written record that shall include a summary identifying all sources of information used to delineate the waste stream's radionuclide distribution. The basis and rationale for the delineation shall be clearly summarized in an AK report and traceable to referenced documents. Assumptions made in this delineation shall be identified. The following information shall be included as part of the AK written record:

- map of the DOE site with the areas and facilities involved in TRU-mixed waste generation, treatment, and storage identified
- facility mission description as related to radionuclide-bearing materials and their management, e.g., routine weapons production, fuel research and development and experimental processes
- description of the specific DOE site locations (such as the area or building) and operations relative to the radionuclide composition of the TRU wastes they generated, e.g., plutonium recovery, weapons fabrication, pyrochemical operations and waste incineration
- waste identification or categorization schemes used at the facility relevant to the waste material's radionuclide distribution, e.g., the use of codes that correlate to a specific radionuclide distribution, and a description of the radionuclide composition of each waste stream
- information regarding the waste's physical and chemical composition that could affect the radionuclide distribution, e.g., processes used to remove ingrown <sup>241</sup>Am or alter its expected contribution based solely on radioactive decay kinetics

- statement of all numerical adjustments applied to derive the material's radionuclide distribution, e.g., scaling factors, decay/ingrowth corrections and secular equilibrium considerations
- specification of the radionuclide ratios for the 10 WIPP-tracked radionuclides ( $^{241}\text{Am}$ ,  $^{238}\text{Pu}$ ,  $^{239}\text{Pu}$ ,  $^{240}\text{Pu}$ ,  $^{242}\text{Pu}$ ,  $^{233}\text{U}$ ,  $^{234}\text{U}$ ,  $^{238}\text{U}$ ,  $^{90}\text{Sr}$ , and  $^{137}\text{Cs}$ ) and, if applicable, the radionuclides that contribute to 95% of the radiological hazard on a waste stream, waste stream subpopulation, or container basis.

#### **A.2.2.2 Supplemental Acceptable Knowledge Information**

Each DOE site or WCP measurement facility shall obtain supplemental AK information, dependent on availability. The amount and type of this information cannot be mandated, but WCPs shall collect information as appropriate to support their contention regarding the waste's radionuclide distribution. This information will be used to compile the waste's AK written record. Supplemental AK documentation that may be used includes, but is not limited to, information from the following sources:

- Safeguards & Security, Materials Control & Accountability, and other nuclear materials control systems or programs and the data they generated
- reports of nuclear safety or criticality, or accidents/excursions involving the use of special nuclear material (SNM) or nuclear material
- waste packaging, waste disposal, building or nuclear material management area logs or inventory records, and DOE site databases that provide information on SNM or nuclear materials
- test plans, research project reports, or laboratory notebooks that describe the radionuclide content of materials used in experiments
- information from DOE site personnel (e.g., documented interviews)
- historical analytical data relevant to the radionuclide distribution of the waste stream

### A.2.2.3 Discrepancy Resolution

If there is a discrepancy between AK information related to radionuclide ratios or composition, the WCP will evaluate the sources of the discrepancy to determine if the discrepant information is credible. Information that is not credible or information that is limited in its applicability to WIPP characterization will be identified as such and the reasons for dismissing it will be justified in writing. Limitations concerning the information will be documented in the AK record and summarized in the AK report. In the event that the discrepancy cannot be resolved, the WCP will perform direct measurements for the impacted population of containers. If discrepancies result in a change to the original determinations, the AK summary will be updated.

### A.3 Data Quality Objectives

The DQOs for WIPP certifiable radiological characterization data are established in section 3.3 of this WAC. They are summarized below in Table A-1 as they apply to individual payload containers.

**Table A-1 Data Quality Objectives for Radioassay**

Requirement	DQO	Confidence <sup>1</sup>
TRU alpha activity concentration <sup>2</sup> > 100 nCi/g	$A > LLD$	N/A
Fissile mass $\leq$ FGE limit	$FGE + 2\sigma_{TMU}(FGE) \leq FGE$ limit	97.5%
Decay heat $\leq$ TRAMPAC <sup>3</sup> limit	$DH + 1\sigma_{TMU}(DH) \leq L_{TRAMPAC}^3$	84%

<sup>1</sup> Confidence means the statistical level of confidence that the limit is exceeded or not exceeded depending on the requirements of the individual DQOs. The confidence is derived from the specified DQOs which assume contributions to TMU are normally distributed.

<sup>2</sup> TRU waste determinations shall be in accordance with the policy for the management of TRU alpha activity concentration when overpacking waste containers (see Appendix E).

<sup>3</sup> TRAMPAC includes limits from the CH-TRAMPAC, the RH-TRAMPAC, and the TRUPACT-III TRAMPAC.

There are no stipulated DQOs for PE-Ci or individual radionuclide activities (except as they impact the requirements listed above). However, at a minimum, radioassay programs must be capable of identifying, measuring, and reporting the presence or absence of:

- the ten radionuclides identified in sections 3.3.1 and 4.3.1 for tracking of the WIPP radionuclide inventory (see section A.2.1),
- <sup>235</sup>U, in order to calculate FGE or Fissile Equivalent Mass (FEM), as required in sections 3.3.2 and 4.3.2 for compliance with transportation requirements, and

- other radionuclides whose presence contributes to 95% of the radioactive hazard, as specified in sections 3.3.1 and 4.3.1, for compliance with transportation requirements.

In support of the above requirements, each WCP must evaluate, document and technically justify the following determinations.

*Lower Limit of Detection and Minimum Detectable Activity:* The LLD for each radioassay system must be determined. Instruments performing TRU/low-level waste discrimination measurements must have an LLD of 100 nCi/g or less. Site-specific environmental background and container-specific interferences must be factored into LLD and Minimum Detectable Activity (MDA) determinations. The LLD and MDA are similarly defined as that level of radioactivity which, if present, yields a measured value greater than the critical level with a 95% probability, where the critical level is defined as that value which measurements of the background will exceed with 5% probability. The LLD is expressed as a concentration (the activity divided by the waste mass) while the MDA is expressed in units of activity. In general, the term MDA is used to describe the statistically derived activity below which the true activity of an individual radionuclide in a sample cannot be determined. It therefore represents the highest activity of a particular radionuclide that may probably be in a sample within the statistical bounds of the conditions under which the measurement was made. Because the MDA is a measurement-based parameter, it is not feasible to calculate MDAs for radionuclides that are not determined primarily by measurement, e.g., <sup>90</sup>Sr. In such cases, the WCP shall derive the equivalent of an MDA, i.e., a reporting threshold for a radionuclide(s), when it is technically justified. This value may be based on decay kinetics, scaling factors or other scientifically based relationships and must be adequately documented in WCP records. For purposes of reporting radionuclide data to the WWIS database, this value will be the equivalent of an MDA. References A3 and A4 provide information in developing the MDA.

*Total Measurement Uncertainty:* The method used to calculate the TMU for the quantities in Table A-1 must be documented and technically justified for each CBFO-certified radioassay system. Compliance with this requirement will be evaluated in reviews of the TMU documentation package for each assay system by CBFO. General guidance for determining the TMU is provided in References A5 and A6.

*Calibration Procedures and Frequencies:* Calibration procedures shall be developed for calibrating each radioassay measurement system before initial use. Calibrations may be performed by using either physical standards or accepted calculational models and methods. During calibration or re-calibration, system correction factors shall be established and algorithms adjusted such that the value of percent recovery (%R) is set equal to 100%; i.e., the system is calibrated or modeled to reflect 100% recovery. The matrix/source surrogate waste combination(s) used for initial calibrations, as well as the calculational models and methods, shall be described in a calibration plan and will be representative, as appropriate, of the:

- activity range(s), gram loading(s), photon energy range(s), and
- relevant waste matrix characteristics (e.g., densities, moderator content, applicable matrix correction, and container size), planned for measurement by the system.

Calibration(s) shall be performed in accordance with consensus standards, when such standards exist. If consensus standards are not used, full documentation of the calibration technique must be provided to and approved by CBFO prior to performing WIPP-related assays. Primary calibration standards shall be obtained from suppliers maintaining a nationally accredited measurement program. When primary standards are not available, the standards used shall be correlated with primary standards obtained from a nationally accredited measurement program. Neutron-emitting standards proposed as surrogates for  $^{238}\text{Pu}$  or  $^{240}\text{Pu}$  (e.g.,  $^{252}\text{Cf}$ ) may be used for calibration if their equivalence is clearly documented. In addition, recent technology advancements have expanded the ability to mathematically model the physical principles involved with neutron and gamma-ray transport and measurement. This modeling allows the development of computational methods for system calibrations. Gamma modeling methods are described in *Standard Guide for Use of Modeling for Passive Gamma Measurements*, ASTM C1726 (Reference A7). The modeling and methodology must be clearly documented. For calorimetry, calibration shall be performed in accordance with Reference A8.

*Calibration Verification:* Notwithstanding the need to calibrate individual components for replacement, changes or adjustments (e.g., energy calibration of a detector), verification of the radioassay measurement system's calibration shall be performed after any one of the following occurs:

- major system repairs and/or modifications
- replacement of the measurement system's components, e.g., detector, neutron generator or supporting electronic components that have the capacity to affect data
- significant changes to the system's software
- relocation of the system
- failure of measurement quality controls not assignable to external activities or events

Calibration verification shall consist of demonstrating that the affected operating system modality (whether gamma, passive neutron, or active neutron) is within the range of acceptable operation. Secondary standards or sources can be used for the calibration verification if their responses have been correlated with primary calibration standards. These secondary standards or sources may either be a single source or a collection of



sources in a geometrically stable configuration and matrix, with suitably long-lived radionuclides. These may be used to confirm proper operation when compared to a previously collected baseline set of measurements that have demonstrated the reproducibility of response for the source(s) and configuration. If a verification of the measurement system's calibration or other test demonstrates that the system's response has significantly changed, a re-calibration of the system shall be performed.

*Calibration Confirmation:* In order to confirm that the calibration of a modality (e.g., a gamma efficiency curve) of an NDA system was correctly established, the accuracy and precision of the system are determined after each calibration or re-calibration by performing replicate measurements of an appropriate surrogate matrix selected from within the expected operating range of the calibration being confirmed. For example, a calibration involving a lead-lined waste drum, would most appropriately employ a surrogate lead-lined drum while a POC configuration would more appropriately employ a POC surrogate. In the typical case of a gamma detection system, a minimally interfering matrix, such as a light combustible matrix container, might be considered. If a geometrically consistent surrogate is not available, then the justification of the surrogate container selected shall be documented. Calibration confirmation replicate measurements shall be performed on containers of the same nominal size as those in which actual waste is assayed and according to approved waste assay procedures. The number of replicate measurements to be performed shall be documented and technically justified. The replicate measurements shall be performed using nationally recognized standards, or certified standards derived from nationally recognized standards that span the expected operating range of the system. The standards used to calculate accuracy shall not be the same as those used for the system calibration.

Alternatively, for gamma systems using segmented gamma scanning techniques, an Efficiency Curve Calibration may be used as described in Reference A9, *Standard Test Method for Nondestructive Assay of Special Nuclear Material in Low Density Scrap and Waste by Segmented Passive Gamma-Ray Scanning*, ASTM C1133. This type of calibration is based on an energy range over which the efficiency response is defined. This allows calibration for gamma-emitting radionuclides without a specific mass or activity loading limitation for the establishment of the calibration range. For an NDA system using the Efficiency Curve Calibration, the calibration and operating ranges are only limited by geometry, equipment, system performance, and the ability to interpret the acquired gamma spectra. Similarly, modeling methodologies are described in Reference A7, *Standard Guide for Use of Modeling for Passive Gamma Measurements*, ASTM C1726, and have been implemented by multiple vendor systems.

Accuracy is reported as percent recovery (%R). Accuracy shall be  $\leq 10\%$ . The justification for an accuracy greater than 10% will be documented. For gamma systems, the accuracy shall be calculated for each useable gamma energy line over the calibration range. The accuracy for each line shall be  $\leq 10\%$ . The justification for not using certain gamma lines due to matrix density, filter density, or attenuation will be documented. Precision is reported as percent relative standard deviation (% RSD).

The %RSD shall not exceed the values listed in Table A-2 for the corresponding number of replicate measurements in a non-interfering matrix.

**Table A-2 Upper Limits for %RSD vs. Number of Replicates**

Number of Replicates	2	3	4	5	6	7	8	9	10	11	12	13	14	15
Max %RSD <sup>1</sup>	1.8	6.6	10.0	12.3	14.0	15.2	16.2	17.1	17.7	18.3	18.8	19.3	19.7	20.0

<sup>1</sup> The values listed are derived from the measured standard deviation of the replicate measurements using

$$\frac{s}{\mu} \cdot 100\% < \sqrt{\frac{(0.292)^2 \cdot \chi^2_{0.05, n-1}}{n-1}} \cdot 100\%$$

where s is the measured standard deviation, n is the number of replicates,  $\mu$  is the true value,

$\chi^2_{0.05, n-1}$  is the critical value for the upper 5% tail of a one-sided chi-squared distribution with n – 1 degrees of freedom, and 0.292 corresponds to a 95% upper confidence bound on the true system precision limit of 29.2%.

Measurement facilities may develop alternate limits for accuracy and precision subject to approval by CBFO prior to certification of waste.

## A.4 Quality Control

To ensure that data of known and documented quality are generated, each participating measurement facility shall implement a documented facility QA program. Any radioassay technique used for TRU waste must be performed in accordance with calibration and operating procedures that have been written, approved, and controlled by the WCP or testing facility. Laboratory procedures must contain applicable quality controls. Facility QA programs shall specify qualitative and quantitative acceptance criteria for the QC checks of this program and corrective action measures to be taken when these criteria are not satisfied.

### A.4.1 General Requirements

*Radioassay Training:* Only appropriately trained and qualified personnel shall be allowed to perform radioassay and data validation/review. Standardized training requirements for radioassay personnel shall be based upon existing industry standardized training requirements (e.g., ASTM C1490, *Standard Guide for Selection, Training and Qualification of Nondestructive Assay (NDA) Personnel* (Reference A10); ANSI N15.54, *Radiometric Calorimeters – Measurement Control Program* (Reference A8)) and shall meet the specifications in the QAPD. Requalification of radioassay personnel shall be based upon evidence of continued satisfactory performance and must be performed at least every two years.

*Software QC Requirements:* All computer programs and revisions thereof used for radioassay shall meet the applicable requirements in Section 6.0 of the QAPD (Reference A2).

*Comparison Programs:* WCPs using radioassay systems shall participate in any relevant measurement comparison program(s) sponsored or approved by the CBFO. Such programs may be conducted as part of the NDA performance demonstration program (References A11 and A12), or through other third parties (Reference: WIPP Compliance Recertification Application including Annual Reports to the EPA).

#### **A.4.2 NDA QC Requirements**

The NDA QC requirements identified in various American Society for Testing and Materials (ASTM) and ANSI standards (References A7, A8, A9, A13, A14, A15, and A16), and NRC standard practices and guidelines (Reference A17) as referenced in this appendix are recommended for use at all testing facilities. Some specific QC requirements are:

*Background Measurements:* Background measurements must be performed and recorded daily, unless otherwise approved by CBFO. Contributions to background due to radiation from nearby radiation-producing equipment, standards or wastes must be carefully controlled or more frequent background checks must be performed. For calorimeters, basepower or baseline measurements shall be conducted at a frequency determined by each WCP and approved by CBFO.

*Instrument Performance Measurements:* Performance checks on calibrated and operable gamma and neutron NDA instruments must be performed and recorded once per operational day. Performance checks shall include efficiency checks (when applicable), matrix correction checks and, for spectrometric instruments, peak position and resolution checks. If daily performance checks result in data that are outside the acceptable ranges specified in Table A-3, then the cause of the failure will be evaluated and the required responses in Table A-3 shall be followed. If the failure is the result of outside influences such as surrounding waste container movement, mis-positioning of waste containers, failure to initiate container rotation, etc., then the system performance check shall be repeated after the source of failure is rectified and documented. Acceptability of performance check data may be based on either statistically determined limits (Warning or Action limits) derived from a suitable population of data or on a technically determined (i.e., non-statistical) assignment of acceptable boundary limits (Above and Below flags). Above and Below boundary limits should mirror the Action category and follow the identified required response. The basis of the applicability range or assigned boundaries must be documented.

Containers and sources used for performance checks must be constructed in such a way that the surrogate waste characteristics and geometries do not change over time.

Radioactive sources should be long-lived, easy to position relative to the detector(s), and of sufficient radioactivity to obtain good results with relatively short count times, preferably with count times equivalent to normal container assay times.

Performance checks for calorimetry shall be performed with electrical and/or heat standards traceable to a nationally accredited measurement program at a frequency determined by each WCP, consistent with Reference A18. This information is specified in WCP operating procedures and approved by CBFO.

*Data Checks:* Background (for calorimetry: baseline or base power) and performance measurements shall be reviewed and evaluated at least weekly to determine continued acceptability of the assay system and to monitor performance trends.

**Table A-3 Range of Applicability**

Category	Acceptability Range <sup>1, 2</sup>	Required Response
Acceptable Range	$ Data  \leq 2\sigma$	No action required.
Warning Range	$2\sigma <  Data  \leq 3\sigma$	The performance check standard shall be rerun no more than two times. If the rerun performance check(s) result in data within $\pm 2\sigma$ , then the additional performance checks shall be documented and work may continue. If the system does not fall within $\pm 2\sigma$ after two rerun performance checks, then the required response for the Action Range shall be followed.
Action Range	$ Data  > 3\sigma$ Or exceeds Above or Below Boundary Limits	Work shall stop and the occurrence shall be documented and appropriately dispositioned (e.g., corrective action by operator or initiation of a nonconformance report). The radioassay system shall be removed from service pending successful resolution of all necessary actions, and all assays performed since the last acceptable performance check are suspect, pending satisfactory resolution. Recalibration or calibration verification is required prior to returning the system back to service.

<sup>1</sup>Reference A16, *Nondestructive Assay Measurement Control and Assurance*, ANSI N15.36.

<sup>2</sup> The standard deviation  $\sigma$  is only based on the reproducibility of the data check measurements themselves. This is not TMU.

### A.4.3 Radiochemistry QC Requirements

Any RC method may be used as long as the assay results meet the DQOs specified in section A.3. Each laboratory used for TRU waste assay by RC shall demonstrate that the analytical methods are appropriate to assay the specific wastes for which they are proposed. These methods must contain the following general provisions:

- Assay standards must be prepared and used as indicated in the standard test methods.
- The sample taken from the waste must be representative and traceable to its specific waste batch or waste container.
- The test result for each sample must be associated with a specific lot, batch number, or container.

All methods will be preceded by radiochemical separation and preparation for measurement. Table A-4 presents a list of laboratory control procedures that must be performed by laboratories involved in the TRU waste RC process.

**Table A-4 Quality Control Requirements for Radiochemistry**

QC Sample	Minimum Frequency	Acceptance Criteria	Corrective Action
Laboratory control samples (LCS)	One per analytical batch	75% to 125%R	See Laboratory Control Sample <sup>1</sup>
Method blank	One per analytical batch	Site-specific statistical control limits	See Method Blanks <sup>2</sup>
Laboratory duplicate	One per analytical batch	RPD (relative percent difference) $\leq 40$ , or project-specific requirements	See Laboratory Duplicate <sup>3</sup>
Matrix spike (MS)	One per analytical batch for ICP-MS, as required by the test performed	50 to 150%R	See Matrix Spike and Matrix Spike Duplicate <sup>4</sup>
Matrix spike duplicate (MSD)	One per analytical batch, as required by the test performed	50 to 150%R RPD $\leq 40$ , or project-specific requirements	See Matrix Spike and Matrix Spike Duplicate <sup>4</sup>
Radioisotopic tracers	Every sample	Site-specific statistical control limits	See Radioisotopic Tracer <sup>5</sup>

<sup>1</sup>**Laboratory Control Sample:** An LCS is analyzed at least once per analytical batch. If a solid matrix with established control limits is used as the LCS, the established limits may be used for the acceptance criteria. If LCS

recoveries do not meet acceptance criteria, a nonconformance report is prepared and corrective action is initiated to determine the cause of the problem. Associated samples are qualified in the data report.

<sup>2</sup>**Method Blanks:** A method blank is analyzed at least once per analytical batch. It contains all reagents in proportions equal to those in the samples and is carried through the analytical procedure to identify if contamination is present. Each WCP establishes the acceptance criteria for method blanks; they may be expressed as statistical control limits. Criteria may be absolute values, multiples of background variation, fractions of activity concentrations observed in samples, or other appropriate units. When results outside the criteria are obtained, a nonconformance report is prepared and corrective action is initiated to determine the cause of the problem. Associated samples are qualified in the data report.

<sup>3</sup>**Laboratory Duplicate.** A laboratory duplicate is analyzed at least once per analytical batch. A laboratory duplicate is a separate aliquot from the same field sample carried through the entire analytical procedure. The RPD between duplicate results is compared with the criteria; if the RPD between duplicate results does not meet the criteria, a nonconformance report is prepared and corrective action is initiated to determine the cause of the problem. Associated sample results are qualified in the data report.

<sup>4</sup>**Matrix Spike and Matrix Spike Duplicate:** Duplicate MSs on individual field samples are performed for inductively coupled plasma-mass spectrometry (ICP-MS) analysis at a minimum frequency of one pair (MS plus MSD) per analytical batch. The MSDs are preferred for any analytical procedure not using radioactive tracers. The MS and MSD results are acceptable if the criteria given above for percent recovery and RPD are met. Sample data associated with non-compliant MS and MSD results are qualified in the data report.

<sup>5</sup>**Radioisotopic Tracer:** Some methods require that all samples, blanks, LCSs, and laboratory duplicates be spiked with radioisotopic tracers to determine chemical recoveries, counting efficiencies, or a combination thereof. Each WCP establishes the acceptance criteria for method blanks; they may be expressed as statistical control limits. When yields outside the criteria are obtained, a non-conformance report is prepared and corrective action is initiated to determine the cause of the problem. Associated samples are qualified in the data report.

Completeness of RC data shall be expressed as the ratio of the number of samples that are analyzed with valid results to the total number of samples that are submitted for analysis, expressed as a percent. Acceptable RC data shall be obtained for 90 percent of the samples acquired for waste characterization. Valid results for radioassay data are those that were obtained when the laboratory or testing facility demonstrated that the instrumentation and method were in control.

Representativeness of RC data shall be achieved by the collection of unbiased samples.

## **A.5 Data Management**

### **A.5.1 Data Review and Validation**

All radioassay data must be reviewed and approved by qualified personnel prior to being reported. At a minimum, the data must be reviewed by a technical reviewer and approved by the SPM. The validation process includes verification that the applicable quality controls specified in section A.4 have been met.

### **A.5.2 Data Reporting**

Radioassay data must be reported to the WCP project office on a testing batch basis. A batch is defined, for the purpose of the program, as a suite of waste containers undergoing radioassay using the same testing equipment. For NDA, the WCP shall

specify the size of the testing batch as needed, without regard to waste matrix. For RC, a testing batch shall not exceed 20 waste containers without regard to waste matrix, as is consistent with industry practice.

Each radioassay testing facility is required to submit testing batch data reports for each testing batch to the WCP project office on standard forms (either hard copy or electronic equivalent), as provided in approved documentation. Radioassay testing batch data reports shall consist of the following:

- testing facility name, testing batch number, container numbers included in that testing batch, and signature release by the SPM.
- table of contents
- background and performance data or control charts for the relevant time period
- data validation per the QAPD (Reference A2, Section 5.3.2), and as described in site procedures.
- separate testing report sheet(s) for each container in the testing batch that includes:
  - title "Radioassay Data Sheet"
  - method used for radioassay (i.e., procedure identification)
  - date of radioassay
  - activities and/or masses of individual radioisotopes present and their associated TMUs (curies and/or grams)
  - operator signature/date
  - reviewer signature/date

Other radiological properties to be documented for each container include:

- decay heat expressed in watts and its associated TMU
- total  $^{239}\text{Pu}$  FGE expressed in grams and its associated TMU
- TRU alpha activity concentration expressed in Ci/g and its associated TMU, and
- total  $^{239}\text{Pu}$  equivalent activity expressed in curies

These calculated quantities shall be included in the radioassay batch data report or other QA record or database.

When TMU is reported differently on the testing report sheet than in the WWIS database, the method of expressing TMU shall be specified on the testing report sheet

or associated procedures/QAPjP. In the case of radiochemical analyses, the batch data report shall also include the QC sample results.

### **A.5.3 Data and Records Retention**

The following nonpermanent records shall be maintained at the radioassay testing facilities or shall be forwarded to the WCP project office for maintenance, and shall be documented and retrievable by testing batch number, in accordance with the QAPD:

- testing batch reports
- all raw data, including instrument readouts, calculation records, and radioassay QC results
- all instrument calibration reports, as applicable

## **A.6 Quality Characteristics Assessment**

Per 40 CFR §194.22(c), there are five “quality characteristics” that must be assessed. These quality characteristics and the method by which they are assessed are described in the following sections.

### **A.6.1 Data Accuracy**

Per 40 CFR §194.22(c)(1), *Data Accuracy* is defined as “the degree to which data agree with an acceptable reference or true value.” For NDA methods, this quality characteristic is reported as %R and is met and maintained as described in section A.3. For RC methods, this quality characteristic is met and maintained through the requirements specified in Table A-4 of section A.4.3. See References A11 and A12 for application of this quality characteristic in formulating the scoring criteria for data generated by the performance demonstration program. Specifically, Appendix D, Section D.1 of these references gives the definitions of limits, bounds, and point estimates as they relate to NDA measurement systems and the relationship between accuracy, bias, and %R.

### **A.6.2 Data Precision**

Per 40 CFR §194.22(c)(2), *Data Precision* is defined as “a measure of the mutual agreement between comparable data gathered or developed under similar conditions expressed in terms of standard deviation.” For NDA methods, this quality characteristic is met and maintained as described in section A.3. For RC methods, this quality characteristic is met and maintained through the requirements specified in Table A-4 of section A.4.3.



### **A.6.3 Data Representativeness**

Per 40 CFR §194.22(c)(3), *Data Representativeness* is defined as “the degree to which data can accurately and precisely represent a characteristic of a population, a parameter, variations at a sampling point, or environmental conditions.” For NDA and RC methods, this quality characteristic for the waste stream is met and maintained through 100% measurement confirmation on a payload container basis. For NDA, since the entire waste container is subjected to measurement, representativeness pertaining to the actual measurement is not applicable. However, since a sample is physically removed from the container for RC measurements and must be representative of the waste within the container, section A.4.3 provides the criteria for representativeness for the actual sample itself.

### **A.6.4 Data Completeness**

Per 40 CFR §194.22(c)(4), *Data Completeness* is defined as “a measure of the amount of valid data obtained compared to the amount that was expected.” For NDA methods, this quality characteristic is met and maintained by requiring 100% valid results. Any results indicating the NDA measurement was invalid require re-measurement. For RC methods, this quality characteristic is met and maintained through the requirements specified in section A.4.3.

### **A.6.5 Data Comparability**

Per 40 CFR §194.22(c)(5), *Data Comparability* is defined as “a measure of confidence with which one data set can be compared to another.” For NDA and RC methods, this quality characteristic is addressed by ensuring that all data are produced under the same system of controls. These controls apply to all aspects of the data generation process, including procurement of analytical instruments, calibration and operation of assay equipment according to industry standards, preparation and use of standardized instrument and data review procedures, and training of equipment operators and technical/data review personnel to the QAPD, as specified in section A.4.1. All NDA and RC systems and methods are approved by CBFO prior to use in generating waste characterization data. Additionally, comparison of measured data with AK derived or based values, as applicable, provides a means to assess comparability on a waste stream basis. Although no specific confidence level is specified, these controls provide comparability among all data generated under this program. WCPs using radioassay systems shall participate in measurement comparison programs as specified in section A.4.1.

## References

*Note: The current revisions of these reference documents are applicable. The Internet links are provided for informational purposes only and may change without prior public notification.*

- A1. U.S. Nuclear Regulatory Commission. *Peer Review for High-Level Nuclear Waste Repositories*, NUREG-1297, Washington D.C., Office of Nuclear Material Safety and Safeguards, U.S. Nuclear Regulatory Commission.
- A2. U.S. Department of Energy. *Quality Assurance Program Document*, DOE/CBFO-94-1012. Carlsbad, New Mexico, Carlsbad Field Office, U.S. Department of Energy. ([http://www.wipp.energy.gov/library/qapd/DOE-CBFO-94-1012\\_QAPD\\_Rev\\_12.pdf](http://www.wipp.energy.gov/library/qapd/DOE-CBFO-94-1012_QAPD_Rev_12.pdf))
- A3. Currie, Lloyd A., 1968. *Limits for Qualitative Detection and Quantitative Determination*. *Anal.Chem.* 40: 586-93.
- A4. EPA, 1980. *Upgrading Environmental Radiation Data*. EPA 520/1-80-012, Washington D.C., Office of Radiation Programs, U. S. Environmental Protection Agency.
- A5. K. C. Smith, R. A. Stroud, K. L. Coop, and J. F. Bresson. 1998. *Total Measurement Uncertainty Assessment for Transuranic Waste Shipments to the Waste Isolation Pilot Plant*. Proceedings of the 6th Nondestructive Assay Waste Characterization Conference, Salt Lake City, Utah, Nov. 17-19, 1998, pp.21-37.
- A6. K. L. Coop, J. F. Bresson, M. E. Doherty, B. M. Gillespie, and D. R. Davidson. *Standardized Total Measurement Uncertainty Reporting for WIPP*. Nondestructive Assay Interface Working Group, Salt Lake City, Utah, May 22, 2000.
- A7. American Society for Testing and Materials. *Standard Guide for Use of Modeling for Passive Gamma Measurements*. ASTM C1726, Annual Book of ASTM Standards, Philadelphia, Pennsylvania, American Society for Testing and Materials.
- A8. American National Standards Institute. *Radiometric Calorimeters – Measurement Control Program*, ANSI N15.54, American National Standards Institute, Inc., 1430 Broadway, New York, NY 10018.
- A9. American Society for Testing and Materials. *Standard Test Method for Nondestructive Assay of Special Nuclear Material in Low Density Scrap and Waste by Segmented Passive Gamma-Ray Scanning*. ASTM C1133, Annual Book of ASTM Standards, Philadelphia, Pennsylvania, American Society for Testing and Materials.

- A10. American Society for Testing and Materials. *Standard Guide for Selection, Training and Qualification of Nondestructive Assay (NDA) Personnel*, ASTM C1490, Annual Book of ASTM Standards, Philadelphia, Pennsylvania, American Society for Testing and Materials.
- A11. U.S. Department of Energy. *Performance Demonstration Program Plan for Nondestructive Assay of Boxed Wastes for the TRU Waste Characterization Program*, DOE/CBFO-01-1006. Carlsbad, New Mexico, Carlsbad Field Office, U.S. Department of Energy.  
([http://www.wipp.energy.gov/Documents\\_NTP.htm](http://www.wipp.energy.gov/Documents_NTP.htm))
- A12. U.S. Department of Energy. *Performance Demonstration Program Plan for Nondestructive Assay of Drummed Wastes for the TRU Waste Characterization Program*, DOE/CBFO-01-1005. Carlsbad, New Mexico, Carlsbad Field Office, U.S. Department of Energy.  
([http://www.wipp.energy.gov/Documents\\_NTP.htm](http://www.wipp.energy.gov/Documents_NTP.htm))
- A13. American Society for Testing and Materials. *Standard Test Method for Determination of Plutonium Isotopic Composition by Gamma-Ray Spectrometry*. ASTM C1030, Annual Book of ASTM Standards, Philadelphia, Pennsylvania, American Society for Testing and Materials.
- A14. American Society for Testing and Materials. *Standard Test Method for Nondestructive Assay of Nuclear Material in Scrap and Waste by Passive-Active Neutron Counting Using a <sup>252</sup>Cf Shuffler*. ASTM C1316, Philadelphia, Pennsylvania, American Society for Testing and Materials.
- A15. American Society for Testing and Materials. *Standard Test Method for Nondestructive Assay of Plutonium, Tritium and <sup>241</sup>Am by Calorimetric Assay*. ASTM C1458, Annual Book of ASTM Standards, Philadelphia, Pennsylvania, American Society for Testing and Materials.
- A16. American National Standards Institute. *Nondestructive Assay Measurement Control and Assurance*, ANSI N15.36. American National Standards Institute, Inc., 1430 Broadway, New York, NY 10018.
- A17. U.S. Nuclear Regulatory Commission. 1984. *Nondestructive Assay of Special Nuclear Material Contained in Scrap and Waste*. Regulatory Guide 5.11, Washington, DC, Office of Nuclear Regulatory Research, U.S. Nuclear Regulatory Commission.
- A18. American National Standards Institute. *Plutonium-Bearing Solids Calibration Techniques for Calorimetric Assay*. ANSI N15.22-1987, American National Standards Institute, Inc., 1430 Broadway, New York, NY 10018.

## APPENDIX B

### <sup>239</sup>Pu Equivalent Activity

The concept of  $^{239}\text{Pu}$  equivalent activity is intended to eliminate the dependency of radiological analyses on specific knowledge of the radionuclide composition of a TRU waste stream. A unique radionuclide composition and/or distribution is associated with most TRU waste streams at each DOE site. By normalizing all radionuclides to a common radiotoxic hazard index, radiological analyses that are essentially independent of these variations can be conducted for the WIPP facility.  $^{239}\text{Pu}$ , as a common component of most defense TRU wastes, was selected as the radionuclide to which the radiotoxic hazard of other TRU radionuclides could be indexed.

Modeled operational releases from the WIPP facility, including both routine and accident-related, are airborne. There are no known significant liquid release pathways during the operational phase of the facility. This, and the fact that TRU radionuclides primarily represent inhalation hazards, allows a valid relationship to be established, which normalizes the inhalation hazard of a TRU radionuclide to that of  $^{239}\text{Pu}$  for the purpose of the WIPP radiological analyses. In effect, the radiological dose consequences of an airborne release of a quantity of TRU radioactivity with a known radionuclide distribution will be essentially identical to that of a release of that material expressed in terms of a quantity of  $^{239}\text{Pu}$ . To obtain this correlation, the 50-year effective whole-body dose commitment or dose conversion factor for a unit intake of each radionuclide will be used.

For a known radioactivity quantity and radionuclide distribution, the  $^{239}\text{Pu}$  equivalent activity is determined using radionuclide-specific weighting factors. The  $^{239}\text{Pu}$  equivalent activity (AM) can be characterized by

$$AM = \sum_{i=1}^K A_i / WF_i$$

where  $K$  is the number of TRU<sup>2</sup> radionuclides,  $A_i$  is the activity of radionuclide  $i$ , and  $WF_i$  is the PE-Ci weighting factor for radionuclide  $i$ .

$WF_i$  is further defined as the ratio

$$WF_i = E_o / E_i$$

where  $E_o$  (rem/ $\mu\text{Ci}$ ) is the 50-year effective whole-body dose commitment due to the inhalation of  $^{239}\text{Pu}$  particulates with a 1.0  $\mu\text{m}$  activity median aerodynamic diameter (AMAD) and a weekly pulmonary clearance class, and  $E_i$  (rem/ $\mu\text{Ci}$ ) is the 50-year effective whole-body dose commitment due to the inhalation of radionuclide ( $i$ )

---

<sup>2</sup> TRU as designated in this equation refers to any radionuclide with an atomic number greater than 92 and including  $^{233}\text{U}$ .

particulates with a 1.0  $\mu\text{m}$  AMAD and the pulmonary clearance class resulting in the highest 50-year effective whole-body dose commitment. Weighting factors calculated in this manner are presented in Table B-1 for radionuclides typically present in CH TRU waste. If other TRU radionuclides are determined to be present in the payload container, their weighting factors can be obtained from the values of  $E_o$  and  $E_i$  contained in DOE/EH-0071 (Reference B1).

**Table B-1 PE-Ci Weighting Factors for Selected Radionuclides**

Radionuclide	Pulmonary Clearance Class <sup>1</sup>	Weighting Factor
<sup>233</sup> U	Y	3.9
<sup>237</sup> Np	W	1.0
<sup>236</sup> Pu	W	3.2
<sup>238</sup> Pu	W	1.1
<sup>239</sup> Pu	W	1.0
<sup>240</sup> Pu	W	1.0
<sup>241</sup> Pu	W	51.0
<sup>242</sup> Pu	W	1.1
<sup>241</sup> Am	W	1.0
<sup>243</sup> Am	W	1.0
<sup>242</sup> Cm	W	30.0
<sup>244</sup> Cm	W	1.9
<sup>252</sup> Cf	Y	3.9

<sup>1</sup>(W) Weekly, (Y) Yearly

### References

- B1. U.S. Department of Energy. *Internal Dose Conversion Factors for Calculation of Dose to the Public*, DOE/EH-0071, July 1988.

## **APPENDIX C**

### **Glossary**

**10-160B Packaging** – An NRC-certified TypeB transportation packaging used for transportation of TRU wastes.

**Acceptable knowledge** – Any information about the process used to generate waste, material inputs to the process, and the time period during which the waste was generated, as well as data resulting from the analysis of waste, conducted prior to or separate from the waste certification process authorized by EPA's Certification Decision, to show compliance with Condition 3 of the certification decision (Appendix A of this part) (40 CFR §194.2 and §194.67).

**Activity** – A measure of the rate at which a material emits nuclear radiation, usually given in terms of the number of nuclear disintegrations occurring in a given length of time. The common unit of activity is the curie, which amounts to 37 billion ( $3.7 \times 10^{10}$ ), disintegrations per second. The International Standard unit of activity is the becquerel and is equal to one disintegration per second.

**Administrative controls** – Provisions relating to organization and management, procedures, record keeping, assessment, and reporting necessary to ensure the safe operation of the facility.

**Atomic energy defense activities** – Activities of the Secretary of Energy (and predecessor agencies) performed in whole or in part in carrying out any of the following functions: naval reactors development; weapons activities, including defense inertial confinement fusion; verification and control technology; defense nuclear material production; defense nuclear waste and materials by-product management; defense nuclear materials security investigations; and defense research and development.

**Authorization basis** – Those aspects of the facility design and operational requirements relied upon by DOE to authorize the operation of nuclear facilities and processes.

**Characterization** – Sampling, monitoring, and analysis - whether by review of AK, nondestructive examination, NDA, or RC to identify and quantify the constituents of a waste material.

**Chemical compatibility** – Assessing the properties of chemicals in a payload container (>1 weight percent); there must be no adverse safety or health hazards produced as a result of any mixtures that occur.



**Completeness** – The percentage of measurements made that are judged to be valid measurements. The completeness goal is to generate a sufficient amount of valid data based on program needs. Valid results for radioassay and radiography data are those that were obtained when the laboratory or testing facility demonstrated that the instrumentation and method were in control; that is, that all calibration, verification, interference, and zero matrix checks met acceptance criteria.

**Compressed gas** – Compressed gases are those materials defined as such by 49 CFR Part 173, Subpart G.

**Contact-handled transuranic waste** – Transuranic waste with a surface dose rate not greater than 200 millirem per hour (Reference 2, Section 2[3]).

**Contact-handled Transuranic Waste Authorized Methods for Payload Control (CH-TRAMPAC)** – The governing document for shipments in the Transuranic Package Transporter-II (TRUPACT-II) and HalfPACT packagings (Reference 24, Section 1).

**Content code** – A uniform system applied to waste forms to group those with similar characteristics for purposes of shipment in the TRUPACT-II, TRUPACT-III, HalfPACT, and RH-TRU 72-B packagings.

**Corrosive/Corrosivity** – A solid waste exhibits corrosivity if a sample of the waste is either aqueous and has a pH  $\leq 2$  or  $\geq 12.5$ , or it is a liquid and corrodes steel at a rate  $> 6.35$  mm (0.250 inch) per year at a test temperature of 55° (130°F) (40 CFR §261.22).

**Criticality control overpack** – A packaging configuration consisting of a steel 55-gallon drum containing a vented criticality control container confinement vessel that is centrally positioned within the drum by laminated plywood dunnage (Reference 48, Section 4.6).

**Curie** – A unit of activity equal to 37 billion ( $3.7 \times 10^{10}$ ) disintegrations per second.

**Disposal** – Permanent isolation of TRU waste from the accessible environment with no intent of recovery, whether or not such isolation permits the recovery of such waste (Reference 2, Section 2[5]).

**Dose conversion factor** – A numerical factor used in converting radionuclide uptake (curies) in the body to the resultant radiation dose (rem).

**Dose equivalent rate** – The radiation dose equivalent delivered per unit time (e.g., rem per hour).

**Drum** – Includes 55-gallon, 85-gallon, and 100-gallon drums as described in the CH-TRAMPAC and HWFP.

**Fissile gram equivalent** – An isotopic mass of radionuclide normalized to  $^{239}\text{Pu}$ .

**Fissile material** – Any material consisting of or containing one or more radionuclides that can undergo neutron-induced fission with neutrons of essentially zero kinetic energy (e.g., thermal neutrons), such as  $^{233}\text{U}$ ,  $^{235}\text{U}$ , and  $^{239}\text{Pu}$ .

**HalfPACT** – An NRC-certified Type B transportation packaging used for transportation of CH TRU wastes.

**Hazardous waste** – Those wastes that are designated hazardous by EPA (or state) regulations. For a detailed description, see 40 CFR §261.3. Hazardous wastes are listed in 20.4.1 New Mexico Administrative Code (NMAC), subpart II (40 CFR Part 261), and/or exhibit one of the four characteristics in 20.4.1 NMAC, subpart II (40 CFR Part 261) (i.e., ignitability, corrosivity, reactivity, and toxicity).

**Headspace** – The total contained volume of a container minus the volume occupied by the waste material.

**Headspace gas** – The gas within the headspace of a container.

**Internal container** – A container inside the outermost container examined during radiography or VE. Drum liners, liner bags, plastic bags used for contamination control, capillary-type lab ware, and debris not designed to hold liquid at the time of original waste packaging are not internal containers (Reference 10, Part 1, Section 1.5.17).

**Lower Limit of Detection** – The level of radioactivity which, if present, will yield a measured value greater than the critical limit with a 95% probability. The critical limit is defined as that value which measurements of the background will exceed with a 5% probability.

**Machine-compacted waste** – Waste whose volume has been reduced using a mechanical process.

**Minimum detectable activity** – The minimum detectable activity is the smallest amount of radioactivity in a sample that can be detected with a 5% probability of erroneously detecting radioactivity, when in fact none was present (Type I error) and also, a 5% probability of not detecting radioactivity, when in fact it is present (Type II error).

**Observable liquid** – Liquid that is observable using radiography or VE as specified in Permit Attachment C, Waste Analysis Plan (Reference 10, Part 1, Section 1.5.18).

**Overpack** – A container put around another container.

**Package** – (1) A packaging plus its contents. (2) The reusable Type B shipping container (e.g., TRUPACT-II, TRUPACT-III, HalfPACT, RH-TRU 72-B, or 10-160B), loaded with TRU waste payload containers, which has been prepared for shipment in accordance with the package QA program. (3) In the regulations governing the transportation of radioactive materials, the packaging, together with its radioactive contents, as presented for transport.

**Packaging** – The reusable Type B shipping container for transport of TRU waste payload containers (e.g., TRUPACT-II, TRUPACT-III, HalfPACT, RH-TRU 72-B, or 10-160B).

**Packaging quality assurance program** – A WCP document that defines the quality assurance and quality control activities applicable to usage of the NRC-approved packaging. This program shall meet the requirements of 10 CFR Part 71, Subpart H.

**Payload container** – The outermost container (e.g., a drum, shielded container, SLB2, SWB, TDOP, or canister) for TRU waste material that is placed in a reusable Type B shipping container (e.g., a TRUPACT-II, TRUPACT-III, HalfPACT, RH-TRU 72-B, or 10-160B) for transport.

**Payload assembly** – An assembly of payload containers qualified for transport in a TRUPACT-II, HalfPACT, or 10-160B.

**PCB bulk product waste** – Waste derived from manufactured products containing PCBs in a non-liquid state, at any concentration where the concentration at the time of designation for disposal was  $\geq 50$  ppm PCBs. PCB bulk product waste does not include PCBs or PCB items regulated for disposal under § 761.60(a) through (c), § 761.61, § 761.63, or § 761.64 (References 13 and 40 CFR § 761.3).

**Pipe overpack** – A packaging configuration consisting of a vented cylindrical pipe component surrounded by dunnage within a vented 55-gallon drum with a rigid polyethylene liner and vented lid.

**Plutonium-239 equivalent activity** – An equivalent radiotoxic hazard of a radionuclide normalized to  $^{239}\text{Pu}$ .

**Precision** – A measure of mutual agreement among individual measurements of the same property made under prescribed similar conditions, often expressed as a standard deviation or relative percent difference.

**Pyrophoric** – Materials that may ignite spontaneously in air or that emit sparks when scratched or struck, especially with materials such as steel. A flammable solid that, under transport conditions, might cause fires through friction or retained heat or that can be ignited readily and, when ignited, burns vigorously and persistently so as to create a serious transportation hazard. Included in the pyrophoric definition are spontaneously combustible materials, water reactive materials, and oxidizers. Examples of nonradioactive pyrophorics are organic peroxides, sodium metal, and chlorates.

**Radioassay** – Methods used to identify and quantify radionuclides in TRU waste. Radioassay includes NDA and RC.

**Radiography** – A nondestructive testing method that uses X -rays to inspect and determine the physical form of waste.

**Radionuclide** – A nuclide that emits radiation by spontaneous transformation.

**Remote-handled transuranic waste** – Transuranic waste with a surface dose rate of 200 millirem per hour or greater. (Reference 2, Section 2[12])

**Remote-handled Transuranic Waste Authorized Methods for Payload Control (RH-TRAMPAC)** – The governing document for shipments in the RH-TRU 72-B packaging (Reference 41, Section 1).

**RH-TRU Waste Canister** – Container that is transported in the RH-TRU 72-B Cask.

**RH-TRU 72-B Packaging** – An NRC-certified Type B transportation packaging used for transportation of RH TRU wastes.

**Shielded container** – A metal payload container authorized for use within the HalfPACT packaging, that has been tested by DOE to meet DOT Specification 7A Type A requirements. It is approximately the same size as a standard 55-gallon drum, contains one 30-gallon steel drum, and incorporates a nominal one-inch layer of lead lining to shield waste forms with high gamma energies. Although the shielded container is managed during handling, shipment, storage, and disposal as a CH payload container, the waste contained in a shielded container is characterized and inventoried in the WWIS database as RH waste.

**Shipper** – A TRU waste site that releases an NRC-approved package to a carrier for shipment to the WIPP.

**Shipping category** – A shipping category is defined by the following parameters: chemical composition of the waste (waste type), gas generation potential of the waste material type (quantified by the g-value for hydrogen), and gas release resistance (type of payload container and type and maximum number of confinement layers used).

**Sites** – Department of Energy TRU waste generator or storage sites.

**Standard large box 2** – A specialized metal payload container with a top-loading and a bottom-loading option for use within the TRUPACT-III packaging, that has been tested by DOE to meet DOT Specification 7A Type A requirements.

**Standard waste box** – A metal payload container authorized for use within the TRUPACT-II and HalfPACT packaging, that has been tested by DOE to meet DOT Specification 7A Type A requirements.

**Summary category group** – Used to segregate TRU-mixed wastes into broad groups having similar physical forms. The summary category groups include homogeneous solids (S3000) that are at least 50 percent by volume solid process residues, soil/gravel (S4000) that is at least 50 percent by volume soil/gravel, and debris (S5000) that is at least 50 percent by volume materials that meet the criteria specified in 20.4.1.800 New Mexico Administrative Code (incorporating 40 CFR §268.2(g)). Categorization is based on the Summary Category Group constituting the greatest volume of waste for a waste stream (Reference 10, Attachment C).

**Ten-drum overpack** – A metal payload container authorized for use within the TRUPACT-II packaging, that has been tested by DOE to meet DOT Specification 7A Type A requirements.

**Trace chemicals/materials** – Chemicals/materials that occur individually in the waste in quantities less than 1 weight percent. The total quantity of chemicals/materials not listed as allowed materials for a given waste material type in any payload container is restricted to less than 5 weight percent (References 24 and 25, Section 4.3.1; Reference 41, Section 4.3.1).

**TRU isotope** – An isotope of any element having an atomic number greater than uranium (i.e., 92).

**TRU waste** – Waste containing more than 100 nCi of alpha-emitting TRU isotopes per gram of waste, with half-lives greater than 20 years, except for (1) high-level radioactive waste, (2) waste that the Secretary has determined, with the concurrence of the Administrator, does not need the degree of isolation required by the disposal regulations, or (3) waste that the NRC has approved for disposal on a case-by-case basis in accordance with 10 CFR Part 61 (Reference 2, Section 2[18]).

**TRU-mixed waste** – TRU waste that is also a hazardous waste as defined by the Hazardous Waste Act and 20.4.1.200 NMAC (incorporating 40 CFR §261.3) (Reference 10, Part 1, Section 1.5.7).

**TRUPACT-II** – An NRC-certified Type B transportation packaging used for transportation of CH TRU wastes.

**TRUPACT-III** – An NRC-certified Type B transportation packaging used for transportation of CH TRU wastes in the SLB2 container.

**TRUPACT-III Transuranic Waste Authorized Methods for Payload Control (TRUPACT-III TRAMPAC)** – The governing document for shipments in the TRUPACT-III packaging (Reference 25, Section 1).

**Verification** – The act of authenticating or formally asserting the truth that a process, item, data set, or service is, in fact, that which is claimed. Data verification is the process used to confirm that all review and validation procedures have been completed.

**Waste Acceptance Criteria** – Constraints (limits) on the physical, chemical, and radiological properties of TRU waste and its packaging as determined by WIPP's authorization basis requirements. TRU waste will not be approved for shipment to and disposal at the WIPP until it has been certified as meeting these criteria. Waste acceptance criteria ensure that TRU waste is managed and disposed of in a manner that protects human health and safety and the environment.

**Waste analysis plan** – The waste analysis plan includes test methods, details of planned waste analysis for complying with the general waste analysis requirements of 20.4.1.500 NMAC (incorporating 40 CFR §264.13), a description of the waste shipment screening and verification process, and a description of the QA/QC program. WCPs are required to implement the applicable requirements of the WAP.

**Waste characterization** – The process of determining that TRU waste meets the requirements of the WAC by the acceptable performance of the activities defined by CBFO-approved WCP plans.

**Waste certification** – Formal and documented declaration by WCPs that waste has been characterized and meets the requirements of the WIPP WAC.

**Waste matrix code** – A DOE-developed coding system for grouping waste streams that have similar matrix constituents, especially for treatment objectives. This coding system allows waste streams within the DOE TRU waste system that have similar physical and chemical waste form properties to be categorized together (Transuranic Waste Baseline Inventory Report, DOE/CAO-95-1121).

**Waste stream** – A waste stream is waste materials that have common physical form, that contain similar hazardous constituents and that are generated from a single process or activity (Reference 10, Attachment C).

**WIPP Certified Program (includes CCP by site and the contractor for the AMWTP)** – A program that has undergone initial certification and annual recertification audits conducted by the CBFO to verify the adequacy of procedures reflecting program requirements (compliance), implementation of the procedures (procedure adherence), and the effectiveness of the procedures (desired result) (Reference 4, Chapter 18, Section 18.4).

**WIPP Waste Information System** – A computerized data management system used by WIPP to gather, store, and process information pertaining to CH and RH TRU waste destined for or disposed of at WIPP. The WWIS database is a subsystem of the WDS (Reference 23, Waste Data System Definitions).

## **APPENDIX D**

### **Payload Container Integrity Checklist**



The operator is to visually examine 100% of the payload container exterior to determine if the payload container meets the criteria of sections 3.2.1 and 4.2.1. At a minimum, WCPs shall incorporate the questions and criteria contained in the following checklist into applicable procedures. This payload container inspection shall be performed and documented as a part of the loading process. Any "YES" answer on the inspection checklist will result in the operator discontinuing the inspection, marking the payload container as unacceptable for shipment, and removal of the payload container from the shippable inventory. Before the rejected container can be shipped, it must undergo appropriate corrective actions (e.g., evaluation, repackaging, overpacking, etc.), as applicable. All containers must have an acceptable and complete inspection checklist documenting that it meets the DOT 7A criteria.

CONTAINER EXAMINATION		DISCUSSION OF CRITERIA	COMPLIANCE	
			YES	NO
1.	Is the payload container obviously degraded?	Obviously degraded means clearly visible and potentially significant defects in the payload container or payload container surface.		
2.	Is there evidence that the payload container is, or has been, pressurized?	Pressurization can be indicated by a fairly uniform expansion of the sidewalls, bottom or top. Past pressurization can be indicated by a notable outward deflection of the bottom or top. Verify that the payload container is not warped.		
3.	Is there any potentially significant rust or corrosion such that wall thinning, pin holes, or breaches are likely or the load bearing capacity is suspect?	<p>Rust shall be assessed in terms of its type, extent, and location. Pitting, pocking, flaking, or dark coloration characterizes potentially significant rust or corrosion. This includes the extent of the payload container surface area covered, thickness, and if it occurs in large flakes or built-up (caked) areas. Rusted payload containers may not be accepted if:</p> <ul style="list-style-type: none"> <li>• Rust is present in caked layers or deposits</li> <li>• Rust is present in the form of deep metal flaking, or built-up areas of corrosion products</li> </ul> <p>In addition, the location of rust should be noted; for example on a drum: top lid; filter region; locking chine; top one-third, above the second rolling hoop; middle one-third, between the first and second rolling hoops; bottom one-third, below the second rolling hoop; and on the bottom.</p> <p>Payload containers may still be considered acceptable if the signs of rust show up as:</p> <ul style="list-style-type: none"> <li>• Some discoloration on the payload container</li> <li>• If rubbed would produce fine grit or dust or minor flaking (such that wall thinning does not occur)</li> </ul>		
4.	<p>Are any of the following apparent?</p> <ul style="list-style-type: none"> <li>• wall thinning</li> <li>• pin holes</li> <li>• breaches</li> </ul>	Wall thinning, pin holes, and breaches can be a result of rust/corrosion (see discussion for #3).		

CONTAINER EXAMINATION		DISCUSSION OF CRITERIA	COMPLIANCE	
5.	Are there any split seams, tears, obvious holes, punctures (of any size), creases, broken welds, or cracks?	Payload containers with obvious leaks, holes or openings, cracks, deep crevices, creases, tears, broken welds, sharp edges or pits, are either breached or on the verge of being breached. Verify that there is no warpage that could cause the container to be unstable or prevent it from fitting properly in the applicable package.		
6.	Is the load-bearing capacity suspect?	The load-bearing capacity could be reduced for excessive rust (see discussion for #3), wall thinning (see discussion for #4), breaches, cracks, creases, broken welds, etc. (see discussion for #5).		
7.	Is the payload container improperly closed?	Inspect the fastener and fastener ring (chine) if applicable for damage or excessive corrosion. Check the alignment of the fastener to ensure that it is in firm contact around the entire lid and the payload container will not open during transportation.		
8.	Are there any dents, scrapes, or scratches that make the payload container's structural integrity questionable or prevent the top and bottom surfaces from being parallel?	Deep gouges, scratches, or abrasions over wide areas are not acceptable. If top and bottom surfaces are not parallel, this would indicate that the container is warped. Dents should be less than ¼ inch deep by 3 inches long and between ½ inch to 6 inches wide. All other dents must be examined to determine impact of structural integrity.		
9.	Is there discoloration which would indicate leakage or other evidence of leakage of material from the payload container?	Examine the payload container regions near vents, top lid fittings, bottom fittings, welds, seams and intersections of one or more metal sheets or plates. Payload containers must be rejected if evidence of leakage is present.		
10.	Is the payload container bulged?	For the purposes of this examination, bulging is indicated by: <ul style="list-style-type: none"> <li>• A fairly uniform expansion of the sidewalls, bottom, or top (e.g., in the case of a drum, either the top or bottom surface protrudes beyond the planar surface of the top or bottom ring,</li> <li>• A protrusion of the side wall (e.g., in the case of a drum, beyond a line connecting the peaks of the surrounding rolling hoops or a line between a surrounding rolling hoop and the bottom or top ring), or</li> <li>• Expansion of the sidewall (e.g., in the case of a drum, such that it deforms any portion of a rolling hoop).</li> </ul>		

## References

- D1. INEEL Engineering Design File. “*Waste Container Integrity Evaluation for Storage*”, EDF-RWMC-705, September 25, 1996. Idaho National Engineering and Environmental Laboratory, Idaho Falls, ID.
- D2. Title 49 CFR Part 173, Subpart 475. “Quality Control Requirements Prior to Each Shipment of Class 7 (Radioactive) Materials.” *Code of Federal Regulations*, Washington, D.C., Office of the Federal Register, National Archives and Records Administration. (<https://www.law.cornell.edu/cfr/text/49/173.475>)
- D3. DOE/RL-96-57, Section 2.5.5. “Test & Evaluation Document for the U.S. Department of Transportation Specification 7A Type A Packaging.” (Formerly WHC-EP-0558). (<https://rampac.energy.gov/docs/default-source/default-document-library/doe-rl-96-57-volume-2-rev-0-d.pdf?sfvrsn=2>)

## **APPENDIX E**

### **Payload Management of TRU Alpha Activity Concentration**

## E.1 Scope

The policies and methods for the management of TRU alpha activity concentration within each TRU waste payload container disposed of at WIPP are set out below. They are based on the definition of TRU waste in the WIPP LWA, Public Law 102-579. The WIPP LWA defines TRU waste as:

“...waste containing more than 100 nanocuries of alpha emitting transuranic isotopes per gram of waste, with half lives greater than 20 years...” (Sec. 2(18))

This appendix pertains specifically to the payload management of TRU alpha activity concentration of waste containers selected for overpacking.

## E.2 Policies

The National TRU Waste Program has established the following policies for managing TRU alpha activity concentration in compliance with the WIPP LWA (References E1, E2, and E3):

- The TRU alpha activity concentration limit for TRU waste (>100 nCi/g) applies to the TRU waste stream as a whole.
- Waste containers belonging to a TRU waste stream may vary in their TRU alpha activity concentration, some containing >100 nCi/g and some containing ≤100 nCi/g. Using process knowledge in combination with radioassay measurements to determine the presence of transuranic isotopes within the waste stream, WCPs define a TRU waste stream based on its potential to include waste containers with a TRU alpha activity concentration in excess of 100 nCi/g.
- Waste containers belonging to the same TRU waste stream may be overpacked into a payload container (e.g., SWB or TDOP) provided the TRU alpha activity concentration of the payload container exceeds 100 nCi/g.

## E.3 Prerequisites for Implementation

- Each waste container selected for payload management must be part of the TRU waste stream identified in the AK summary report for that waste stream (References E2 and E3).
- WCPs shall submit to the CBFO, for its review and approval, applicable plans and procedures for making TRU waste determinations based on payload management practices that involve the overpacking of waste containers (Reference E2).

- CBFO will notify EPA of DOE sites seeking such authorization prior to CBFO's approval of a WCP to manage TRU alpha activity concentration using payload management. The WIPP will not accept payload managed waste for disposal until EPA has received notice (Reference E3).

#### **E.4 Implementation and Practice**

- Each TRU waste stream selected for payload management must include in its acceptable knowledge summary report an estimate of the total waste volume and the percentage of the waste volume that is above and below 100 nCi/g. (It should be noted that this information, although based on the best available AK information, is preliminary and subject to the performance of WIPP certified radiological characterization processes and cannot and will not be used as a measure of AK accuracy) (Reference E3).
- Each waste container selected for payload management must contain at least one TRU isotope (e.g., <sup>238</sup>Pu, <sup>239</sup>Pu, <sup>240</sup>Pu, <sup>242</sup>Pu, etc.) whose activity exceeds the LLD of the radioassay system used to characterize the waste (References E2 and E3). The applicability of LLD will vary from system to system and may be on a container basis. Sections 3.3.1 and A.3 of this document provide the applicable requirements for determining and reporting LLDs.
- Each waste container selected for payload management may only be overpacked into a payload container with other waste containers from the same TRU waste stream.
- The TRU alpha activity concentration of the payload container is determined according to sections 3.3.3 and 4.3.3 of this document.

#### **E.5 References**

- E1. Public Law 102-579, 106 Stat.4777, 1992 (as amended by Public Law 104-201, 1996). Waste Isolation Pilot Plant Land Withdrawal Act.  
(<http://www.wipp.energy.gov/library/cra/baselinetool/documents/regulatory%20tools/10%20WIPPLWA1996.pdf>)
- E2. Letter to Mr. Frank Marcinowski (Director, Office of Radiation and Indoor Air, U.S. Environmental Protection Agency) from Dr. Ines R. Triay (Manager, Carlsbad Field Office, U.S. Department of Energy), August 4, 2003.
- E3. Letter to Dr. Ines R. Triay (Manager, Carlsbad Field Office, U.S. Department of Energy) from Mr. Frank Marcinowski (Director, Office of Radiation and Indoor Air, U.S. Environmental Protection Agency), August 8, 2003.

## **APPENDIX F**

### **Radiography Requirements for Contact-Handled Transuranic Waste for EPA Compliance**

## F.1 Radiography Requirements for Contact-Handled Waste

Radiography aids in the examination and identification of containerized waste. All activities required to achieve radiography objectives shall be described in WCP documents. These documents shall include instructions specific to the radiography systems used at the DOE site. This appendix applies to radiography of CH waste; requirements for radiography of RH waste are found in the WCPIP.

A radiography system (e.g., real-time radiography or digital radiography/computed tomography) normally consists of an X-ray producing device, an imaging system, an enclosure for radiation protection, a waste container handling system, an audio/video recording system, and an operator control and data acquisition station. Although these six components are required, it is expected there will be some variation within a given component between DOE sites. The radiography system shall have controls or an equivalent process which allow the operator to control image quality. On some radiography systems, it should be possible to vary the voltage to provide an optimum degree of penetration through the waste.

To perform radiography, the waste container is scanned while the operator views the video monitor. An audio/video recording shall be made of the waste container scan and is maintained as a non-permanent record. An approved radiography data form shall also be completed to document the waste matrix code (WMC), to verify there are no prohibited items including observable liquid in excess of the waste acceptance criteria limit, and to identify waste components including packaging materials for the purposes of estimating their weights and assigning waste material parameters to the container's contents.

The estimated waste material parameter weights for CH waste should be determined by compiling an inventory of waste items and packaging materials. The items on this inventory should be sorted by waste material parameter and combined with a standard weight look-up table to provide an estimate of waste material parameter weights.

Containers whose contents prevent full examination during radiography shall be subject to visual examination. If AK for the waste stream suggests that visual examination would provide no additional relevant information for that container, the reason(s) for the inability to perform full identification shall be recorded on the radiography data form with the supporting AK referenced.

For containers which contain classified shapes and undergo radiography, the radiography recording shall be considered classified information. The radiography data forms will not contain classified information.



## F.2 Radiography Training

The radiography system involves qualitative and semiquantitative evaluations of visual displays. Operator training and experience are the most important considerations for assuring quality controls in regard to the operation of the radiography system and for interpretation and disposition of radiography results. Only trained and qualified radiography operators shall be allowed to operate radiography equipment.

Standardized training and qualification requirements for radiography operators shall be based upon existing industry standard training requirements and shall comply with the training and qualification requirements of this waste acceptance criteria document and the CBFO QAPD.

The WCP shall develop a training program that provides radiography operators with both formal and on-the-job training (OJT). At each TRU waste site, the WCP radiography operators shall be instructed in the AK description of TRU waste, specific waste generating practices, typical packaging configurations, and associated waste material parameters expected to be found in each WMC at the DOE site. The OJT and apprenticeship shall be conducted by an experienced, qualified radiography operator prior to qualification of the training candidate. The WCP training programs shall be site-specific due to differences in equipment, waste configurations, and the level of waste characterization efforts. For example, certain DOE sites use digital radiography equipment, which is more sensitive than real-time radiography equipment. In addition, the particular physical forms and packaging configurations at each DOE site will vary; therefore, radiography operators shall be trained on the types of waste that are generated, stored, or characterized at that particular DOE site.

The training program shall contain the following elements:

- Project Requirements
- State and Federal Regulations
- Basic Principles of Radiography
- Radiographic Image Quality
- Radiographic Scanning Techniques
- Application Techniques
- Radiography of Waste Forms
- Standards, Codes, and Procedures for Radiography
- Site-Specific Instruction

The training program shall also contain OJT, which addresses:

- System Operation
- Identification of Packaging Configurations
- Identification of Waste Material Parameters
- Weight and Volume Estimation
- Identification of Prohibited Items

Radiography training containers shall contain items common to waste streams currently being characterized at the DOE site.

Radiography training containers will be examined using the same processes and procedures as those used for examining TRU and TRU-mixed waste. The procedures may be modified as necessary to allow use with the training containers. The examination criteria for training containers will be the same as for actual waste containers. The pass/fail criteria for the examination will be consistent with the original qualification criteria. Contents of the training containers will reflect the waste stream description of one or more of the waste streams currently or expected to be examined at the DOE site. Training containers will be reconfigured semiannually.

Training container examinations shall be performed by each operator semiannually. The audio/video recording and data form shall then be reviewed by a subject matter expert (SME) to ensure that operators' interpretations remain consistent and accurate. Imaging system characteristics shall be verified on a routine basis.

Qualifications of radiography operators shall, at a minimum, encompass the following requirements:

- Successfully pass a comprehensive exam with a score of 80% or greater based upon training enabling objectives. The comprehensive exam will address all of the radiography operations, documentation, characterization and procedural elements stipulated in this WAC.
- Perform a training container examination in the presence of an appointed WCP radiography SME. The person will be an experienced radiography operator who is also qualified as an OJT trainer.

Requalifications of operators are based on evidence of continued satisfactory performance (primarily SME or audio/video recording reviews), and shall be done at least every two years. Unsatisfactory performance will result in disqualification. Satisfactory operator performance is defined as the acceptable identification of prohibited items including observable liquid in excess of the waste acceptance criteria limit, the estimation of waste material parameter weights as evaluated by the SME, and a score of  $\geq 80\%$  on the comprehensive written exam. Retraining and demonstration of satisfactory performance are required before a disqualified operator is again allowed to operate the radiography system.

In summary, the operator qualification process is as follows:

- Initial qualification
  - Includes formal and on-the-job (OJT) training. A subject matter expert (SME) will provide oversight of the OJT and apprenticeship to ensure satisfactory knowledge and practical performance.

- Successful examination of a training container in the presence of an SME.
  - Successfully pass a comprehensive written exam with a score of 80% or greater.
- Semiannual continuing education refresher training
  - Successful examination of a training container in the presence of an SME or an audio/video recording review by a supervisor.
- Biennial requalification (every two years)
  - Successful examination of a training container in the presence of an SME or an audio/video recording review by a supervisor.
  - Successfully pass a comprehensive written exam with a score of 80% or greater.

Successful examination of a training container is defined as the acceptable identification of the WMC and prohibited items including observable liquid in excess of waste acceptance criteria limits, the assignment of waste items to waste material parameters, and their estimated weights, as evaluated by a radiography SME.

### **F.3 Quality Control**

Independent replicate scans and replicate observations of the video output of the radiography process shall be performed under uniform conditions and procedures. Independent replicate scans shall be performed on one waste container per day or once per testing batch, whichever is less frequent. Independent observation of one scan (not the replicate scan), shall be made once per day or once per testing batch, whichever is less frequent, by a qualified radiography operator other than the individual who performed the first examination. A testing batch is a suite of waste containers undergoing radiography using the same testing equipment. A testing batch can be up to 20 waste containers without regard to waste matrix.

Oversight functions include periodic audio/video recording reviews of accepted waste containers by a qualified radiography operator other than the operator who dispositioned the waste container. The results of this independent verification shall be made available to the radiography operator.

### **F.4 Data Review and Validation**

A testing batch data report for data validation and QA purposes is required when radiography is used to characterize waste. A testing batch data report (or equivalent), includes data pertaining to radiography for up to 20 waste containers or samples.

All measurement data must be reviewed and approved by qualified personnel prior to being reported. Reviews shall meet the requirements of the QAPD. At a minimum, the

data must be reviewed by an independent technical reviewer and approved by the SPM. This review shall be performed by an individual other than the data generator who is qualified to have performed the initial work. The independent technical reviewer shall verify, at a minimum, the following information:

- Data generation and reduction were conducted in a technically correct manner in accordance with the methods used (verification of procedure and revision).
- Data were reported in the proper units and correct number of significant figures.
- Calculations have been verified by a valid calculation program, a spot check of verified calculation programs, and/or 100 percent check of all hand calculations.
- Values that are not verifiable to within rounding or significant difference discrepancies must be rectified prior to completion of independent technical review.
- The data have been reviewed for transcription errors.
- The testing QA documentation for batch data reports is complete and includes, as applicable, raw data, calculation records, calibration records (or references to an available calibration package), list of containers in the batch, and QC sample results. Corrective action will be taken to ensure that all batch data reports are complete and include all necessary raw data prior to completion of the independent technical review.
- QC sample results are within established control limits and, if not, the data have been appropriately dispositioned using the nonconformance process.
- Radiography tapes have been reviewed (independent observation) on a waste container basis at a minimum of once per testing batch or once per day of operation, whichever is less frequent.
- The container contains no indication that there are prohibited items including observable liquid in excess of this waste acceptance criteria, and that the physical form matches the WMC.
- The appropriate quality assurance objectives (QAOs) have been met as defined in the operating procedure.

All data must be approved by the SPM. The SPM shall verify, at a minimum, the following information:

- Data generation-level independent technical review, validation, and verification have been performed as evidenced by the completed review checklists and appropriate signature release. Batch data review checklists are complete.

- Batch data reports are complete and data are properly reported (e.g., data are reported in the correct units and with the correct number of significant figures).
- Data meet all applicable QAOs.

The SPM shall provide a SPM Summary and a Data Validation Summary for each batch data report. These reports may be combined and shall consist of a detailed checklist documenting that the batch has been adequately reviewed and that the data meet program objectives.

To ensure that data of known and documented quality are generated, each participating measurement facility shall implement a documented facility QA program. Facility QA programs shall specify qualitative and quantitative acceptance criteria for the QC checks of this program, and corrective actions to be taken when these criteria are not satisfied. Only appropriately trained and qualified personnel shall be allowed to perform data validation/review.

## **APPENDIX G**

### **Visual Examination Requirements for Contact-Handled Transuranic Waste for EPA Compliance**

## **G.1 Visual Examination Requirements for Contact-Handled Waste**

This appendix applies to visual examination requirements for CH waste; requirements for visual examination of RH waste are found in the WCPIP.

Contact-handled waste container contents may be verified directly by performing VE on the waste container contents. Visual examination may also be performed during packaging or repackaging of waste.

Visual examination does not require audio/video recordings of the examination; the examination is documented on a data form and certified with signatures from two qualified VE operators. If the second operator cannot verify the descriptions of the first operator, corrective actions will be taken in accordance with the established QA Program.

Visual examination shall be conducted to describe all contents of a waste container and includes estimated or measured weights of the contents. The description shall clearly identify all discernible waste items, packaging materials, and waste material parameters in the waste container. Visual examination activities shall be documented on VE data forms.

Visual examination video/audio recordings of containers that contain classified shapes shall be considered classified information. Visual examination data forms will not contain classified information.

## **G.2 Visual Examination Training**

Visual examination shall consist of a semiquantitative and qualitative evaluation of the waste container contents and may be recorded on audio/video recording media. Standardized training for VE shall be developed to include both formal classroom training and OJT. Personnel performing VE shall be instructed in the specific waste generating processes, typical packaging configurations, and the waste material parameters expected to be found in each WMC at the DOE site. The OJT and apprenticeship shall be conducted by an operator experienced and qualified in VE prior to qualification of the candidate. The WCP training shall be site-specific to include the various waste configurations at the DOE site. For example, the particular physical forms and packaging configurations at each DOE site will vary so operators shall be trained on types of waste that are generated, stored, or characterized at that particular DOE site. Visual examination operators need only be trained to the physical forms and packaging configurations used on the waste stream that they are examining and packaging. Visual examination personnel shall be requalified once every two years.

Training shall address the following required elements:

- Project Requirements
- State and Federal Regulations
- Application Techniques
- Site-Specific Instruction

Training shall also include OJT that addresses:

- Identification of Packaging Configurations
- Identification of Waste Material Parameters
- Weight and Volume Estimation
- Identification of Prohibited Items, including Observable Liquid in Excess of the Waste Acceptance Criteria Limit

Each visual examination facility shall designate one or more VE experts. The VE expert shall be familiar with the waste generating processes that have taken place at the DOE site and will also be familiar with all types of waste being characterized at that site. The VE expert shall be responsible for the overall direction and implementation of the visual examination at that facility. The VE expert shall receive training in the same elements as the visual examination personnel, including both formal training and OJT.

Qualification of a VE expert shall be based on familiarity with waste generating processes, familiarity with the types of waste being characterized, and meeting the training requirements discussed above. Consistent with other VE personnel, the VE expert shall be requalified once every two years. WCP documents shall specify the selection, qualification and training requirements for the VE expert.

### **G.3 Method**

Visual examination recorded on video/audio media shall meet the following minimum requirements:

- The video/audio media shall record the waste packaging event for the container such that all waste items placed into the container are recorded in sufficient detail and shall contain an inventory of waste items in sufficient detail that another trained visual examination operator can identify the associated waste material parameters.
- The video/audio media shall capture the waste container identification number
- The personnel loading the waste container shall be identified on the video/audio media or on packaging records traceable to the loading of the waste container
- The date of loading of the waste container will be recorded on the video/audio media or on packaging records traceable to the loading of the waste container.



Visual examination performed using two operators shall meet the following minimum requirements:

- At least two WCP personnel who witnessed the packaging of the waste shall approve the data forms or packaging records attesting to the contents of the waste container
- The data forms or packaging records shall contain an inventory of waste items in sufficient detail that a trained VE operator can identify the associated waste material parameters
- The container identification number shall be recorded on the data forms or packaging records.

A description of the waste container contents shall be recorded on a VE data form. The description shall clearly identify all waste material parameters and provide enough information to estimate weights of waste material parameters. In cases where bags are not opened, a brief written description of the contents of the bags shall contain an estimate of the amount of each waste type in the bags. The written records of VE shall be supplemented with the audio/videotape recording, if applicable.

#### **G.4 Data Review and Validation**

A testing batch data report for data validation and QA purposes is required when VE is used to characterize waste. A testing batch data report (or equivalent) includes data pertaining to VE for up to 20 waste containers or samples.

All measurement data must be reviewed and approved by qualified personnel prior to being reported. Reviews shall meet the requirements of the QAPD. At a minimum, the data must be reviewed by an independent technical reviewer and approved by the SPM. This review shall be performed by an individual other than the data generator who is qualified to have performed the initial work. The independent technical reviewer shall verify, at a minimum, the following information:

- Data generation and reduction were conducted in a technically correct manner in accordance with the methods used (verification of procedure and revision).
- Data were reported in the proper units and correct number of significant figures.
- Calculations have been verified by a valid calculation program, a spot check of verified calculation programs, and/or 100 percent check of all hand calculations.
- Values that are not verifiable to within rounding or significant difference discrepancies must be rectified prior to completion of independent technical review.

- The data have been reviewed for transcription errors.
- The testing QA documentation for batch data reports is complete and includes, as applicable, raw data, calculation records, and list of containers in the batch. Corrective action will be taken to ensure that all batch data reports are complete and include all necessary raw data prior to completion of the independent technical review.
- There is no indication of prohibited items in the container including observable liquid in excess of this waste acceptance criteria and the physical form matches the WMC.
- The appropriate QAOs have been met.

All data must be approved by the SPM. The SPM shall verify, at a minimum, the following information:

- Data generation-level independent technical review, validation, and verification have been performed as evidenced by the completed review checklists and appropriate signature release. Batch data review checklists are complete.
- Batch data reports are complete and data are properly reported (e.g., data are reported in the correct units and with the correct number of significant figures).
- Data meet all applicable QAOs.

The SPM shall provide a SPM Summary and a Data Validation Summary for each batch data report. These reports may be combined and shall consist of a detailed checklist documenting that the batch has been adequately reviewed and that the data meet program objectives.

To ensure that data of known and documented quality are generated, each participating measurement facility shall implement a documented facility QA program. Facility QA programs shall specify qualitative and quantitative acceptance criteria for the QC checks of this program, and corrective actions to be taken when these criteria are not satisfied. Only appropriately trained and qualified personnel shall be allowed to perform data validation/review.

**APPENDIX H**  
**Enhanced Acceptable Knowledge**

## H.1 Introduction

After the 2014 radiological release event, several new activities and process enhancements were established. One of these enhancements was to provide additional controls over the collection, verification, and validation of AK, thus resulting in a more robust AK program referred to as Enhanced Acceptable Knowledge (Reference 4, Chapter 18.4.2.1). Use of these newly established controls by the WCPs is expected to ensure the receipt of WIPP WAC compliant waste containers.

## H.2 Interface Waste Management Documents List (IWMDL)

The IWMDL, which is generated by the WCP, identifies DOE site plans, procedures, and reports associated with current waste management and packaging (e.g., waste management, waste generation, waste treatment, waste packaging, waste repackaging, waste remediation, waste stream delineation, and waste characterization procedures) to be reviewed before containers are added to the Waste Containers List or Container Tracking Spreadsheet in order to continue characterization activities. TRU waste will not be provided to the WCP until the IWMDL is updated with the latest version of the procedure.

Procedure verification will include the review of waste management and packaging activities performed under the procedures listed on the IWMDL. This “walk down” for the initial list of documents included in the list, and new procedures added to the list, will involve observing the performance of procedural steps implemented by the DOE site relating to the management of prohibited items, including potentially reactive, corrosive, ignitable, and incompatible TRU waste materials. Subsequent revisions to documents on the list will be reviewed by the AK Expert. Changes affecting waste management or packaging will be verified with the cognizant points of contact and/or SMEs on the IWMDL.

The IWMDL, including changes to the list, will be approved by the WCP. Changes to procedures on the list will be concurred upon by the WCP prior to shipment of waste containers certified under the subject changes.

The IWMDL will be initiated and maintained as described for each waste stream. In addition, the IWMDL identifies the generator POCs/SMEs from the groups directly involved with the generation, characterization, and management of containers in the waste stream and will:

- Identify active and planned site operations with input from the SMR that directly affect the waste stream management and packaging of the waste stream; including, as applicable
  - Waste packaging and repackaging processes (including the remediation of prohibited items),

- Waste treatment/processing (e.g., waste neutralization, deactivation, and solidification/immobilization),
- Waste inspection, testing, and characterization activities,
- Record the relevant generator site documents on the Interface Waste Management Documents List; including, as applicable:
  - Facility Safety and Analysis Reports,
  - Standard operating procedures,
  - Work and test plans,
  - Work/field instructions (e.g., field changes, intermediate field changes, and timely orders/standing orders),
  - Sampling and analysis plans, and
  - Physical and chemical studies/evaluations.
- WCP verify with the SMR that the list is complete AND that the list identifies the most current revision for each document.
- A review will be completed of new and revised procedures or documents potentially affecting the waste stream management and packaging associated with the activities and ensure the Interface Waste Management Documents List is updated, as needed.
- The SMR will identify the generator POCs/SMEs for each document/procedure and include the contact information in the IWMDL. The completed IWMDL is required prior to offering to the WCP.
- IMWDL must be reviewed quarterly by the SMR and SPM for notifications for waste streams expected to generate additional containers of TRU waste or if containers in the waste stream will be repackaged or remediated. Revision to the IWMDL can serve to meet the Quarterly SMR Notification requirement.

### **H.3 Certified Program Enhanced Chemical Compatibility Evaluation**

As part of the process for characterizing and certifying TRU waste for disposal at WIPP, it is necessary to consider the range of possible chemical combinations that could occur in each waste stream. Potential adverse chemical reactions (e.g., generation of heat, fire, explosion, or toxic fumes) that stem from combining potentially incompatible chemicals must be evaluated to support safe and compliant waste management. To expand upon this evaluation, chemical compatibility has been enhanced to require

formal documentation and generation of a chemical compatibility evaluation memo (CCEM) for the waste stream, or sub-population of the waste stream, as needed. The CCEMs are written by the WCPs using procedural requirements based on the method described in the 1980 EPA method EPA-600/2-80-076, "A Method for Determining the Compatibility of Hazardous Wastes" (EPA Method). The CCEM will document and communicate the evaluation including the conclusions. CCEMs concluding the potential for chemical incompatibility will provide the basis for placing an administrative hold on the affected waste via issuance of a nonconformance report (NCR). CCEMs concluding the potential for chemical incompatibility are provided to the CBFO for information only. CCEMs concluding that the waste is acceptable are provided to CBFO for formal review and approval.

- The concentrations typically represent a qualitative and conservative estimate of the highest potential amount of a chemical/material in any individual container. When the AK is not conclusive to make this categorization, the more conservative (higher) quantity shall be assigned. Quantity estimations for the chemicals/materials identified in a waste stream may also be based on quantitative data if available.
- A determination of which Trace chemicals and materials are present in insignificant quantities.
- Based on the specific chemical/material use and management described in the AK record, assess the "Trace" chemical materials to determine those that are insignificant and do not require additional evaluation and document the justification and assumptions for this determination in the CCEM. The justification(s) for this determination for each chemical and material may include, but are not limited to the following examples:
  - Chemicals/materials included only in historical waste already emplaced at WIPP.
    - Chemicals/materials that have been segregated from the waste stream resulting in only incidental insignificant contamination.
    - Process chemicals and products introduced in such minute quantities (e.g., drops of indicators and dilute analytical standard solutions) that they would result in only insignificant waste contamination.
    - Chemicals present in the waste stream in low ppm concentrations based on analytical or other characterization data.
    - Process chemicals that are reacted or consumed during use (e.g., experiment oxidants, reductants, and buffers). The AKE must consider the use of excess reagents in these instances.
- Assignment of Reactivity Group Numbers (RGNs) to chemicals and materials of concern will be coordinated with the Payload Engineer Team responsible for

RGN assignment during TRUCON code development. The Payload Engineer Team is responsible for maintaining the List of RGNs for Chemicals/Materials in the TRU Waste Inventory (Master RGN List). The Master RGN List will be updated as chemicals and materials are evaluated during the development of the CCEMs and subsequent TRUCON code development.

- The primary focus of this evaluation is to assess potential reactions between dominant and minor constituents. However, some trace components could produce significant exothermic reactions even in small quantities without the proper actions being taken to mitigate the hazards associated with these compounds. For this reason, all trace chemicals that could not be determined to be insignificant must be evaluated for compatibility regardless of concentration.
- For compound(s) that cannot be found in the EPA Method, coordination with the Payload Engineer Team to assign the most appropriate RGN(s) based on its chemical class (functional group) or reactive properties based on review of chemical literature, MSDS, SDS, or industry documentation and reports is required.
- Inorganic chemical or material determined to be a non-reactive compound that is not listed in the EPA Method or Listed in the Master RGN list, the RGN will be determined to be Not Applicable (NA) and the justification for this determination must be documented in the CCEM.
- For purposes of the CCEM, “incompatible” refers to chemicals and materials that when mixed can lead to adverse hazardous chemical reactions described in 40 CFR 264.17(b) (General Requirements for Ignitable, Reactive, or Incompatible Wastes) and the 1980 EPA method. Thus, compatible chemicals and materials (including those referred to as non-reactive in this evaluation) may react slowly over time, and even generate heat, but will not lead to unanticipated or disastrous effects such as (1) generate extreme heat or pressure, fire or explosions, or violent reactions, (2) produce uncontrolled toxic mists, fumes, dusts, or gases in sufficient quantities to threaten human health or the environment; (3) produce uncontrolled flammable fumes or gases in sufficient quantities to pose a risk of fire or explosions; (4) damage the structural integrity of the device or facility; (5) through other like means threaten human health or the environment.

#### **H.4 Basis of Knowledge for Evaluating Oxidizing Chemicals in TRU Waste**

The Basis of Knowledge Document will be provided by CBFO and implemented in conjunction with the AK procedures of the WCPs. The Basis of Knowledge Document will specify when waste with oxidizing chemicals is acceptable as is, or when treatment will be required along with the treatment that must be performed.

## H.5 Certified Program Acceptable Knowledge Assessments

To ensure that the AK documentation relating to the management of potentially reactive, corrosive, ignitable, and incompatible TRU waste materials is adequate, current, and accurately described in existing AK Summary Reports, a onetime AK assessment will be performed for waste streams having a currently certified container in a waste stream that has a population of unshipped containers. New AK Summary Reports and the supporting documentation must address all of the evaluation parameters described in this section or an AK assessment must be performed and include:

- The review of the existing AK documentation associated with the historic and current waste management activities relating specifically to TRU waste generation, packaging, treatment, remediation, and characterization, focusing on the use of absorbents, immobilization products, and neutralization reagents for the waste stream.
- The review of existing AK for the special testing and management activities associated with suspect materials included in each waste stream.
- An assessment of revisions of waste management and packaging procedures bounded by the inventory to identify any relevant changes associated with these activities described in the AK Summary Report.
  - AK records associated with commercial products used (e.g., MSDSs, SDSs, and other manufacture's information)
- The Acceptable Knowledge Assessment Memorandum includes the following, as applicable:
  - Waste stream summary (brief description of the waste stream and generating activities),
  - Historic waste management practices,
  - Current waste management practices,
  - Waste remediation and repackaging practices,
  - Absorbent, immobilization, and neutralization reagents,
  - Container specific documentation collected and reviewed,
  - New and revised AK source documents,
  - AKA conclusions, assumptions, and limitations, and
  - List of containers bounded by the evaluation.



- The AKA will be reviewed by the SMR and designated generator site POCs/SMEs for of the accuracy and completeness of practices and procedures under their purview controlling the generation and management (e.g., waste repackaging, remediation, treatment) of the subject waste containers described by the AKA.

#### **H.6 AK Briefings**

- AK Briefing updates are required when the AK Summary Report requires revision due to changes in the waste stream characteristics (physical, chemical, or radiological composition) or packaging configuration. Include a discussion of the waste management and packaging activities verified during preparation of the current Interface Waste Management Documents list prepared for the waste stream. The AKE/SPM must emphasize the importance of maintaining current procedures in the AK record.
- AK Briefings are prepared and presented the generator POCs/SMEs, or cognizant designees. The participation of these site representatives from the groups directly involved with the generation, characterization, and management of containers in the waste stream will further ensure that the description of the waste streams in the AK Summary Reports are complete and accurate.
- The AK Briefing presentations shall include the following topics for each new waste stream:
  - Mission and Generating Facility Information, including process(es) generating the waste
  - Waste Stream Description and Information, including description of physical waste composition, WMPs, Waste Matrix Code
  - Radiological Characteristics
  - Chemical Characteristics
  - Suspected Prohibited Items
  - Waste Packaging

**APPENDIX I**

**Previously Certified Waste Preclusion  
of Shipments**

All currently certified waste containers in the complex following prior to shipment:

- Certified Program will implement an enhanced AK process including an enhanced chemical compatibility evaluation for the waste streams, or waste stream sub-populations, and submits to CBFO for review.
- Certified Programs will implement the Basis of Knowledge document in the AK process for evaluating oxidizing chemicals in TRU waste streams to determine acceptability or need for treatment.
- CBFO will concur with enhanced chemical compatibility evaluation and implementation of the Basis of Knowledge for the evaluated waste stream.
- CBFO will approve waste streams with acceptable enhanced chemical compatibility evaluation documentation provided by the Certified Programs.
- WIPP M&O Contractor Payload Engineers will evaluate TRUCON codes to ensure compliance with the enhanced chemical compatibility evaluation.
- The WIPP M&O Contractor will implement additional checks in the WDS for each container before those containers can be used to populate payloads in WDS.
- The WIPP M&O Contractor will obtain written approval from CBFO prior to release of waste streams for shipment.
- The WIPP M&O Contractor will verify each container requested is part of a CBFO-approved waste stream and authorizes shipment in WDS.